

User manual IM1 – Multi-function device

Measuring inputs: Direct voltage, Direct current, Pt100(0), Counter Thermocouple, Frequency, Rotation speed,



Technical features:

- red display of -1999...9999 digits (optional: green, orange or blue display)
- digit height 14 mm
- display adjustment via factory presetting or directly on the sensor signal
- min/max-memory
- 9 adjustable supporting points
- display flashing at threshold value exceedance/undercut
- Tara-function
- sliding averaging
- two relay outputs
- · programming interlock via access code
- protection class IP65 at the front
- pluggable screw terminal
- accessories: PC-based configuration software incl. CD and USB-adapter for devices without keypad and for a simple adjustment of standard devices.

Identification

STANDARD-TYPES

Multi-function measuring inputs Housing size: 72x36 mm

ORDER NUMBER

IM1-6UR4B.000X.772xD IM1-6UR4B.000X.572xD

Options - break-down order key:

| | I | IM | 1- | 6 | υ | R | 4 | В. | 0 | 0 | 0 | Χ. | 7 | 7 | 2 | x | D | |
|-------------------------------|---|----|----|---|---|---|---|----|---|---|---|----|---|---|---|---|---|---|
| Standard type M-Line | | | | | | | | | | | | | | | | | | Operation D physical unit |
| Installation depth | | | | | | | | | | | | | | | | | | |
| 100 mm incl. plug-in terminal | 1 | | | | | | | | | | | | | | | | | Version A A |
| Housing size | | | | | | | | | | | | | | | | | | _ |
| 72x36x71 mm (WxHxD) | 6 | | | | | | | | | | | | | | | | | Switching points 2 2 relay outputs |
| Display type | | | | | | | | | | | | | | | | | | |
| Multi-function measuring | U | | | | | | | | | | | | | | | | | Protection class 1 no keypad, operation via |
| Display colours | | | | | | | | | | | | | | | | | | PC-software PM-TOOL |
| Green | G | | | | | | | | | | | | | | | | | 7 IP65 / plug-in terminal |
| Red | R | | | | | | | | | | | | | | | | | |
| Orange | Υ | | | | | | | | | | | | | | | | | Voltage supply |
| Blue | В | | | | | | | | | | | | | | | | | 7 24 VDC, galv. not isolated 5 230 VAC |
| Number of digits | | | | | | | | | | | | | | | | | | |
| 4-digit | 4 | | | | | | | | | | | | | | | | | Measuring input X Voltage, Current, |
| Digit height | | | | | | | | | | | | | | | | | | Frequency |
| 14 mm | В | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | Analog output |
| Interface without | 0 | | | | | | | | | | | | | | | | | 0 without |
| | | | | | | | | | | | | | | | | | | Sensor supply |
| | | | | | | | | | | | | | | | | | | |

Please state physical unit by order, e.g. mbar

Contents

| 1. | Brief description | 1 |
|----|---|----|
| 2. | Assembly | 1 |
| 3. | Electrical connection and connection examples | 2 |
| | 3.1. Terminal pin assignment | 2 |
| | 3.2. Connection examples | 3 |
| | 3.2.1. Voltage / Current | 3 |
| | 3.2.2. Pt100 / Pt1000 / Thermocouple | 6 |
| | 3.2.3. Frequency / Rotation speed | 7 |
| | 3.2.4. Counter | 9 |
| 4. | Description of function and operation | 10 |
| | 4.1. Operating and display elements | 10 |
| | 4.2. Programming software PM-TOOL | 11 |
| 5. | Setting-up the device | 12 |
| | 5.1. Switching on | 12 |
| 6. | Parameterisation | 12 |
| | 6.1. Selection of input signal, Type | 12 |
| | 6.1.1. Voltage/Current, VOLT, AMPE | 13 |
| | Setting of the final and initial value, END, ENDA, OFFS, OFFA | 14 |
| | Setting of the decimal point, DOT.A | 14 |
| | Zero point slowdown of the input signal, ZERO | 14 |
| | Taring value, TARA | 14 |
| | Overflow/underflow behaviour, OVER | 14 |
| | Input of supporting points for linearisation of the measuring signal, SPC.A | 15 |
| | 6.1.2. Pt100, Pt1000, Thermocouple, PT.SW, THER | 15 |
| | Temperature device in °C/°F, UNIT | 16 |
| | Impedance matching, OFFS | 16 |
| | 6.1.3. Pulse measuring, IMPU | 16 |
| | 6.1.3.1. Frequency measurement, FREQ | 16 |
| | Pulse triggering, I.TYP | 17 |
| | Range of frequency, RANG | 18 |
| | Filter, FILT | 18 |
| | Adjustment of final and initial value, END, ENDF, OFFS, OFFF | 18 |
| | Adjustment of the decimal point, DOT.F | 18 |
| | Taring value, TARA | 18 |
| | Input of supporting points for linearisation of the measuring signal, SPC.F | 18 |

| 6.1.3.2. Rotation speed, TURN | 19 |
|--|----|
| Pulse triggering, I.TYP | 19 |
| Filter, FILT | 19 |
| Pulse per revolution, PPT | 19 |
| Time base, TIME | 19 |
| 6.1.3.3. Counter upwards/downwards, CO.UP, CO.DN | 21 |
| Pulse triggering, I.TYP | 21 |
| Counter base / Input signal, CO.BA | 22 |
| Wing, EDGE | 22 |
| Prescaler, PRES | 22 |
| Display value and pulse final numerical value, END, END.C | 22 |
| Reset value, RST | 22 |
| 6.2. General device parameter | 23 |
| Adjustment of measuring time, SEC | 23 |
| Adjustment of the sliding average value, GLM | 23 |
| Presentation of initial/final value in the display, DI.HI, DI.LO | 23 |
| Allocation of functions onto the navigation keys, TAST | 23 |
| Display flashing at threshold value exceedance/undercut, FLAS | 23 |
| 6.3. Alarm parameter | 24 |
| Limit value behaviour, A1.FU, A2.FU | 25 |
| Report of limit value errors, A1.ER, A2.ER | 25 |
| Adjustment of the switching threshold, A1.LI, A2.LI | 25 |
| Adjustment of the hysteresis, A1.HY, A2.HY | 25 |
| Upper limit value, A1.LO, A2.LO | 25 |
| Lower limit value, A1.HI, A2.HI | 25 |
| Drop off delay, A1.OF, A2.OF | 25 |
| Activation delay, A1.ON, A2.ON | 25 |
| 6.4. Safety parameter – locking of the parameterisation | 26 |
| Assignment of individual numerical codes, CODE | 26 |
| Activation/Deactivation of the programming interlock, RUN | 26 |
| 7. Reset to default values | 26 |
| Setting back the parameter onto delivery condition | |
| 8. Technical data | 27 |
| 9. Safety advices | 30 |
| 10. Error elimination | 31 |


1. Brief description

The panel instrument **IM1-6U** is a 4-digit device for measuring of different kind of measuring signals such as direct voltage/direct current, temperature and frequency. The configuration happens via 3 front keys or via the optional PC-software PM-TOOL. An integrated programming interlock prevents unrequested changes of the parameter and can be released again via an individual code. Two integrated relay outputs control limit values and report them to an superior master display. The electrical connection happens on the rear side via plug-in terminals.

Selectable functions like e.g. the recall of the min/max-value, Tara-function, averaging, a direct change of the limit value in operating mode and additional measuring supporting points for linearisation complete the concept of a modern device.

2. Assembly

Please read the *Safety instructions* on *page 30* before installation and keep this user manual for future reference.

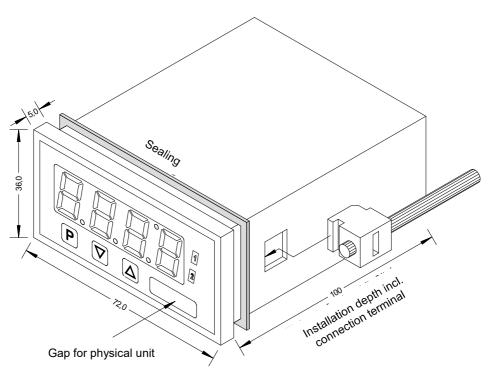


- 1. After removing the fixing elements, insert the device.
- 2. Check the seal to make sure it fits securely.
- 3. Click the fixing elements back into place and tighten the clamping screws by hand. Then use a screwdriver to tighten them another half a turn.


CAUTION! The torque should not exceed 0.1 Nm!

3. Electrical connection

3.1. Terminal pin assignment

Type **IM1-6UR4B.000X.570xD** – supply 230 VAC 50/60 Hz Type **IM1-6UR4B.000X.770xD** – supply 24 VDC galv. isolated

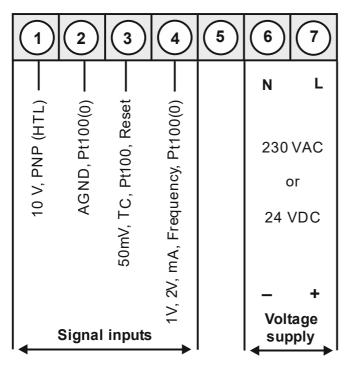

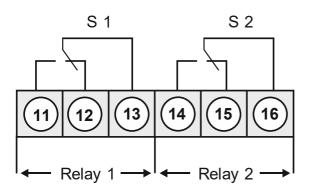


3.2. Connection examples


Below please find some connection examples, which demonstrate some practical applications:

3.2.1. Current / Voltage


2-wire sensor 4...20 mA

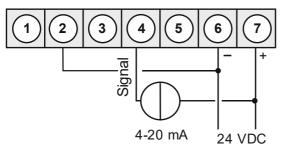


2-wire sensor 4...20 mA with external voltage source

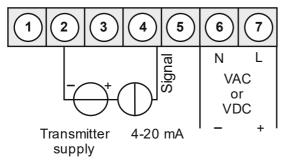


3-wire sensor 0/4...20 mA

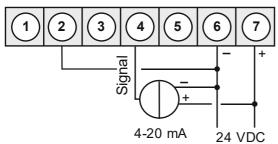


3-wire sensor 0/4...20 mA with external voltage source

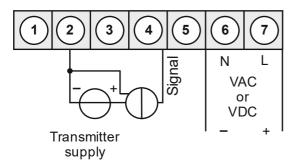


3-wire sensor 0/1/2...10 V

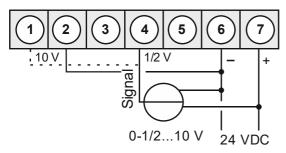


3-wire sensor 0-1/2...10 V with external voltage supply

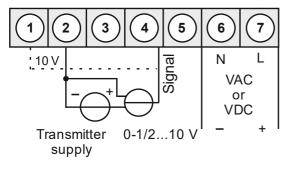

4-wire sensor 0/1/2...10 V, 50 mV

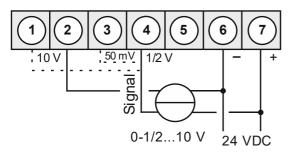


3-wire sensor 0-1/2...10 V, 50 mV with external voltage supply

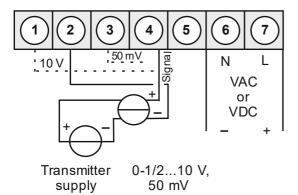


3.2.2. Temperature


Pt100 wire

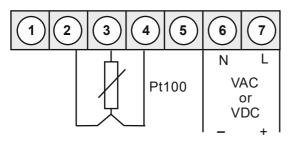

Pt1000 2-wire

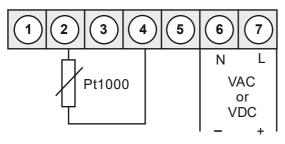


Thermocouple

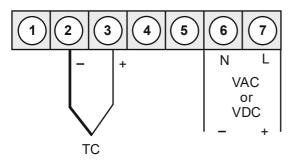


3.2.3. Frequency / Rotation speed


Encoder with TTL-output

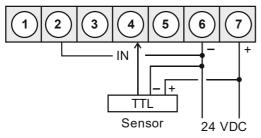


Encoder with external voltage source and TTL-output

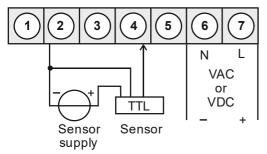


Encoder with PNP-output

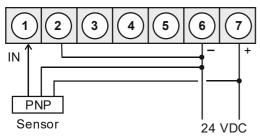


Encoder with NPN-output and required external resistance

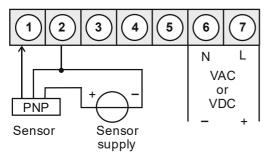


Encoder with NPN-output

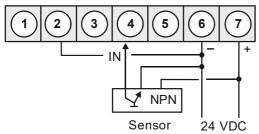


Encoder with external voltage source and NPN-output

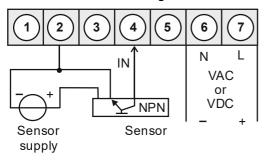


Encoder with NPN-output and necessary external resistance

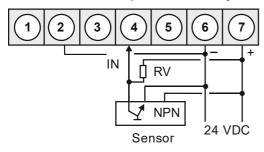


Encoder with external voltage source, NPN-output and necessary external resistance

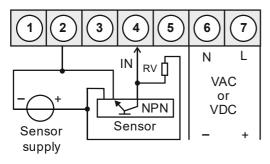


Encoder with PNP-output and external resistance circuit

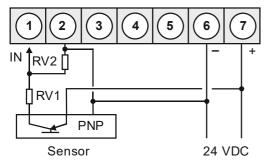

Encoder with external supply, PNP-output and external resistance circuit

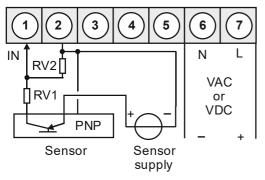


Encoder with external supply, Namur output

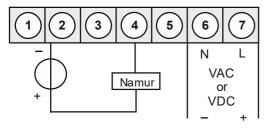

3.2.4. Counter

If the device is used as counter, please use the connection examples for frequency/rotation speed and follow the examples given below for a performed reset input:

Manual setting back via external feeler

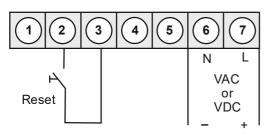

4. Description of function and operation


4.1. Operating and display elements

The device comes with three keys, which are used for parameterisation of the device and whose deposited functions can be called up during operation. Functions, that can be adjusted or changed are always signalised by a flashing of the display. Adjustments that were made in the "Parameterisation level" are always confirmed with **[P]** and thus saved. The device saves however automatically all adjustments and changes back into operating mode, if no more key actuation takes place within 10 seconds.

| Key symbol | Function in operating mode | Function at parameterisation | | |
|------------------------|---|--|--|--|
| Program key [P] | Change the parameterisation with program key [P] . | Change into a lower parameterisation level or to deposited values. | | |
| Minus key [▼] | Depending on adjusted key functions, use the minus-key [▼] for calling up the min-value or changing a lower limit value. | Change between parameter and changing of parameter within the value level. | | |
| Plus key [▲] | Depending on adjusted key functions, use the plus-key [▲] for calling up the min-value or changing a lower limit value. | Change between parameter and changing of parameter within the value level. | | |

A switched-on relay or an activated switching point will be reported optically by a flashing of the respective switching point LED next to the 7-segment display. A display overflow/underflow is displayed by four bars "- - - -,...

 Example: Setting up the device parameter, e.g. selection of the input signal



Example: Setting up numerical values, e.g. final value of measuring range



Numerical values are adjusted from the smallest to the highest digit with $[\blacktriangle]$ [\forall] and confirmed digit per digit with [P]. A minus sign can only be adjusted on the leftmost digit. After the last digit, the display changes back into menu-level.

4.2. Programming via configuration software PM-TOOL USB:

The software comes on CD incl. an USB-cable with a device adapter. The connection happens via a micro USB connector plug on the back and the PC is connected via an USB connector plug.

System requirements: PC with USB interface

Software: Windows XP, Windows Vista

With this tool the device configuration can be created, skipped and saved on the PC. Via the easy to handle program surface the parameter can be changed, whereat the mode of operation and the possible selection options can be preset via the program.

CAUTION!

During parameterisation with connected measuring signal, make sure that the measuring signal has no mass supply to the programming plug. The programming adapter is galvanic not isolated and directly connected with the PC. Via polarity of the input signal, a current can discharge via the adapter and destroy the device as well as other connected components!

5. Setting up the device

5.1. Switching on

Once the installation is complete, start the device by applying the voltage supply. Check beforehand once again that all the electrical connections are correct.


Starting sequence

For 1 second during the switching-on process, the segment test ($B \ B \ B \ B$) is displayed, followed by an indication of the software type and, after that, also for 1 second, the software version. After the start-up sequence, the device switches to operation/display mode.

6. Parameterisation

6.1. Selection of the input signal: type

During the type adjustment, an allocation of the input version takes place. Here, one can select between 5 input types: Voltage, Current, Pt100(0), Thermocouple and Pulse signal.

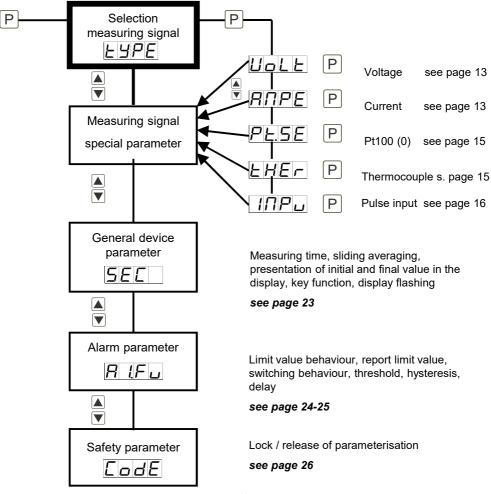

6.1.1. Device parameter for the allocation of voltage/current signals: VoLt, AMPE

VoLt: 4 voltage signals are available: 0-10 V, 0-2 V, 0-1 V and 0-50 mV AMPE: Choose between the following signals: 0-20 mA and 4-20 mA

| Pa | rameter | Menu item | | | | Default |
|------|---------|-----------|------|--------------|------|---------|
| VoLt | Uolt | 0-10 | 0-2 | <u>0</u> - 1 | 0-50 | 0-10 |
| | | SEn.U | | | | |
| AMPE | ΠΠΡΕ | 0-20 | 4-20 | SEn.A | | 0-20 |

| Pa | rameter | Menu item | | | | Default |
|-------|---------|-------------|------------|--------|------|---------|
| End | End | -1999 | to | 9999 | | 1000 |
| | with | SEn.U or | additional | no[A | | |
| | WILLI | SEnR | additional | ERL | | |
| OFFS | OFFS | -1999 | to | 9999 | | |
| | with | SEn.U | additional | noER | | |
| | WITT | or 5En.A | adunional | ERL | | |
| dot.A | doĿ.A | | to | 0.000 | | |
| EndA | EndR | -19.99 | to | 99.99 | | 10.00 |
| OFFA | DFFR | 79.99 | to | 99.99 | | 00.00 |
| tArA | LRrR | -999 | to | 9999 | | |
| ZErO | 2E-0 | | to | 99 | | |
| OUEr | DUEr | no | RdC | r An G | 5 Pr | |
| | | 10Pr | | | | no |
| SPC.A | SPE.R | | to | 5 | | |

| Pa | rameter | Menu item | | | Default |
|-------|----------|-----------|----|------|---------|
| SPC.A | di 5.1 | -1999 | to | 9 | |
| dIS.1 | 1 n P. 1 | -1999 | to | 9999 | |
| InP.1 | di 5.2 | -999 | to | 9999 | |
| | | | to | | |
| diS.9 | dl 5.9 | -1999 | to | 9999 | |
| InP.9 | 1 nP.9 | -1999 | to | 9999 | |

End / OFFS: Upper range value/lower range value

By use of these values, the desired display value can be allocated to the measuring signal. If **Sen.V** or **Sen.A** was selected as the input type, you can choose between **noCA** and **CAL**. With **noCA**, the previously set display value is adopted, with **CAL** the adjustment is carried out over the measuring section and the analog input value is adopted.

dot.A: Comma / decimal place

Determine the decimal representation of the display value with the decimal point. It is used for the adjustment of the limit values, too.

EndA / OFFA: Rescale the measuring input values

With this function the final value/initial value can be rescaled to e.g. 19.5 mA / 3.2 mA without application of the measuring signal.

tArA: Setting up the Tara-/Offset value

The preset value is added to the linearised value. So the characteristic line can be shifted by the selected amount.

ZErO: Zero-point slowdown

Here, a range of values around the zero-point can be preset, where the display shows a zero. If e.g. a 10 is adjusted, the display would show a zero within a range of value of -10 to +10 and continue below with -11 and above with +11.

OVEr: Overflow and underflow behaviour

The over-/underflow of the measuring input will be signaled by 4 horizontal bars at the top respectively by 4 bars at the bottom. Exception is input type **"4-20**" (mA), where a measurand smaller than 1 mA can already be valuated as underflow. This shall indicate a sensor failure.

| no | No additional check of the range takes place. By leaving the display range, the display remains on the smallest value dI.Lo respectively highest value dI.HI . |
|-------|--|
| AdC | At exceedance/undercut of the display range dl.Lo / dl.Hl over-/underflow will be displayed. |
| rAnG | The measuring signal needs to be exactly in the preset measuring range EnD/OFFS , so that an overflow will not be detected. The display range and transformer range will be monitored additionally. |
| 5 Pr | The measuring signal is monitored over \pm 5% of the adjusted measuring range. The display range will be monitored additionally. |
| 10 Pr | The measuring signal is monitored over \pm 10% of the adjusted measuring range. The display range will be monitored additionally. |

SPC.A: Number of additional supporting points

To linearise nonlinear sensor values, 9 additional supporting points can be defined for the initial and final value. Only the activated supporting point parameters are shown.

dIS1...dIS9: Display values for supporting points

Under this parameter supporting points are defined on a value basis.

INP1...INP9: Analog values for supporting points


The supporting points are always preset according to the selected input signal ma/V. Here, desired analog values can be freely adjusted in ascending order.

6.1.2. Device parameter for the allocation of Pt100(0), Thermocouple: Pt.SE, tHEr

Pt.SE: Three types are available:

Pt.Lo: Pt100 3-wire -50.0...200.0°C / -58.0...392.0°F Pt.Hi: Pt100 3-wire -200...850°C / -328...1562°F Pt.tH: Pt1000 2-wire -200...850°C / -328...1562°F

tHEr: Select between: Thermocouple types L, J, K, B, S, N, E, T, R

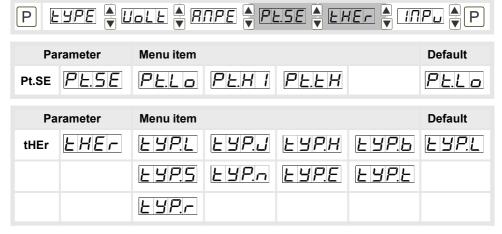

| Pa | rameter | Menu item | | | Default |
|------|---------|-----------|----|------|---------|
| Unlt | Un IE | σĽ | oF | | ٥٢ |
| OFFS | OFFS | - 19.9 | to | 19.9 | |
| | | - 35.9 | to | 35.9 | 000.0 |

Unit: Type of temperature metering

Chose, if the temperature shall be displayed in °C or °F with Unlt.

OFFS: Impedance matching

The value alignment at a temperature measuring in °C can be adjusted between -20,0 and +20,0 and for a later measurement in °F between -36 and +36. If the measuring type is changed later, the value will be rounded.

General device parameter see page 23 Alarm parameter see page 24 Safety parameter for lock / release of parameterisation see page 26

6.1.3. Device parameter for the allocation of pulse signals: IMPU

FrEq: Frequency measuring of TTL-signals, PNP-/NPN-sensors.

tUrn: Rotation speed measurement (simplified adjustment option) of TTL-signals, PNP-/NPN-sensors. A flow rate can be scaled with this function, too.

CO.up: Counter input (upwards) for TTL-signals, PNP-/NPN-sensors.

CO.on: Counter input (downwards) for TTL-signals, PNP-/NPN-sensors.

6.1.3.1. Frequency measurement

| PŁ | P LYPE A UOLE A RAPE A PLSE A LHER A MPU A P | | | | | | | |
|-------|--|-----------|-------|---------|------|---------|--|--|
| Pa | rameter | Menu item | | Default | | | | |
| IMPu | ПΡц | FrE9 | | | | | | |
| Pa | rameter | Menu item | | | | Default | | |
| I.tYP | le yp | EEL | nPn | PnP | nRП | EEL | | |
| rAnG | r Rn G | 9.999 | 99.99 | 9999 | 9999 | 9999 | | |
| FILt | FILE | no | 2 | 5 | 10 | no | | |
| | | 20 | 50 | 100 | 200 | | | |
| | | 500 | | | | | | |

| Pa | rameter | Menu item | | | Default |
|-------|-------------|-----------|----|-------|---------|
| End | End | -1999 | to | 9999 | 1000 |
| OFFS | OFFS | -1999 | to | 9999 | 0000 |
| dot.F | doĿ.F | | to | 0.000 | |
| End.F | EndF | 00.00 | to | 9999 | 1000 |
| OFF.F | DFF.F | 00.00 | to | 9999 | 0000 |
| tArA | <u>LAra</u> | 4999 | to | 9999 | |
| SPC.F | SPE.F | | to | 9 | |
| dIS.1 | di 5. i | -1999 | to | 9999 | |
| InP.1 | 1 n P. 1 | -1999 | to | 99.99 | |
| | | | to | | |
| diS.9 | di 5.9 | 1999 | to | 9999 | |
| InP.9 | I nP.9 | 1999 | to | 9999 | |

I.tYP: Pulse signal There a three modes for the triggering of the pulse input:

| ttL | Active TTL-signals with approx. 0.8 V lower and approx. 2 V upper threshold. |
|-----|--|
| nPn | Passive switching contact; it operates the internal pull-up depending on the rate. |
| PnP | Active sensor output. A pull-down is operated in the device. |
| nAM | Namur input Low <1,5mA, High > 2,5mA |

rAnG: Selection of the frequency range

A selection of four frequency ranges is available:

| 9.999 | 09,999 Hz (automatic software filter on 100 Hz/5 ms) |
|-------|--|
| 99.99 | 099,99 Hz (automatic software filter on 500 Hz/5 ms) |
| 999.9 | 0999,9 Hz |
| 9999 | 09999 Hz (approx. 10 kHz) |

FILt: Limitation of the pulse length

For contact bounce suppression of mechanical contacts via selection of the filter frequency.

| no | no particular evaluation of the pulse length |
|-----|--|
| 2 | 2 Hz with pulse-duty factor 1:1 => minimal pulse length 250 ms |
| 5 | 5 Hz with pulse-duty factor 1:1 => minimal pulse length 100 ms |
| 10 | 10 Hz with pulse-duty factor 1:1 => minimal pulse length 50 ms |
| 20 | 20 Hz with pulse-duty factor 1:1 => minimal pulse length 25 ms |
| 50 | 50 Hz with pulse-duty factor 1:1 => minimal pulse length 10 ms |
| 100 | 100 Hz with pulse-duty factor 1:1 => minimal pulse length 5 ms |
| 500 | 500 Hz with pulse-duty factor 1:1 => minimal pulse length 1 ms |

End / OFFS: Upper range value/lower range value

By use of this pair of values, the desired display value can be allocated to the measuring signal.

dot.F: Comma / decimal place

Determine the decimal representation of the display value with the decimal point. It is used for the adjustment of the limit values, too.

End.F / OFF.F: Rescale the measuring input values

Here, the final value/initial value can be rescaled without application of the measuring signal.

tArA: Setting up the Tara-/Offset value

The preset value is added to the linearised value. This way, the characteristic line can be shifted by the selected amount.

SPC.F: Number of additional supporting points

To linearise nonlinear sensor values, 9 additional supporting points can be defined for the initial- and final value. Only the activated supporting point parameter are shown.

dIS1...dIS9: Display values for supporting points

Under this parameter supporting points are defined on a value basis.

INP1...INP9: Analog values for supporting points

The supporting points are always preset according to the selected input signal ma/V. Here, desired analog values can be freely adjusted in ascending order.

Π

6.1.3.2. Rotation speed measurement

As more than 80% of frequency measurement applications are referring to a rotation speed, there is a simplified adjustment mode available via type "Turn". A flow rate can be scaled with this function, too.

| Parameter | Menu item | | | | Default |
|----------------------|-----------|-------|------|-------------|---------|
| IMPu /ПРц | Lurn | | | | |
| | | | | | |
| Parameter | Menu item | | | | Default |
| I.tYP <u>(Е У</u> Р | EEL | nPn | PnP | ~ <i>80</i> | EEL |
| FILt FILE | no | 2 | 5 | 10 | no |
| | 20 | 50 | 100 | 200 | |
| | 500 | | | | |
| PPt | 000 / | to | 9999 | | |
| tIME <u> </u> | SEC | [] In | hour | | |

I.tYP: Pulse signal

dot

dot

There are three modes for the triggering of the pulse input:

 \Box

| ttL | Active TTL-signals with approx. 0.8 V lower and approx. 2 V upper threshold. |
|-----|--|
| nPn | Passive switching contact; it operates the internal pull-up depending on the rate. |
| PnP | Active sensor output. A pull-down is operated in the device. |
| nAM | Namur input Low <1,5 mA, High > 2,5 mA |

to

0.000

FILt: Limitation of the pulse length

For contact bounce suppression of mechanical contacts via selection of the filter frequency:

| no | No particular evaluation of the pulse length. |
|-----|---|
| 2 | 2 Hz with pulse-duty factor 1:1 => minimal pulse length 250 ms |
| 5 | 5 Hz with pulse-duty factor factor 1:1 => minimal pulse length 100 ms |
| 10 | 10 Hz with pulse-duty factor factor 1:1 => minimal pulse length 50 ms |
| 20 | 20 Hz with pulse-duty factor 1:1 => minimal pulse length 25 ms |
| 50 | 50 Hz with pulse-duty factor 1:1 => minimal pulse length 10 ms |
| 100 | 100 Hz with pulse-duty factor 1:1 => minimal pulse length 5 ms |
| 500 | 500 Hz with pulse-duty factor 1:1 => minimal pulse length 1 ms |

PPt: Pulse per turn

With this parameter the number of pulse per turn can be entered directly. It generally works with sprockets and their number of sprockets, incremental encoder and their resolution or glands with a number of boreholes. For simple flow meter with impeller it is only neccessary to enter the number of pulse per liter or cubic metre.

tIME: Time base

Generally the time base for rotation speed is always set on **MIn**, it can of course be changed into seconds or hours.

dot: Comma / decimal place

Determine the decimal representation of the display value with the decimal point. A rotation speed with up to 3 positions after decimal point can be displayed, if they are small enough.

Example: Rotation speed measurement

The rotation speed of a roller in a steel works needs to be displayed in turns/minute with one position after decimal place. The rotational speed will be recorded via a perforated disc with 18 holes, positioned in an angle of 20° . The maximum rotation speed of the roller is 60 turns/minute. Like this, adjust for example **FILt = 100**; **PPt = 18**; **tIME = MIn**; **dot = 0.0**. The difficulty with the adjustment of the filter is to calculate the pulse length precisely.

6.1.3.3. Upwards/downwards counter

| PE | | | | | | | |
|-------|---------|-----------|-----------|-------|----------|---------|--|
| Pa | rameter | Menu item | Menu item | | | | |
| IMPu | ПΡц | L o.u P | [o.dn | | | | |
| Pa | rameter | Menu item | | | | Default | |
| I.tYP | le yp | EEL | nPn | PnP | <u> </u> | LLL | |
| Co.bA | C o.b R | Pul 5 | SEC | П In | | Puls | |
| EdGE | EdGE | Po5 1 | nEGR | | | Po5 1 | |
| PrES | PrES | 0001 | to | 9999 | | | |
| FILt | FILE | no | 2 | 5 | 10 | no | |
| | | 20 | 50 | 100 | 200 | | |
| | | 500 | | | | | |
| End | End | -1999 | to | 9999 | | 1000 | |
| End.C | EndE | 0001 | to | 9999 | | | |
| rSt | r SE | | to | 9999 | | | |
| dot | dot | | to | 0.000 | | | |

I.tYP: Pulse signal

There a 3 modes for the triggering of the pulse input:

| ttL | Active TTL-signals with approx. 0.8 V lower and approx. 2 V upper threshold. |
|-----|--|
| nPn | Passive switching contact; it operates the internal pull-up depending on the rate. |
| PnP | Active sensor output. A pull-down is operated in the device. |
| nAM | Namur input Low <1,5 mA, High > 2,5 mA |

Co.bA: Counter base

As standard the device records incoming pulses during counter operation. However the counter basis can also be used as system time in seconds or minutes. In doing so, the pulse input turns into gate time, it counts at wing **PoSI** (HIGH-signal) and stands at **LOW**. The logic is contrary at wing **nEGA**.

EdGE: Counting start / counting end (wing)

The active wing declares when the counting takes place. The pulse recording **PuLS** is choosen as counter basis, via this it will be declared if the internal counter will be increased by the positive wing **PoSI** or the negative wing **nEGA**. If time is taken as time basis, then the active-triggering/HIGH-triggering will be selected with **PoSI** and the passive triggering/LOW-triggering will be selected with **nEGA**. The counter reset is always statical.

PrES: Prescaler

A prescaling in the device happens via the prescaler, so even large pulse numbers like e.g. 5.000.000 can be recorded by the device. Only the prescaled value will be included for the scaling.

FILt: Limitation of the pulse length

For contact bounce suppression of mechanical contacts via selection of the filter frequency:

| no | No particular evaluation of the pulse length |
|-----|---|
| 2 | 2 Hz with pulse-duty factor 1:1 => minimal pulse length 250 ms |
| 5 | 5 Hz with pulse-duty factor factor 1:1 => minimal pulse length 100 ms |
| 10 | 10 Hz with pulse-duty factor factor 1:1 => minimal pulse length 50 ms |
| 20 | 20 Hz with pulse-duty factor 1:1 => minimal pulse length 25 ms |
| 50 | 50 Hz with pulse-duty factor 1:1 => minimal pulse length 10 ms |
| 100 | 100 Hz with pulse-duty factor 1:1 => minimal pulse length 5 ms |
| 500 | 500 Hz with pulse-duty factor 1:1 => minimal pulse length 1 ms |

End, End.C: Display terminal value and pulse terminal value

The display value can be freely linearised via the prescaled pulse number. For it the number of desired pulses will be allocated to a display value. The zero-point cannot be prescaled. At a backwards counter **End** and **End.C** serve as start value. For the absolute counter threshold values, the adjustments of **dl.Hl** and **dl.Lo** are used. By reaching them, all digits that reached this value are flashing, what equates an underflow/overflow.

rSt: Reset value

If rSt = 0 is set, the start value is reset on a reset contact. If the value is not equal to 0, the display value is changed by the number of entered impulses. The change of the value takes place in the opposite direction to the preset direction.

General device parameter see page 23 Alarm parameter see page 24 Safety parameter for lock / release of parameterisation see page 26

6.2. General device parameter

| Parameter | | Menu item | | | | Default |
|-----------|---------|-----------|--------|----------|--------|---------|
| SEC | SEC | 00.1 | to | 2.0 | | 1.00 |
| GLM | БLП | | to | 20 | | |
| dl.Hl | d I.H I | -1999 | to | 9999 | | 1999 |
| dl.Lo | d lLo | -1999 | to | 9999 | | 9999 |
| tASt | ERSE | no | EHLr | RLL I | | no |
| FLAS | FLAS | | AL - 1 | <u> </u> | RL. 12 | |

SEC: Measuring time

Adjustement of basis measuring time respectively of the frequency filter for a relief of the measurand. This filter value is adjustable from 0.01...2.00 seconds. At pulse measurement, the value can be selected up to 0.00, so that the identification runs on maximum speed.

GLM: Sliding averaging

Besides the measuring time, as sliding averaging of 1...20 values can be activated, too. Here, no seperate emphasis between the past values is taking place. At **GLM** = 1 the sliding averaging is switched off.

dl.Lo, dl.HI: Presentation of start/terminal value in the display

For overflow evaluation the measuring range and the optional selected overflow (**OVEr**) behaviour are evaluated. In addition this range can be limited by the parameter **dI.HI** and **dI.Lo**.

tASt: Allocation (deposit) of key functions

For operating mode either a min/max-value monitoring or a limit value correction on the navigation keys can be deposited here. If the min/max memory is activated by **EHtr**, the measured min/max-values will be saved during operation and can be recalled via the navigation keys [\blacktriangle] [\triangledown]. At restart of the device, all values are lost. If the limit value correction **AL.LI** is selected, limit values can be changed during operation, without interfere with the operating procedure. If **no** is adjusted, the navigation keys [\blacktriangle] [\triangledown] are without any function in the operating mode.

FLAS: Display flashing at threshold value exceedance/undercut

A display flashing can be added as additional alarm function either to the first limit value (select: **AL-1**), to the second limit value (select: **AL-2**) or to both limit values (select: **AL-12**). With **no** (factory settings), no flashing is allocated.

6.3. Alarm parameter

| Pa | rameter | Menu item | | | | Default |
|-------|----------------|-----------|-------|--------|--------|---------|
| Al.Fu | ЯlFц | ٥FF | | H LL I | Lo.L I | |
| | | r An G | Dut.r | Ac.H I | Ac.Lo | oFF |
| Al.Er | RLEr | no | oFF | DN | | |
| AI.LI | R (L | -1999 | to | 9999 | | 100 |
| AI.HY | R (HY | 0000 | to | 9999 | | |
| AI.HI | R (H 1 | 7999 | to | 9999 | | 200 |
| Al.Lo | A lLo | -999 | to | 9999 | | 100 |
| Al.oF | A LoF | 0000 | to | 5999 | | |
| Al.on | R lon | 0000 | to | 5999 | | |
| A2.Fu | <i>R2.</i> F ц | oFF | | H LL I | Lo.L I | |
| | | r An D | Dut.r | | | oFF |
| A2.Er | <i>R2.Er</i> | | oFF | on | | |
| A2.LI | R2.L I | -1999 | to | 9999 | | 300 |
| A2.HY | RZHY | 0000 | to | 9999 | | |
| A2.HI | R2.H I | -1999 | to | 9999 | | 400 |
| A2.Lo | 82.L o | -1999 | to | 9999 | | 300 |
| A2.oF | 82.oF | 0000 | to | 9999 | | |
| A2.on | 82.on | 0000 | to | 9999 | | |

A1.Fu, A2.Fu: Limit value behaviour

Change between the different working types of switching outputs by using the functional principle. If **Ax.Fu** = **oFF** was selected, the relevant switching point parameter will not be displayed.

| oFF | The switching point is without function and relevant parameter will not be displayed (Default status). |
|-------|--|
| On | The switching point is switched on during measuring operation and corresponding parameter (except Ax.Er and Ax.tY) will not be displayed. |
| HI-LI | Switch at threshold value exceedance. |
| Lo.LI | Switch at threshold value undercut. |
| rAnG | Switch within the preset range. |
| Out.r | Switch outside the preset range. |

A1.Er, A2.Er: Report at threshold value errors

If a check sum should not be correct or the range of value is affected, the switching point behaviour can be preset.

| on | Selected switching point behaviour is activated. HIGH/L+ is switched in push-pull-mode. |
|-----|---|
| oFF | The switching points behave contrary. The maloperation transcribes the actual threshold function in case of an occured error. |
| no | An error has no defined influence. This means a value of 10,000 regarding the overflow evaluation and a value of -2,000 for the underflow evaluation. |

A1.L1, A2.L1: Threshold level

Here the threshold level is defined that activates/deactivates an alarm. This parameter will not be recalled if the window function is used.

A1.HY, A2.HY: Hysteresis

The hysteresis defines a difference to the limit value which defines the delay of an alarm. This parameter will not be recalled if the window function is used.

A1.HI, A2.HI: Upper limit value

A1.Lo, A2.Lo: Lower limit value

For range functions **A1.FU**, **A2.FU** = **rAnG** or **Out.r** this value defines the upper/lower limit of the window function between -1999...9999. This parameter will not be displayed with other functional principles. The functional principle can change between switching point 1 and 2.

A1.oF, A2.oF: Dropout delay

Preset a delayed switching off of 0-5999 seconds for the limit values. The time value will not be saved permanently and is set back by restart of the device. Furthermore the alarm condition will be detected during restart, without considering the preset delay.

A1.on, A2.on: On-delay

Preset a delayed switching on of 0-5999 seconds for the limit values. The time value will not be saved permanently and is set back by restart of the device. Furthermore the alarm condition will be detected during restart, without considering the preset delay.

6.4. Safety parameter for lock/release of parameterisation

| Parameter | | Menu item | | | Default | |
|-----------|------|-----------|-----|------|---------|------|
| CodE | LodE | 0000 | to | 9999 | | 1234 |
| run | гип | UL OC | LDE | | | ULOE |

CodE: Assignment of an individual numerical code (4-digit number combination, free allocatable)

With assignment of this code (0000 factory settings), all parameter will be locked for the user, if **LOC** was selected afterwards under menu item **run**. By pushing **[P]** in operating mode for approx 3 seconds, the message **CodE** appears in the display. The code needs to be entered before each parameterisation, until the programming is released with **ULoC** under **run**.

run: Activation/Deactivation of programming interlock

Select with $[\blacktriangle] [\lor]$ between deactivated key lock ULOC (factory settings) and activated key lock LOC. The keypad is locked, if LOC was selected. To get into menu level again, [P] needs to be pushed for 3 seconds in operating mode. The now appearing CodE (factory settings 0000) needs to be entered with $[\land] [\lor]$ and [P] and releases the keypad. A faulty entry will be displayed with FAIL.

In LOC-mode the device cannot be resetted, which shall additionally secure the regular operation.

7. Reset to default values (factory settings)

To set the device into a defined initial state, there is the possibility to do a reset to the default values. Please proceed as follows:

Switch off the voltage supply of the device. Push the **[P]**-key and switch voltage supply on with in-position **[P]**-key. Push the **[P]**-key until "----" appears in the display. Due to the reset, default values are charged and used for further operation. The device is now reset to the delivery state.

ATTENTION! All application related data are lost!

8. Technical data

| 72x36x Panel cut-out 68.0+0.2 | 7 x 32. ^{+0.6} m mm elements | VxHxD) including p | lug-in terminal | | | | |
|---|--|--------------------|-----------------|------------------------|--|--|--|
| | mm elements | nm | | | | | |
| Wall thickness up to 5 | elements | | | | | | |
| | | | | up to 5 mm | | | |
| Fixing screw e | ycarbonate | screw elements | | | | | |
| Material PC Pol | PC Polycarbonate, black, UL94V-0 | | | | | | |
| Sealing material EPDM | EPDM, 65 Shore, black | | | | | | |
| Protection class standa | standard IP65 (front panel), IP00 (back side) | | | | | | |
| Weight approx | approx. 100 g | | | | | | |
| Connection plug-in | plug-in terminal; wire cross-section up to 1.5 mm ² | | | | | | |
| Display | | | | | | | |
| Digit height 14 mm | git height 14 mm | | | | | | |
| Segment colour red (op | red (optional green, orange or blue) | | | | | | |
| Display range -1999 t | -1999 to 9999 | | | | | | |
| Switching points LED S | LED S1, LED S2 | | | | | | |
| Overflow horizon | horizontal bars at the top | | | | | | |
| Underflow horizor | horizontal bars at the bottom | | | | | | |
| Display time 0.01 to | isplay time 0.01 to 2.00 seconds | | | | | | |
| Signal Measu range | ring | Measuring span | Resolution | Internal resistance | | | |
| Voltage 010 | V | 012 V | ≥ 14 bit | Ri > 100 kΩ | | | |
| Voltage 02 V | | 02.2 V | ≥ 14 bit | Ri ≥ 10 kΩ | | | |
| Voltage 01 V | | 01.1 V | ≥ 14 bit | Ri ≥ 10 kΩ | | | |
| Voltage 050 | mV | 075 mV | | Ri ≥ 10 kΩ | | | |
| Current 420 | mA | 122 mA | | Ri = ~125 Ω | | | |
| Current 020 | mA | 022 mA | | Ri = ~125 Ω | | | |
| Pt100-3-wire -502 | 00°C | -58392°F | 0.1°C / 0.1°F | | | | |
| Pt100-3-wire -200 | 850°C | -3281562°F | 1°C / 1°F | | | | |
| Pt1000-2-wire -200 | 850°C | -3281562°F | 1°C / 1°F | | | | |
| Thermo K -270 | 1350°C | -4542462°F | 1°C / 1°F | | | | |
| Thermo S -501 | 750°C | -3283182°F | 1°C / 1°F | | | | |
| Thermo N -270 | 1300°C | -4542372°F | 1°C / 1°F | | | | |

| Signal | Measuring range | Measuring span | Resolution | Internal resistance | |
|--|--|------------------------|---------------------------------------|------------------------------|--|
| Thermo J | -170950°C | -2741742°F | 1°C / 1°F | | |
| Thermo T | -270400°C | -454752°F | 1°C / 1°F | | |
| Thermo R | -501768°C | -583214°F | 1°C / 1°F | | |
| Thermo B | 801820°C | 1763308°F | 1°C / 1°F | | |
| Thermo E | -2701000°C | -4541832°F | 1°C / 1°F | | |
| Thermo L | -200900°C | -3281652°F | 1°C / 1°F | | |
| Frequency | 010 kHz | 010 kHz | 0,001 Hz | | |
| NPN | 03 kHz | 03 kHz | 0,001 Hz | | |
| PNP | 01 kHz | 01 kHz | 0,001 Hz | | |
| Rotation speed | 09999 1/min | 09999 1/min | 0,001 1/min | | |
| Counter | 09999 (Prescaler up to 1000) | | | | |
| Pulse input | TTL | HTL/PNP | NPN | Namur | |
| | Low <2 V, High >3 V | Low <6 V, High >8 V | Low <0.8 V, High via resistance | Low <1.5 mA, High >2.5 mA | |
| Reset input | active <0.8 V | | | | |
| Measuring error | | | | | |
| Standard 0.2% of measuring range ± 1 digit | | | | | |
| Pt100/Pt1000 | 0.5% of measuring range ± 1 digit | | | | |
| Thermocouple | | | | | |
| Accuracy | | | | | |
| Reference junction | ± 1°C | | | | |
| Drift of temperature | 100 ppm / K | | | | |
| Measuring time | 0.012.0 seconds | | | | |
| Sampling rate | approx. 1/s at thermocouple, approx. 100/s at standard signals | | | | |
| Measuring principle | U/F-conversion | | | | |
| Resolution | approx. 14 bit at 1 sec measuring time | | | | |
| Output | 2 relais with change-over contact 30 VDC/AC, max. 2 A resistive burden Attention! A high switching current leads to heat development, which affects the accuracy of the thermocouples! | | | | |
| Interface | rface Configuration interface for PC-software PM-TOOL & micro USB-plug | | | | |

| Power supply | 230 VAC ± 10% 50/60 Hz, ≤ 10 VA 24 VDC ± 10% galvanic isolated, ≤ 3 VA |
|--------------------------|---|
| Memory | EEPROM |
| Data life | ≥ 100 years at 25°C |
| Ambient condition | |
| Working temperature | -20°C+50°C |
| Storing temperature | -30°C+70°C |
| Weathering resistance | relative humidity 0-85% on years average without dew |
| EMV | EN 61326 |
| CE-identification | conformity according to directive 2014/30/EU |
| Safety standard | according to low voltage directive 2014/35/EU / EN 61010; EN 60664-1 |

9. Safety advice

Please read the following safety advice and the assembly *chapter 2* before installation and keep it for future reference.

Proper use

The IM1-6U-device is designed for the evaluation and display of sensor signals.



Danger! Careless use or improper operation can result in personal injury and/or damage the equipment.

Control of the device

The panel meters are checked before dispatch and sent out in perfect condition. Should there be any visible damage, we recommend close examination of the packaging. Please inform the supplier immediately of any damage.

Installation

The **IM1-6U-device** must be installed by a suitably **qualified specialist** (e.g. with a qualification in industrial electronics).

Notes on installation

- There must be no magnetic or electric fields in the vicinity of the device, e.g. due to transformers, mobile phones or electrostatic discharge.
- The fuse rating of the supply voltage should not exceed a value of 0.4A N.B. fuse!
- Do not install **inductive consumers** (relays, solenoid valves etc.) near the device and **suppress** any interference with the aid of RC spark extinguishing combinations or free-wheeling diodes.
- Keep input, output and supply lines separate from each other and do not lay them parallel with each other. Position "go" and "return lines" next to one another. Where possible use twisted pair. So, the best measuring results can be received.
- Screen off and twist sensor lines. Do not lay current-carrying lines in the vicinity. Connect the **screening on one side** on a suitable potential equaliser (normally signal ground).
- The device is not suitable for installation in areas where there is a risk of explosion.
- Any electrical connection deviating from the connection diagram can endanger human life and/or can destroy the equipment.
- The terminal area of the devices is part of the service. Here electrostatic discharge needs to be avoided. Attention! High voltages can cause dangerous body currents.
- Galvanically isolated potentials within one complex need to be placed on an appropriate point (normally earth or machines ground). So, a lower disturbance sensibility against impacted energy can be reached and dangerous potentials, that can occur on long lines or due to faulty wiring, can be avoided.

10. Error elimination

| | Error description | Measures |
|----|---|--|
| 1. | The unit permanently indicates overflow. | The input has a very high measurement, check the measuring circuit. The display range of 999 respectively the preset measuring range was exceeded, control the supporting points respectively the selected input type and signal range. Not all of the activated supporting points are parameterised. Check if the relevant parameters are adjusted correctly. |
| 2. | The unit permanently shows underflow. | The input has a very low measurement, check the measuring circuit. The display range of -1999 respectively the preset measuring range was undercut, control the adjustments. Not all of the activated supporting points are parameterised. Check if the relevant parameters are adjusted correctly. |
| 3. | The device shows Lbr in the 7- segment display. | Check if the selected input type is correct. Only temperature measurments and 420 mA show these kind of error indication. Check the wiring regarding a contact and correct connection. |
| 4. | The device shows HELP in the 7- segment display. | The device has detected an error in the configuration memory, operate a reset to default values and configurate the device according to your application. |
| 5. | Parameter for the parameterisation of the input are not available. | The programming interlock is activated.Enter correct code. |
| 6. | The device shows Err1 in the 7- segment display. | Contact the manufacturer if errors of this kind occur. |
| 7. | The device does not react as expected. | If you are not sure, if the device has been parameterised before, restore the delivery state as described in <i>chapter</i> 7. |
| 8. | There are higher constant errors of indication at thermocouple measurement. | Remove strong heat or cold sources from the direct surroundings of the device. Reduce the contact rating of the relay switching points onto preferably under 10 mA, as higher switching current lead to an increased local warming and thus to a massive error at the reference junction measurement. If the variations during operation are permanent and constant, the reference junction measurement can be corrected via the offset. |