

Operating and Installation Instructions Display devices

KERN KFB/KFN-TM

Version 2.4
04/2016
GB



KFB/KFN-TM-BA_IA-e-1624



KERN KFB/KFN-TM

Version 2.4 04/2016

Operating and installation instructions Display units

Contents

| | | |
|----------|--|-----------|
| 1 | Technical data | 4 |
| 2 | Appliance overview | 5 |
| 2.1 | Keyboard overview | 7 |
| 2.1.1 | Numerical input via the navigation buttons..... | 8 |
| 2.2 | Overview of display | 9 |
| 3 | Basic Information (General) | 10 |
| 3.1 | Proper use | 10 |
| 3.2 | Improper Use..... | 10 |
| 3.3 | Warranty | 10 |
| 3.4 | Monitoring of Test Resources | 11 |
| 4 | Basic Safety Precautions | 11 |
| 4.1 | Pay attention to the instructions in the Operation Manual..... | 11 |
| 4.2 | Personnel training..... | 11 |
| 5 | Transport and storage | 11 |
| 5.1 | Testing upon acceptance | 11 |
| 5.2 | Packaging / return transport..... | 11 |
| 6 | Unpacking and placing | 12 |
| 6.1 | Installation Site, Location of Use | 12 |
| 6.2 | Unpacking..... | 12 |
| 6.3 | Scope of delivery / serial accessories: | 12 |
| 6.4 | Transportation lock (illustration example)..... | 13 |
| 6.5 | Error message | 13 |
| 6.6 | Placing..... | 14 |
| 6.7 | Mains connection..... | 15 |
| 6.8 | Storage battery operation (optional)..... | 15 |
| 6.9 | Adjustment..... | 16 |
| 6.9.1 | Verified weighing systems | 16 |
| 6.9.2 | Non verifiable weighing systems | 19 |
| 6.10 | Linearization | 20 |
| 6.10.1 | Verified weighing systems:..... | 20 |
| 6.10.2 | Non-verified weighing systems | 21 |
| 6.11 | Verification..... | 22 |


| | | |
|-----------|---|-----------|
| 7 | Operation | 25 |
| 7.1 | Start-up..... | 25 |
| 7.2 | Switching Off..... | 25 |
| 7.3 | Zeroing..... | 25 |
| 7.4 | Simple weighing..... | 25 |
| 7.5 | Switch-over weighing unit (only not verifiable weighing systems)..... | 26 |
| 7.6 | Weighing with tare..... | 27 |
| 7.7 | Weighing with tolerance range..... | 28 |
| 7.7.1 | Tolerance check for target weight..... | 29 |
| 7.7.2 | Tolerance check for target quantity..... | 31 |
| 7.8 | Manual totalizing..... | 33 |
| 7.9 | Automatic adding-up..... | 35 |
| 7.10 | Parts counting..... | 36 |
| 7.11 | Animal weighing..... | 37 |
| 7.12 | Lock keyboard..... | 38 |
| 7.13 | Display background illumination..... | 38 |
| 7.14 | Automatic switch-off function „AUTO OFF“..... | 39 |
| 8 | Menu | 40 |
| 8.1 | Overview non verifiable weighing systems (contacts of circuit board [K1] not short-circuited) 41 | |
| 8.2 | Overview verified weighing systems (contacts of circuit board [K1] short-circuited by means of jumper) 44 | |
| 9 | Service, maintenance, disposal | 47 |
| 9.1 | Clean..... | 47 |
| 9.2 | Service, maintenance..... | 47 |
| 9.3 | Disposal..... | 47 |
| 9.4 | Error messages..... | 47 |
| 10 | Data output RS 232C | 49 |
| 10.1 | Technical data..... | 49 |
| 10.2 | Printer mode..... | 49 |
| 10.3 | Output log (continuous output)..... | 50 |
| 10.4 | Remote control instructions..... | 50 |
| 11 | Instant help | 51 |
| 12 | Installing display unit / weighing bridge | 52 |
| 12.1 | Technical data..... | 52 |
| 12.2 | Weighing system design..... | 52 |
| 12.3 | How to connect the platform..... | 53 |
| 12.4 | Configure display unit..... | 54 |
| 12.4.1 | Verified weighing systems (contacts of circuit board [K1] short-circuited by means of jumper) 54 | |
| 12.4.2 | Non verifiable weighing systems (contacts of circuit board [K1] not short-circuited)..... | 60 |
| 13 | Declaration of Conformity / Test Certificate | 64 |

1 Technical data

| KERN | KFB-TM | KFN-TM |
|--|--|--|
| Display | 5 ½ - digit | |
| Resolution (verified) | 6000 | |
| | Single (Max.) 6.000 e | |
| | Dual (Max.) 3.000 e | |
| Resolution (non-verified) | 30.000 | |
| Weighing ranges | 2 | |
| Divisions | 1,2,5,...10n | |
| Weighing Units | kg | |
| Functions | Weighing with tolerance range, Totalizing, Animal weighing | |
| Display | LCD 52 mm digits with back lighting | |
| DMS weighing cells | 80-100 Ω. Max. 4 item per 350 Ω; Sensitivity 2-3 mV/V | |
| Range calibration | We recommend ≥ 50 % max. | |
| Data output | RS232 | |
| Electric Supply | Input voltage 220 V – 240 V, 50 Hz | |
| | Power pack secondary voltage 12V, 500mA | |
| Housing | 250 x 160 x 58 | 266 x 165 x 96 |
| Admissible ambient temperature | 0°C – 40°C (non-verified) -10°C – 40°C (verified) | |
| Net weight | 1.5 kg | 2 kg |
| Rechargeable battery (optional) Operating / charge time | 35 h / 12 h | 90 h / 12 h |
| RS 232 interface | Standard | Option |
| Tripod | KERN BFS-07, option | |
| Support base incl. wall bracket | Standard | |
| IP protection | - | IP 67 as per DIN 60529 (rechargeable battery operation only) |

2 Appliance overview

KFB-TM: Synthetic finish

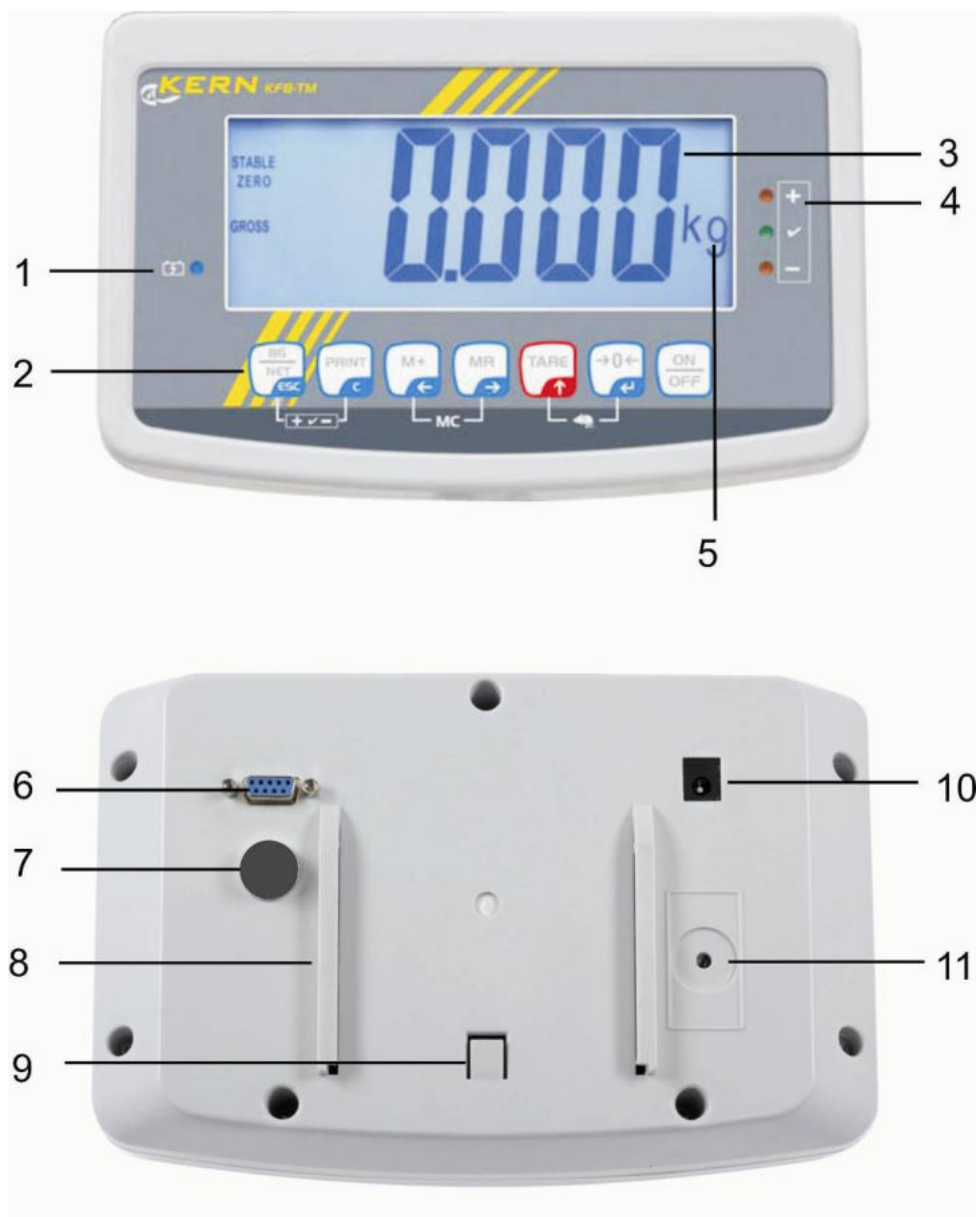











1. Status of rechargeable battery
2. Keyboard
3. Weight display
4. Tolerance margin, see chap. 7.7
5. Weighing unit
6. RS-232
7. Input connection load cell cable
8. Guide rail support base / stand
9. End stop support base / stand
10. Mains adapter connection
11. Adjustment switch


KFN-TM: Stainless steel finish





2.1 Keyboard overview




| Key | Function |
|--|--|
|  | <ul style="list-style-type: none"> • Turn on/off |
|  Navigation button ↵ | <ul style="list-style-type: none"> • Zeroing • Confirm entry |
|  Navigation key ↑ | <ul style="list-style-type: none"> • Taring • At numeric input increase flashing digit • Scroll forward in menu |
|  Navigation key → | <ul style="list-style-type: none"> • Display sum total • Digit selection to the right |
|  Navigation key ← | <ul style="list-style-type: none"> • Add weighing value to summation memory • Digit selection to the left |
|  C | <ul style="list-style-type: none"> • Calculate weighing data via interface • Delete |
|  ESC | <ul style="list-style-type: none"> • Change between gross ⇔ and net weight • Back to menu/weighing mode |
|  | <ul style="list-style-type: none"> • Call up animal weighing function |
|  | <ul style="list-style-type: none"> • Call up weighing with tolerance range |
|  | <ul style="list-style-type: none"> • Delete total added memory |

2.1.1 Numerical input via the navigation buttons

⇒ Press  and current setting will be displayed. The first digit will be flashing and is ready for changing.


⇒ If you do not wish to change the first digit, press  and the second digit will start flashing.




Each time you press , the display will move to the subsequent digit, after the last digit the display will return to the first digit.

⇒ To change the selected (flashing) digit, press  repeatedly until the desired value is displayed. Then press  to access further digits and change them by .

⇒ Complete your entry by .

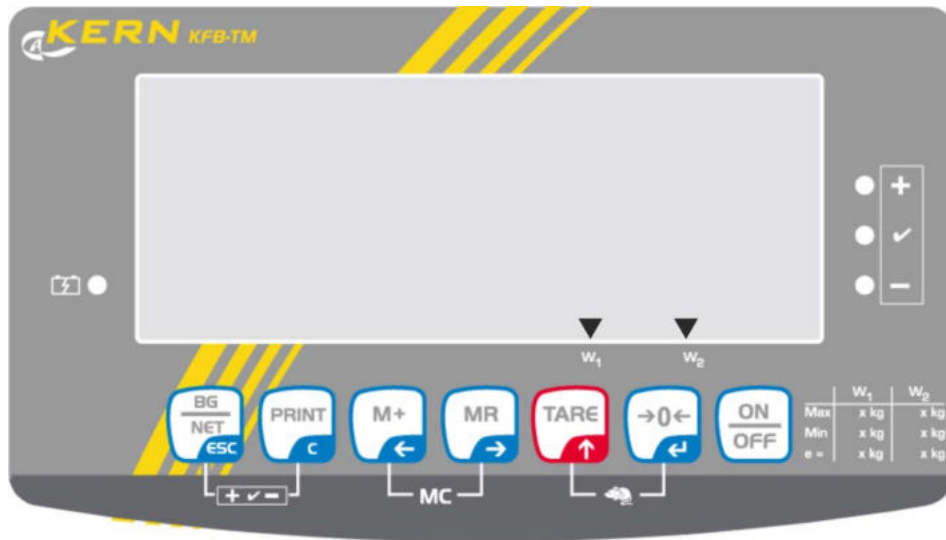2.2 Overview of display



| | |
|---|--|
| Display | Significance |
|  | Weighing range 1 |
|  | Weighing range 2 |
|  | Battery very low |
| STABLE | Stability display |
| ZERO | Zero indicator |
| GROSS | Gross weight |
| NET | Net weight |
| AUTO | Automatic add-up enabled |
| Kg | Weighing unit |
| M+ | Totalisation |
| LED + / ✓ / - | Indicators for weighing with tolerance range |

3 Basic Information (General)

3.1 Proper use

The display unit acquired by you is used in combination with a weighing plate and serves to determine the weighing value of material to be weighed. It is intended to be used as a “non-automatic weighing system”, i.e. the material to be weighed is manually and carefully placed in the centre of the weighing plate. As soon as a stable weighing value is reached the weighing value can be read.

3.2 Improper Use

Do not use display unit for dynamic weighings. In the event that small quantities are removed or added to the material to be weighed, incorrect weighing results can be displayed due to the “stability compensation“ in the display unit. (Example: Slowly draining fluids from a container on the balance.)

Do not leave permanent load on the weighing pan. This may damage the measuring system.

Impacts and overloading exceeding the stated maximum load (max) of the weighing plate, minus a possibly existing tare load, must be strictly avoided. Both, the weighing plate and the display unit may be damaged during this process.

Never operate display unit in explosive environment. The serial version is not explosion protected.

Changes to the display unit's design are not permitted. This may lead to incorrect weighing results, safety-related faults and destruction of the display unit.

The display unit may only be operated in accordance with the described default settings. Other areas of use must be released by KERN in writing.

3.3 Warranty

Warranty claims shall be voided in case

- Our conditions in the operation manual are ignored
- The appliance is used outside the described uses
- The appliance is modified or opened
- Mechanical damage or damage by media, liquids, natural wear and tear
- The appliance is improperly set up or incorrectly electrically connected
- The measuring system is overloaded

3.4 Monitoring of Test Resources

In the framework of quality assurance the measuring-related properties of the display unit and, if applicable, the testing weight, must be checked regularly. The responsible user must define a suitable interval as well as type and scope of this test. Information is available on KERN's home page (www.kern-sohn.com) with regard to the monitoring of display units' test substances and the test weights required for this. In KERN's accredited DKD calibration laboratory test weights and display units may be calibrated (return to the national standard) fast and at moderate cost.

4 Basic Safety Precautions

4.1 Pay attention to the instructions in the Operation Manual

Carefully read this operation manual before setup and commissioning, even if you are already familiar with KERN balances.

4.2 Personnel training

The appliance may only be operated and maintained by trained personnel.

5 Transport and storage

5.1 Testing upon acceptance

When receiving the appliance, please check packaging immediately, and the appliance itself when unpacking for possible visible damage.

5.2 Packaging / return transport



- ⇒ Keep all parts of the original packaging for a possibly required return.
- ⇒ Only use original packaging for returning.
- ⇒ Prior to dispatch disconnect all cables and remove loose/mobile parts.
- ⇒ Reattach possibly supplied transport securing devices.
- ⇒ Secure all parts such as the glass wind screen, the weighing platform, power unit etc. against shifting and damage.

6 Unpacking and placing

6.1 Installation Site, Location of Use

The display units are designed in a way that reliable weighing results are achieved in common conditions of use.

Precise and fast work is achieved by selecting the right place for your display unit and your weighing plate.

On the installation site observe the following:

- Place the display unit and the weighing plate on a stable, even surface.
- Avoid extreme heat as well as temperature fluctuation caused by installing next to a radiator or in the direct sunlight;
- Protect the display unit and the weighing plate against direct draft from open windows or doors.
- Avoid jarring during weighing;
- Protect the display unit and the weighing plate against high humidity, vapours and dust.
- Do not expose the display unit to extreme dampness for longer periods of time. Non-permitted condensation (condensation of air humidity on the appliance) may occur if a cold appliance is taken to a considerably warmer environment. In this case, acclimatize the disconnected appliance for ca. 2 hours at room temperature.
- Avoid static charge of goods to be weighed or weighing container.

Major display deviations (incorrect weighing results) may be experienced should electromagnetic fields (e.g. due to mobile phones or radio equipment), static electricity accumulations or instable power supply occur. Change location or remove source of interference.

6.2 Unpacking


Take the display unit carefully out of its packaging, remove the plastic jacket and install it at the designated work space.

6.3 Scope of delivery / serial accessories:

- Display Unit
- Mains adapter
- Support base incl. wall bracket
- Operating instructions

6.4 Transportation lock (illustration example)

Please note: if the display unit is used together with platform with transportation lock, this transportation lock must be released prior to use:

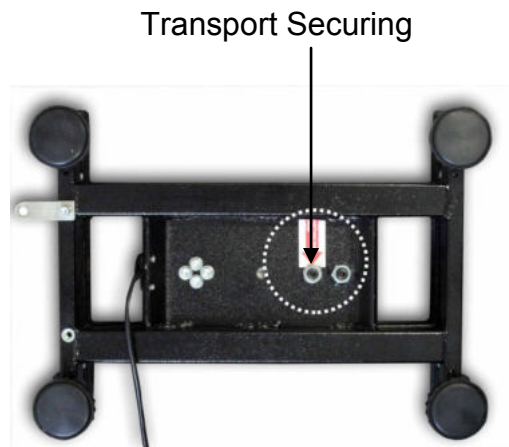

6.5 Error message



As soon as an error message appears in the balance display, the balance must not more be used, e.g. Err 4

6.6 Placing

Mount the display unit in a way that facilitates operation and where it is easy to see.

Usage with support base (KFB-TM only)



Push support base holder in guide rail [8] up to end stop [9], see chap. 2.

Usage with wall mount (KFB-TM only)



Use the wall mount to affix the display unit to the wall.

Using with tripod (optional)



An optional tripod (KERN BFS-07) is available if the display unit is to be mounted in a raised position.


6.7 Mains connection

Power is supplied via the external mains adapter. The stated voltage value must be the same as the local voltage.

Only use original KERN mains adapters. Using other makes requires consent by KERN.

6.8 Storage battery operation (optional)

Before the first use, the battery should be charged by connecting it to the mains power supply for at least 12 hours.

If the weight display shows , this is an indication that the capacity of the rechargeable battery is almost exhausted. The unit will be ready for operation for approx. another 10 hours before switching off automatically. Charge the battery with the help of the supplied power pack.

The LED display informs you during loading about the loading status of the rechargeable battery.

red: Voltage has dropped below prescribed minimum.

green: Battery is completely discharged

yellow: Charging storage battery

To conserve energy, enable the automatic switch-off function „AUTO OFF“, see chap. 7.14.

6.9 Adjustment


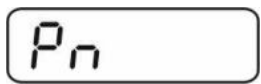





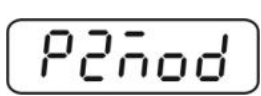










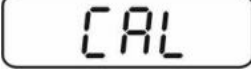



As the acceleration value due to gravity is not the same at every location on earth, each display unit with connected weighing plate must be coordinated - in compliance with the underlying physical weighing principle - to the existing acceleration due to gravity at its place of location (only if the weighing system has not already been adjusted to the location in the factory). This adjustment process must be carried out for the first commissioning, after each change of location as well as in case of fluctuating environment temperature. To receive accurate measuring values it is also recommended to adjust the display unit periodically in weighing operation.
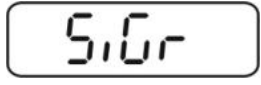
| | |
|----------|---|
| i | <ul style="list-style-type: none"> • In weighing systems with a resolution of < 15 000 dividing steps an adjustment is recommended. In weighing systems with a resolution of > 15 000 dividing steps a linearisation is recommended (see chap. 6.10). • Prepare the required adjustment weight. The weight to be used depends on the capacity of the scale. Carry out adjustment as near as possible to the scale's maximum weight. Info about test weights can be found on the Internet at: http://www.kern-sohn.com. • Observe stable environmental conditions. Stabilisation requires a certain warm-up time. • |
|----------|---|













6.9.1 Verified weighing systems

| | |
|----------|--|
| i | <p>In verified weighing systems the menu item for adjustment „P2 mode“ is blocked.</p> <p>KERN KFB-TM</p> <p>To disable the access lock, destroy the seal and actuate the adjustment switch. Position of the adjustment switch see chap. 6.11</p> <p>KERN KFN-TM</p> <p>To override the blocked access you will have to destroy the seal before calling up the menu and to short-circuit the two contacts on the circuit board [K2], using a jumper (See chap. 6.11).</p> <p>Attention: After destruction of the seal the weighing system must be re-verified by an authorised agency and a new verification wire/seal mark fitted before it can be reused for applications subject to verification.</p> |
|----------|--|

Call up menu:



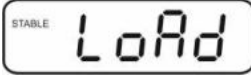







| | |
|---|---|
| 1. Switch-on balance and during the selftest press  . |  |
| 2. Press  ,  ,  subsequently, the first menu block „PO CHK“ will be displayed. |  |
| 3. Press  repeatedly until „P2 mode“ will be displayed. For the KFB-TM model operate the adjustment switch. |  |
| 4. Press  and select the set weighing scales type by  . <i>SIGr</i> = Single-range balance <i>dUAL 1</i> = Dual range balance <i>dUAL 2</i> = Multi-interval balance |      |
| 5. Acknowledge with  . |  |
| 6. Press  repeatedly until „CAL“ will be displayed. |  |
| 7. Confirm with  and select setting „noLin“ by  . |  |

How to carry out an adjustment:

| | |
|---|---|
| <p>⇒ Confirm menu setting „noLin“ by . Ensure that there are no objects on the weighing plate.</p> |    |
| <p>⇒ Wait for stability display, then press .</p> |  |
| <p>⇒ The currently set adjustment weight will be displayed.</p> |  |
| <p>⇒ To change by using the navigation buttons (see chap. 2.1.1) select the desired setting, the active digit is flashing.</p> <p>⇒ Acknowledge with .</p> |  |
| <p>⇒ Carefully place adjusting weight in the centre of the weighing plate. Wait for stability display, then press .</p> |  |
| <p>⇒ After the adjustment the balance will carry out a self-test. Remove adjusting weight during selftest, balance will return into weighing mode automatically. An adjusting error or incorrect adjusting weight will be indicated by the error message; repeat adjustment procedure.</p> |  |

6.9.2 Non verifiable weighing systems

Call up menu:

1. Switch-on balance and during the selftest press .
 2. Press subsequently , ,  the first menu block „PO CHK“ will be displayed.
 3. Press  repeatedly until „P3 CAL“ will be displayed.
 4. Confirm with ; press  repeatedly until „CAL“ appears.
 5. Acknowledge using , the current setting is displayed.
- ⇒ Press  to confirm; press  to select setting.
 noLin = adjustment
 LineAr = linearization, see chap. 6.10

Pn

POCHK

P3CAL





CAL

noLin



LineAr

How to carry out adjustment:

- ⇒ Confirm menu setting „noLin“ by .
 Ensure that there are no objects on the weighing plate.
- ⇒ Wait for stability display, then press .
- ⇒ The currently set adjustment weight will be displayed.
- ⇒ To change by using the navigation buttons (see chap. 2.1.1) select the desired setting, the active digit is flashing.
- ⇒ Acknowledge with .
- ⇒ Carefully place adjusting weight in the centre of the weighing plate. Wait for stability display, then press .
- ⇒ After the adjustment the balance will carry out a self-test. Remove adjusting weight **during** selftest, balance will return into weighing mode automatically. An adjusting error or incorrect adjusting weight will be indicated by the error message; repeat adjustment procedure.

noLin



UnLd

STABLE UnLd

30000 kg

STABLE LoAd

PASS

STABLE ZERO UNLd 0.0000 kg

6.10 Linearization

Linearity shows the greatest deviation of a weight display on the scale to the value of the respective test weight according to plus and minus over the entire weighing range. If linearity deviation is discovered during a testing instrument control, you can improve this by means of linearization.



- In balances with a resolution of > 15 000 dividing steps carrying out a linearisation is recommended.
- Carrying out linearization is restricted to specialist staff possessing well acquainted with the workings of weighing scales.
- The test weights to be used must be adapted to the weighing scale's specifications; see chapter "testing instruments control".
- Observe stable environmental conditions. Stabilisation requires a certain warm-up time.
- After successful linearisation you will have to carry out calibration; see chapter "testing instruments control".
- The adjustment is locked for verified balances. To disable the access lock, destroy the seal and actuate the adjustment switch. Position of the adjustment switch see chap. 6.11






6.10.1 Verified weighing systems:

⇒ Menu item P2 mode ⇒ Cal ⇒ Call up liner, see chap. 6.9.1

LinEr

⇒ Confirm by , the password query „Pn“ will be displayed.


Pn

⇒ Press subsequently , ,  or , , . Ensure that there are no objects on the weighing pan.

STABLE Ld 0

⇒ Wait for stability display, then press .

STABLE Ld 1


⇒ When "Ld 1" is displayed, put the first adjustment weight (1/3 max) carefully in the centre of the weighing platform. Wait for stability display, then press .

STABLE Ld 2

⇒ When "Ld 2" is displayed, put the second adjustment weight (2/3 max) carefully in the centre of the weighing platform.

STABLE Ld 3

Wait for stability display, then press .

⇒ When "Ld 3" is displayed, put the third adjustment weight (max) carefully in the centre of the weighing platform. Wait for stability display, then press .


PASS


- ⇒ After linearisation the balance will carry out a self-test. Remove adjusting weight **during** selftest, balance will return into weighing mode automatically.









6.10.2 Non-verified weighing systems

- ⇒ Call-up menu item P3 CAL⇒Cal⇒Liner, see chap. 6.9.1



- ⇒ Confirm by , the password query „Pn“ will be displayed.




- ⇒ Press , ,  or , ,  subsequently. Ensure that there are no objects on the weighing pan.



- ⇒ Wait for stability display, then press .



- ⇒ When “Ld 1“ is displayed, put the first adjustment weight (1/3 max) carefully in the centre of the weighing platform. Wait for stability display, then press .




- ⇒ When “Ld 2“ is displayed, put the second adjustment weight (2/3 max) carefully in the centre of the weighing platform.



Wait for stability display, then press .

- ⇒ When “Ld 3“ is displayed, put the third adjustment weight (max) carefully in the centre of the weighing platform. Wait



for stability display, then press .

- ⇒ After a successful linearisation the balance will carry out a self-test. Remove adjusting weight **during** selftest, balance will return into weighing mode automatically.



6.11 Verification

General introduction:

According to EU directive 90/384/EEC balances must be officially verified if they are used as follows (legally controlled area):

- a) For commercial transactions if the price of goods is determined by weighing.
- b) For the production of medicines in pharmacies as well as for analyses in the medical and pharmaceutical laboratory.
- c) For official purpose.
- d) For manufacturing final packages.

In cases of doubt, please contact your local trade in standard.

Verification notes:

An EU Qualification Approval is in existence for verified weighing systems. If a balance is used where obligation to verify exists as described above, it must be verified and re-verified at regular intervals.

Reverification is carried out according to the relevant national statutory regulations.

The validity for verification of balances in Germany is e.g. 2 years.

The legal regulation of the country where the balance is used must be observed!




- Verification of the weighing system is invalid without the "seal".

Notes on verified weighing systems

KFB-TM:

Access to conductor plate:


- Remove seal
- Open display unit
- The application of the display unit as a weighing system able to be verified requires that the contacts of the circuit board are short-circuited with the help of a jumper [K1].
For non verifiable weighing systems remove the jumper.

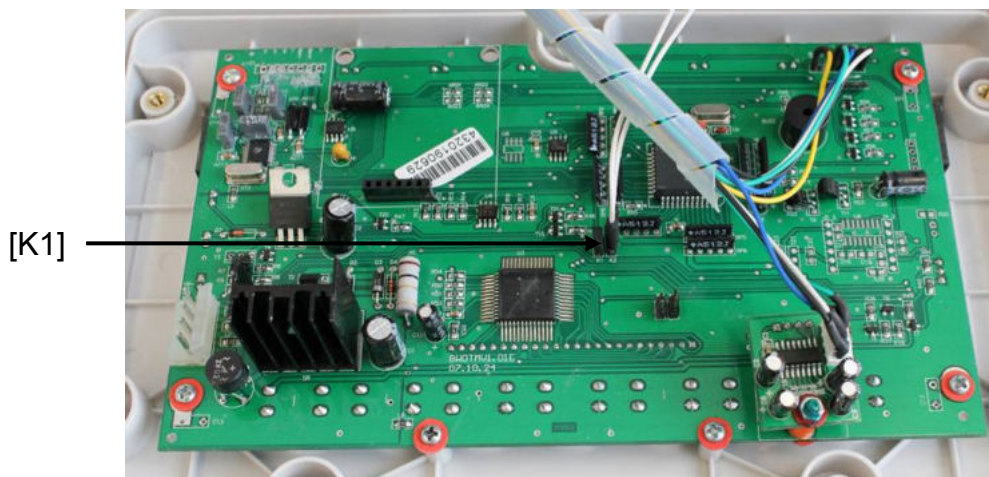

In verified weighing systems the menu item for adjustment, „P2 mode“ will be blocked.

To disable the access lock, destroy the seal and actuate the adjustment switch.

Position of seals and adjusting switch

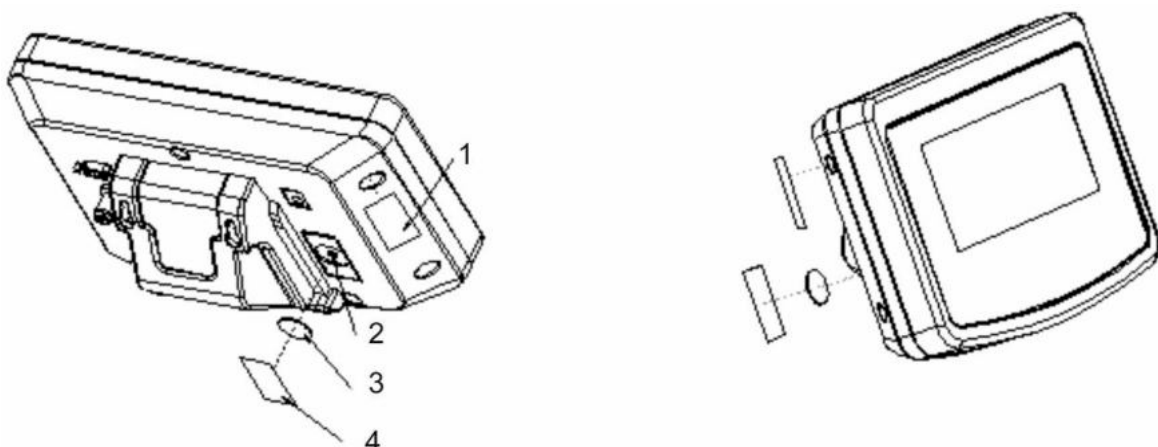


1. Self-destroying seal mark
2. Adjustment switch
3. Cover of adjustment switch
4. Self-destroying seal mark

KFN-TM:


Access to conductor plate:

- Remove seal
- Open display unit
- The application of the display unit as a weighing system able to be verified requires that the contacts of the circuit board are short-circuited with the help of a jumper [K1]. For non verifiable weighing systems remove the jumper.
- To adjust, short-circuit the contacts of the circuit board, using a jumper [K2].

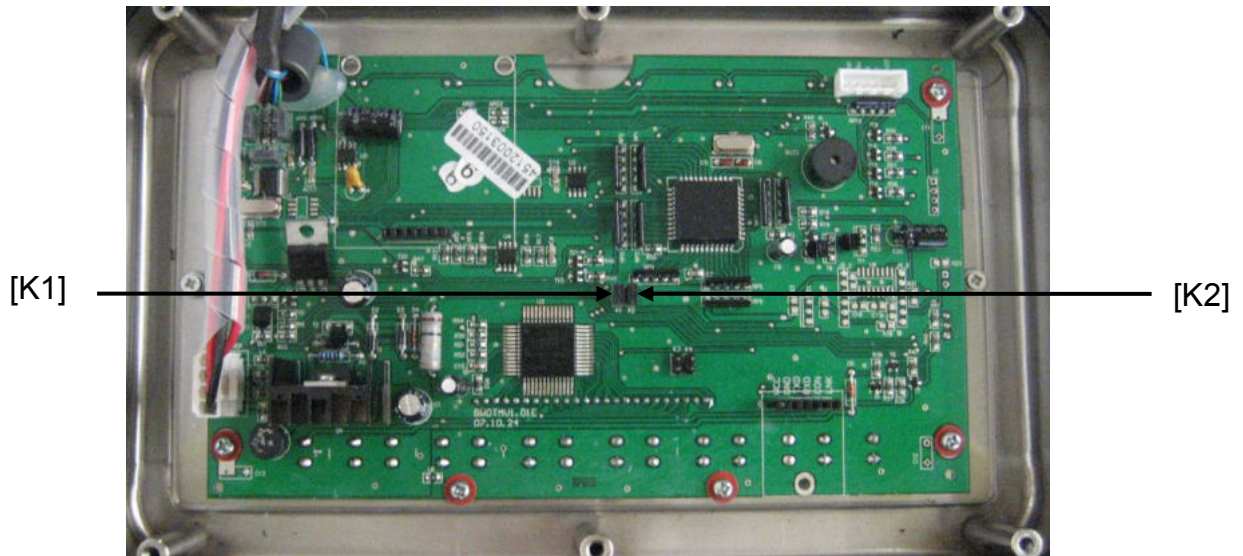


7 Operation

7.1 Start-up

- ⇒ Press  and the instrument will carry out a self-test. As soon as the weight display appears, the instrument will be ready to weigh.




7.2 Switching Off

- ⇒ Press  and the display will disappear.

7.3 Zeroing

Resetting to zero corrects the influence of light soiling on the weighing plate. The unit is equipped with an automatic zero setting function. Therefore the unit can be reset to zero at any time as follows:

- ⇒ To unload the weighing system

- ⇒ Press  and zero display as well as indicator **ZERO** will appear.



7.4 Simple weighing

- ⇒ Place goods to be weighed on balance.
⇒ Wait until stability display **STABLE** appears.
⇒ Read weighing result.



Overload warning

Overloading exceeding the stated maximum load (max) of the device, minus a possibly existing tare load, must be strictly avoided. This could damage the instrument.


Exceeding maximum load is indicated by the display of „----“ and an audio sound. Unload weighing system or reduce preload.

7.5 Switch-over weighing unit (only not verifiable weighing systems)


How to enable weighing units:

⇒ Call-up menu item **P5 Unt**, see chap. 8.1


P5Unt

⇒ Press  and the first weighing unit with the current setting will be displayed.


on^{kg}

⇒ To enable [on] / disable [off] the displayed weighing unit, press .

⇕
off^{kg}

⇒ Acknowledge with . The next unit with the current setting will be displayed.

on^{lb}

⇒ To enable [off] / disable [on] the displayed weighing unit, press .

⇒ Acknowledge with .

⇒ Repeat sequence for each weighing unit.


Note:

„tj“ and „Hj“ cannot be activated at the same time, only either ... or ...

⇒ Return to weighing mode using .

STABLE
ZERO
GROSS: 0.000^{kg}


Switch-over weighing unit:

⇒  Keep pressed, the display changes over to the weighing units activated before (e.g. kg ⇌ lb)

STABLE
GROSS: 1.000^{kg}



⇕
STABLE
GROSS: 2.205^{lb}

7.6 Weighing with tare

- ⇒ Deposit weighing vessel. After successful standstill control press the  button. Zero display and indicator **NET** appear.



The weight of the container is now internally saved.

- ⇒ Weigh the material, the net weight will be indicated.
- ⇒ The weight of the weighing container will be displayed as a minus number after removing the weighing container.
- ⇒ The tare procedure can be repeated as many times as necessary, for example with initial weighing of several components for a mix (add-on weighing). The limit is reached when the taring range capacity (see type plate) is full.
- ⇒ To change between gross weight and net weight, press .
- ⇒ To delete the tare value, remove load from weighing plate and press .

7.7 Weighing with tolerance range

You can set an upper or lower limit when weighing with tolerance range and thus ensure that the weighed load remains exactly within the set limits.

During tolerance tests such as dosing, portioning and sorting the unit will indicate exceeded or undershot limits by emitting an optical or acoustic signal.

Audio signal:

The acoustic signal depends on the settings in menu block „BEEP“.


Options:

- no Acoustic signal turned off
- ok An acoustic signal sounds when load is within tolerance limits
- ng An acoustic signal sounds when load is beyond tolerance limits


Optical signal:

Three colour signal lights indicate whether the load is within the two tolerance limits.

The signal lights provide the following information:

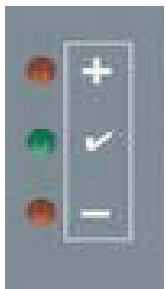

| | | | |
|---|---|--|----------------------------|
|  | + | Goods to be weighed above tolerance limit | Red signal light glowing |
| | ✓ | Goods to be weighed within tolerance range | Green signal light glowing |
| | - | Goods to be weighed below tolerance limit | Red signal light glowing |

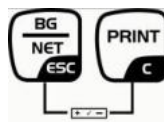The settings for tolerance weighing may be called up either via menu block „**P0 CHK**“ (see chap. 8) or faster via the key combination



7.7.1 Tolerance check for target weight


Settings

⇒ Press  and  at the same time in weighing mode.


0.000 kg



nEt H

⇒ Press  until the display for entering the lower limit value nEt L appears.


nEt L

⇒ Press , the current setting will be displayed.


100.000 kg

⇒ To enter the lower limit, e. g. 1000 Kg, press the navigation keys (See chap. 2.1.1); the currently enabled digit will be flashing.


10 1.000 kg

⇒ Confirm input by .

nEt L


⇒ Press  repeatedly until nEt H is displayed.

nEt H


⇒ Press , the current setting for the upper limit will be displayed.

⇒ Press the navigation keys (See chap. 2.1.1) to enter the upper limit, e.g. 1,100 kg; the currently enabled digit will be flashing.


10 1.100 kg

⇒ Confirm input by .

nEt H


⇒ Press  repeatedly until bEEP is displayed.

bEEP


⇒ Press  and the current setting for the acoustic signal will be shown.

ot

⇒ Select desired setting (no, ok, ng) by .

⇒ Confirm input by .




bEEP

⇒ Press ; weighing system is in tolerance weighing mode. From here evaluation takes place whether the goods to be weighed are within the two tolerance limits.



Weighing with tolerance range

- ⇒ Tare when using a weighing container.
- ⇒ Put on goods to be weighed, tolerance control is started. The signal lights indicate whether the load is within the two set limits.



| Load below specified tolerance | Load within specified tolerance | Load exceeds specified tolerance |
|--|---|--|
|  <p>Red signal light next to „-“ ON illuminated</p> |  <p>Green signal light next to „✓“ illuminated</p> |  <p>Red signal light next to „+“ ON illuminated</p> |



- The tolerance control is not active when the weight is under 20d.
- To delete limits, enter “00.000 kg“.

7.7.2 Tolerance check for target quantity


Settings

⇒ Press  and  at the same time in weighing mode.


0.000 kg



nEt H

⇒ Press  until the display for entering the lower limit value *PCSL* appears.


PCSL

⇒ Press , the current setting will be displayed.


.00000 PCS

⇒ To enter the lower limit, e. g. 75 items, press the navigation buttons (see chap. 2.1.1); the currently enabled digit will be flashing.


.00075 PCS

⇒ Confirm input by .

PCSL

⇒ Press  repeatedly until *PCSH* is displayed.


PCSH

⇒ Press , the current setting for the upper limit will be displayed.


.00000 PCS

⇒ To enter the upper limit, e. g. 100 items, press the navigation buttons (see chap. 2.1.1); the currently enabled digit will be flashing.


.00 100 PCS

⇒ Confirm input by .

PCSH


⇒ Press  repeatedly until *bEEP* is displayed.

bEEP


⇒  Press and the current setting for the acoustic signal will be shown.

ot

⇒ Select desired setting (no, ok, ng) by .

⇒ Confirm input by .




bEEP

⇒ Press ; weighing system is in tolerance weighing mode. From here evaluation takes place whether the goods to be weighed are within the two tolerance limits.



Weighing with tolerance range


- ⇒ Set item weight, see chap. 7.10.
- ⇒ Tare when using a weighing container.
- ⇒ Put on goods to be weighed, tolerance control is started. The signal lights indicate whether the load is within the two set limits.

| Load below specified tolerance | Load within specified tolerance | Load exceeds specified tolerance |
|--|--|--|
|  <p>Red signal light next to „-“ ON illuminated</p> |  <p>Green signal light next to „✓“, illuminated</p> |  <p>Red signal light next to „+“ ON illuminated</p> |



- The tolerance control is not active when the weight is under 20d.
- To delete limits, enter „00000 PCS“.


7.8 Manual totalizing

With this function the individual weighing values are added into the summation memory by pressing  and edited, when an optional printer is connected.

- i** • Menu setting:
„P1 COM“ or „P2 COM“ ⇨ „MODE“ ⇨ „PR2““, see chap. 8
- The totalizing function is not active when the weight is under 20d.

Add up:

⇒ Place weighing goods A.


Wait until the stability display **STABLE** appears, then press . The weight value will be saved and printed if an optional printer is connected.




⇒ Remove the weighed good. More weighed goods can only be added when the display \leq zero.



⇒ Place goods to be weighed B.

Wait until the stability display appears, then press . Weighing value will be added to summation memory and possibly printed. The number of weighing actions, followed by the total weight will be displayed for 2 sec.





⇒ Add more weighed goods as described before.



Please note that the weighing system must be unloaded between the individual weighing procedures.

⇒ This process may be repeated 99 times or till such time as the capacity of the weighing system has been exhausted.

Display and output sum „Total“:

⇒ Press , number of weighing, followed by the total weight will be displayed for 2 sec. Press  to print out this display.

Delete weighing data:

⇒ Press  and  at the same time The data in the summation memory are deleted.



Printout example KERN YKB-01N, verified weighing system:


Menu setting
„P1 COM“ or „P2 COM“ ⇒ „Lab 2“ / Prt 7“

Menu setting
„P1 COM“ or „P2 COM“ ⇒ „Lab 0“ / Prt 0“

| | | |
|---|---|---|
| ***** NO.: 1 GS: 2.000KG Total: 2.000KG ***** | ← | 1 |
| ***** NO.: 2 GS: 2.000KG Total: 4.000KG ***** | ← | 2 |
| ***** NO.: 3 GS: 3.000KG Total: 7.000KG ***** | ← | 3 |
| ***** Total NO.: 3 Total: 7.000KG ***** | ← | 4 |


| | | |
|-----------------------------------|---|---|
| ***** GS: 2.000KG ***** | ← | 1 |
| ***** GS: 2.000KG ***** | ← | 2 |
| ***** GS: 3.000KG ***** | ← | 3 |
| ***** Total ***** | ← | 4 |
| NO.: 3 Total: 7.000KG ***** | | |

- 1 First weighing
- 2 Second weighing
- 3 Third weighing
- 4 Number of weighings / total

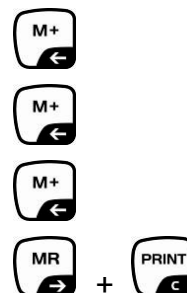

English

7.9 Automatic adding-up

With this function the individual weighing values are automatically added into the summation memory when the balance is unloaded without pressing  and edited, when an optional printer is connected.




- Menu settings:
„P1 COM“ or „P2 COM“ ⇒ „MODE“ ⇒ „AUTO“, see chap. 8
Der Indikator **AUTO** wird angezeigt.



Add up:

- ⇒ Place weighing goods A.


After the standstill control sounds a signal tone. The weighing value will be added to the summation memory and printed.



- ⇒ Remove the weighed good. More weighed goods can only be added when the display \leq zero.

- ⇒ Place goods to be weighed B.

After the standstill control sounds a signal tone. The weighing value will be added to the summation memory and printed. Number of weighing, followed by the total weight will be displayed for 2 sec.



- ⇒ Add more weighed goods as described before.

Please note that the weighing system must be unloaded between the individual weighing procedures.

- ⇒ This process may be repeated 99 times or till such time as the capacity of the weighing system has been exhausted.




Display and delete the weighing data, as well as printout examples see chap. 7.8.


7.10 Parts counting


Before the balance can count parts, it must know the average part weight (i.e. reference). Proceed by putting on a certain number of the parts to be counted. The balance determines the total weight and divides it by the number of parts, the so-called reference quantity. Counting is then carried out on the basis of the calculated average piece weight.


As a rule:


The higher the reference quantity the higher the counting exactness.


- ⇒ In weighing mode , press and hold until the message „P 10“ appears that is used to set the reference quantity.



- ⇒ Use  to set the desired reference quantity (such as 100), options include P 10, P 20, P 50, P100, P 200.



- ⇒ Place as many items to be counted (such as 100 items) as demanded by the set reference quantity and confirm by . The weighing scales calculate the reference weight. The current quantity (such as 100 items) will be displayed.



- ⇒ Remove reference weight. The balance is from now in parts counting mode counting all units on the weighing plate.



- ⇒ Back to Weighing mode by .




7.11 Animal weighing

The animal weighing function is suitable for weighing restless loads.

The weighing system will display a mean value derived from several weighing results.



The animal weighing program can be enabled by either calling up menu block „P3 OTH“ or „P4 OTH“ ⇒ „ANM“ ⇒ „ON“ (See chap. 8) or faster via key combination.



The indicator shows HOLD as long as the animal weighing function remains enabled.



⇒ Place the load on the weighing system and wait until the scale is steady.

⇒ Press  and  at the same time; you will hear an acoustic signal, indicating that the animal weighing function is enabled.


Whilst averaging is taking place you can add or remove loads as the measuring value will be constantly updated.

⇒ To deactivate the animal weighing function press  and  at the same time.

7.12 Lock keyboard


To enable/disable the keyboard lock go to menu item „P3 OTH“ or „P4 OTH“ ⇒ „**LOCK**“, see chap.8.


Whilst the function is enabled the keyboard will self-lock after no key has been pressed for 10 minutes. „**K-LCK**“ will be displayed as soon as a key is pressed.




To disable the lock, press ,  and  hold plus (2 s) until „**U LCK**“ appears.

7.13 Display background illumination

⇒ Keep  pressed (3s) until „**setbl**“ appears.



⇒ Press  again, the current setting will be displayed.


⇒ Use  to select the desired setting.

bl on Continuous background lighting

bl off Background illumination off


bl Auto Automatic background illumination on when weighing pate is loaded or key pressed.

⇒ Either save by  or cancel by pressing .


Back to weighing mode by .

7.14 Automatic switch-off function „AUTO OFF“


The unit is automatically switched off within the preset time when the display unit or the weighing bridge are not operated.


⇒ Keep  pressed (3s) until „setbl“ appears.

SEtbl

⇒ Press  to call up AUTO OFF-function

SEtoF

⇒ Press , the current setting will be displayed.

⇒ Use  to select the desired setting.

of 0 AUTO OFF - function disabled


of 3 Weighing system will be turned off after 3 min.

of 5 Weighing system will be turned off after 5 min.

of 15 Weighing system will be turned off after 15 min.

of 30 Weighing system will be turned off after 30 min.










⇒ Either save by  or cancel by pressing .

Back to weighing mode by .




8 Menu


The application of the display unit as a verified weighing system requires that you short-circuit the two contacts [K1] of the circuit board, using a jumper. To that effect, a menu for verified weighing systems is available. For menu layout see chap. 8.2. There is no jumper for weighing systems that cannot be verified. To that effect, a menu is available for weighing systems that cannot be verified, Menu layout see chap. 8.1


Navigation in the menu:

| | |
|--|---|
| Call up menu | <p>⇒ Switch-on balance and during the selftest press  .</p> <div style="text-align: center; border: 1px solid black; padding: 5px; width: fit-content; margin: 10px auto;">Pn</div> <p>⇒ Press , ,  subsequently, the first menu block „PO CHK“ will be displayed.</p> <div style="text-align: center; border: 1px solid black; padding: 5px; width: fit-content; margin: 10px auto;">POCHK</div> |
| Select menu block | <p>⇒ With help of  , the individual menu items can be selected one after the other.</p> |
| Select setting | <p>⇒ Confirm selected menu item by pressing  . The current setting will be displayed.</p> |
| Change settings | <p>⇒ To change to the available settings, press the navigations keys as described in chap. 2.1.</p> |
| Acknowledge setting / exit the menu | <p>⇒ Either save by pressing  or cancel by pressing  .</p> |
| Return to weighing mode | <p>⇒ Press  repeatedly to exit menu.</p> |

8.1 Overview non verifiable weighing systems (contacts of circuit board [K1] not short-circuited)

| Menu block Main menu | Menu item Submenu | Available settings / explanation | | |
|---|--------------------------------------|--|--|-----------------|
| PO CHK Weighing with tolerance range, see chap. 7.7 | nEt H | Upper limit value „Tolerance check weighing“, input see chap. 7.7.1 | | |
| | nEt LO | Lower limit value „Tolerance check weighing“, input see chap. 7.7.1 | | |
| | PCS H | Upper limit value „Tolerance check counting“, input see chap. 7.7.2 | | |
| | PCS L | Lower limit value „Tolerance check counting“, input see chap. 7.7.2 | | |
| | BEEP | no | Acoustic signal for weighing with tolerance range switched off | |
| | | ok | Audio sound when load is within tolerance limits | |
| | | nG | Audio sound when load is beyond tolerance limits | |
| P1 REF Zero point settings | A2n0 | Automatic zero point correction (Autozero) by changing the display, digits selectable (0.5d, 1d, 2d, 4d) | | |
| | 0AUto | Zero setting range Load range where the display after switching-on the balance is set to zero. Selectable 0, 2, 5, 10, 20, 30, 50, 100 % | | |
| | OrAGE | Zero setting range Load range where the display is set to zero by pressing  . Selectable 0, 2, 4, 10, 20*, 50, 100%. | | |
| | 0tArE | Automatic taring „on / off“, taring range adjustable in menu item „0Auto“. | | |
| | SPEEDd | Not documented | | |
| | Zero | Zero point setting | | |
| | P2 COM Interface parameter | MODE | CONT | S0 off S0 on |
| ST1 | | | One output for stable weighing value | |
| STC | | Continuous data output of stable weighing values | | |
| PR1 | | Output after pressing  | | |
| PR2 | | Manual totalizing, see chap. 7.8. | | |
| | | Press  and the weighing value will be added to the summation memory and issued. | | |

| | | | | | |
|--|-----------------------------|--|--|--|--|
| | | AUTO* | For automatic add-up see chap. 7.9. This function is used to issue and add individual weighing values automatically to the summation memory on unloading of weighing scale. | | |
| | | ASK | For remote control commands, see chap. 10.4 | | |
| | | wirel | Not documented | | |
| | | BAUD | Available Baudrate: 600, 1200, 2400, 4800, 9600* | | |
| | | Pr | 7E1 | 7 bits, even parity | |
| | | | 7o1 | 7 bits, odd parity | |
| | | | 8n1* | 8 bits, no parity | |
| | | PTYPE | tPUP* | Standard printer setting | |
| | | | LP50 | Not documented | |
| | | Lab | Lab x | For data output format, see chap.8.2, tab. 1 | |
| | | Prt | Prt x | | |
| | | LAnG | eng* | Standard settings English | |
| | | | chn | | |
| P3 CAL Configuration data see chap. 12.4 | COUNT | Display internal resolution | | | |
| | DECI | Position of the decimal dot | | | |
| | DUAL | Setting balance type, capacity (Max) and readability (d) | | | |
| | | off | Single-range balance | | |
| | | | R1 inc | Readability | |
| | | | R1 cap | Capacity | |
| | | on | Dual range balance | | |
| | | | R1 inc | Readability 1st weighing range | |
| | | | R1 cap | Capacity 1st weighing range | |
| | | |  | | |
| | R2 inc | | Readability 2nd weighing range | | |
| R2 cap | Capacity 2nd weighing range | | | | |
| CAL | noLin | For adjustment, see chap. 6.9.2 | | | |
| | Liner | For linearization, see chap. 6.10.2 | | | |
| GrA | Not documented | | | | |
| P4 OTH | LOCK | on | Keyboard lock enabled, see chap. 7.11 | | |
| | | off* | Keyboard lock disabled | | |
| | ANM | on | Animal weighing enabled, see chap. 7.10 | | |
| | | off* | Animal weighing disabled | | |

| | | | |
|---|----|---|--|
| P5 Unt Switch-over weighing unit, see chap. 7.5 | kg | on* | |
| | | off | |
| | g | on | |
| | | off* | |
| | lb | on | |
| | | off* | |
| | oz | on | |
| | | off* | |
| | tJ | on | |
| | | off | |
| | HJ | on | |
| | | off | |
| P6 xcl | | Not documented | |
| P7 rst | | Use  to reset balance settings to factory default. | |
| P8 uwb | | Not documented | |

Factory settings are marked by *.

8.2 Overview verified weighing systems (contacts of circuit board [K1] short-circuited by means of jumper)

In verified weighing systems the access to „P2 mode and „P4 tAr“ is locked.

KERN KFB-TM:



To disable the access lock, destroy the seal and actuate the adjustment switch.
Position of the adjustment switch see chap. 6.11.

KERN KFN-TM:



In order to unlock the access, the seal must be destroyed and both contacts of the printed circuit board [K2] must be short-circuited by a jumper, see chap. 6.11.

Attention:

After destruction of the seal the weighing system must be re-verified by an authorised agency and a new verification wire/seal mark fitted before it can be reused for applications subject to verification.

| Menu block Main menu | Menu item Submenu | Available settings / explanation | | |
|--|----------------------|--|---|--|
| PO CHK Weighing with tolerance range, see chap. 7.7 | nEt H | Upper limit value „Tolerance check weighing“, input see chap. 7.7.1 | | |
| | nEt LO | Lower limit value „Tolerance check weighing“, input see chap. 7.7.1 | | |
| | PCS H | Upper limit value „Tolerance check counting“, input see chap. 7.7.2 | | |
| | PCS L | Lower limit value „Tolerance check counting“, input see chap. 7.7.2 | | |
| | BEEP | no | Acoustic signal for weighing with tolerance range switched off | |
| | | ok | Audio sound when load is within tolerance limits | |
| | | ng | Audio sound when load is beyond tolerance limits | |
| P1 COM Interface parameter | MODE | CONT | S0 off Continuous data output, S0 on selectable “send zero” yes / no | |
| | | ST1 | One output for stable weighing value | |
| | STC | Continuous data output of stable weighing values | | |
| | PR1 | Output after pressing  | | |
| | PR2 | Manual totalizing, see chap. 7.8 Press  and the weighing value will be added to the summation memory and issued. | | |
| | AUTO | For automatic totalizing see chap. 7.9 This function is used to issue and add individual weighing values automatically to the summation memory on unloading of weighing scale. | | |

| | | | | | |
|---|--------|---|---|---|--|
| | | ASK | For remote control commands, see chap. 10.4 | | |
| | | wireless | Not documented | | |
| | baud | Available Baudrate: 600, 1200, 2400, 4800, 9600 | | | |
| | Pr | 7E1 | 7 bits, even parity | | |
| | | 7o1 | 7 bits, odd parity | | |
| | | 8n1 | 8 bits, no parity | | |
| | PtYPE | tPUP | Standard printer setting | | |
| | | LP50 | Not documented | | |
| | Lab | Lab x | Details see following table 1 | | |
| | Prt | Prt x | | | |
| | Lang | Eng* | Standard setting English | | |
| Chn | | | | | |
| P2 mode Konfigurations- daten | SiGr | Single-range balance | | | |
| | | COUNT | Display internal resolution | | |
| | | DECI | Position of the decimal dot | | |
| | | Div. | Readability [d] / verification value[s] | | |
| | | CAP | Balance capacity [Max] | | |
| | | CAL | noLin | Adjustment, see chap. 6.9 | |
| | | | LinEr | Linearisation, see chap. 6.10 | |
| | | GrA | Not documented | | |
| | dUAL 1 | Dual range balance | | | |
| | | Balance with two weighing ranges and different maximum load and weighing ranges and interval sizes but only one load-supporting pan, whereby each range extends from zero to the respective maximum capacity. When load is removed, weighing scales will remain in 2nd range. | | | |
| | | COUNT | Display internal resolution | | |
| | | DECI | Position of the decimal dot | | |
| | | div. | div 1 | Readability [d] / verification value [e] 1. weighing range | |
| | | | div 2 | Readability [d] / verification value [e] 2. weighing range | |
| | | CAP | CAP 1 | Weighing scale capacity [max] 1. Weighing range | |
| | | | CAP 2 | Weighing scale capacity [max] 2. Weighing range | |
| | | CAL | noLin | Adjustment, see chap. 6.9 | |
| | | | LinEr | For linearization, see chap. 6.10 | |
| | | GrA | Not documented | | |

| | | | |
|-----------------------------------|-------------|---|--|
| | dUAL 2 | Multi-interval balance Weighing scales with one weighing range subdivided into partial weighing ranges, each providing a different scale interval. The scale interval depends on the applied load and is automatically changed during loading and unloading. | |
| | | COUNT | Display internal resolution |
| | | DECI | Position of the decimal dot |
| | | div. | div 1 Readability [d] / verification value [e] 1. weighing range |
| | | | div 2 Readability [d] / verification value [e] 2. weighing range |
| | | CAP | CAP 1 Weighing scale capacity [max] 1. Weighing range |
| | | | CAP 2 Weighing scale capacity [max] 2. Weighing range |
| | | CAL | noLin Adjustment, see chap. 0 |
| | | | LinEr Linearisation, see chap. 6.10 |
| | | GrA | Not documented |
| P3 OTH s. Kap. 7.10 / 7.11 | LOCK | on | Keyboard lock enabled |
| | | off | Keyboard lock disabled |
| | ANM | on | Animal weighing enabled |
| | | off | Animal weighing disabled |
| P4 tAr Restricted taring range | | Press  , the current setting will be displayed. Using the navigation buttons (see chap. 2.1.1) select the desired setting, the active digit is flashing. Confirm input by  . | |
| | | | |
| P5 St Follow up tare | St on | Follow up tare switched on | |
| | St off | Follow up tare switched off | |
| P6 SP | 7.5, 15, 30 | Not documented | |

Tab. 1. Printout examples Standard printer

| Lab Prt | 0 | 1 | 2 | 3 |
|------------|---|--|--|---|
| 0~3 | ***** GS: 5.000kg ***** | ***** NT: 5.000kg TW: 5.000kg GW: 10.000kg ***** | ***** GS: 5.000kg TOTAL: 10.000kg ***** | ***** NT: 5.000kg TW: 5.000kg GW: 10.000kg TOTAL: 10.000kg ***** |
| 4~7 | ***** No.: 1 GS: 5.000kg ***** | ***** No.: 1 NT: 5.000kg TW: 5.000kg GW: 10.000kg ***** | ***** No.: 1 GS: 5.000kg TOTAL: 10.000kg ***** | ***** No.: 1 NT: 5.000kg TW: 5.000kg GW: 10.000kg TOTAL: 10.000kg ***** |

| | | | |
|----------------|--------------|--------------|-----------------------------------|
| GS / GW | Gross weight | NO | Number weighing processes |
| NT | Net weight | TOTAL | Total of all individual weighings |
| TW | Tare weight | | |

9 Service, maintenance, disposal

9.1 Clean

- Before cleaning, disconnect the appliance from the operating voltage.
- Do not use aggressive detergents (solvents or similar).

9.2 Service, maintenance


The appliance may only be opened by trained service technicians who are authorized by KERN.

Before opening, disconnect from power supply.

9.3 Disposal

Disposal of packaging and appliance must be carried out by operator according to valid national or regional law of the location where the appliance is used.


9.4 Error messages

| Error message | Description | Possible causes |
|-------------------|--|--|
| - - - - - | Maximum load exceeded | <ul style="list-style-type: none"> • Unload weighing system or reduce preload. |
| - - ol - - | | |
| Err 1 | Incorrect data input | <ul style="list-style-type: none"> • Follow format "yy:mm:dd" |
| Err 2 | Incorrect time entry | <ul style="list-style-type: none"> • Follow format "hh:mm:ss" |
| Err 4 | Zeroing range exceeded due to switching-on balance or pressing  (normally 4% max) | <ul style="list-style-type: none"> • Object on the weighing plate • Overload when zeroing |
| Err 5 | Keyboard error | |
| Err 6 | Value outside the A/D changer range | <ul style="list-style-type: none"> • Weighing plate not installed • Damaged weighing cell • Damaged electronics |
| Err 9 | Stability display does not appear | <ul style="list-style-type: none"> • Check the environmental conditions. |

| | | |
|----------------------|-----------------------|--|
| Err 10 | Communication error | <ul style="list-style-type: none"> No data |
| Err 15 | Gravitation error | <ul style="list-style-type: none"> Range 0.9 ~ 1.0 |
| Err 17 | Taring range exceeded | <ul style="list-style-type: none"> Reduce load |
| Fai I h / Fai I l | Adjustment error | <ul style="list-style-type: none"> Repeat adjustment. |
| Err P | Printer error | <ul style="list-style-type: none"> Check communication parameters |
| Ba lo / Lo ba | Battery very low | <ul style="list-style-type: none"> Recharge battery |

Should other error messages occur, switch balance off and then on again. If the error message remains inform manufacturer.

10 Data output RS 232C

You can print weighing data automatically via the RS 232C interface or manually by pressing  via the interface according to the setting in the menu.


This data exchange is asynchronous using ASCII - Code.

The following conditions must be met to provide successful communication between the weighing system and the printer.

- Use a suitable cable to connect the display unit to the interface of the printer. Faultless operation requires an adequate KERN interface cable.
- Communication parameters (baud rate, bits and parity) of display unit and printer must match. For a detailed description of interface parameters see chap. 8, menu block „P1 COM“ or „P2 COM“

10.1 Technical data

Connection 9 pin d-subminiature bushing

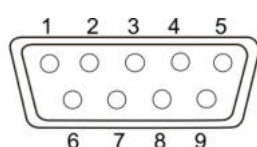

Pin 2 input

Pin 3 output

Pin 5 signal earth

Baud rate Optional 600/1200/2400/4800/9600

Parity 8 bits, no parity / 7 bits, even parity / 7 bits, odd parity

10.2 Printer mode

Printout examples (KERN YKB-01N):

- Weighing

| | |
|--------|---------|
| ST, GS | 1.000kg |
|--------|---------|

Symbols:

| | |
|---------|-----------------------------------|
| ST | Stable value |
| US | Instable value |
| GS / GW | Gross weight |
| NT | Net weight |
| TW | Tare weight |
| NO | Number weighing processes |
| TOTAL | Total of all individual weighings |
| <lf> | Space line |
| <lf> | Space line |

- Counting

```

*****
PCS           100
*****
  
```

10.3 Output log (continuous output)

- Weighing



HEADER1: ST=STABLE , US=UNSTABLE

HEADER2: NT=NET , GS=GROSS

10.4 Remote control instructions

| Command | Function | Printout examples |
|---------|--|--------------------------------|
| S | Stable weighing value for the weight is sent via the RS232 interface | ST,GS 1.000KG |
| W | Weighing value for the weight (stable or unstable) is sent via the RS232 interface | US,GS 1.342KG ST,GS 1.000KG |
| T | No data are sent, the balance carries out the tare function. | - |
| Z | No data are sent, the zero-display appears. | - |
| P | Quantity will be sent via the RS232-interface | 10PCS |

11 Instant help

In case of an error in the program process, briefly turn off the display unit and disconnect from power supply. The weighing process must then be restarted from the beginning.

Help:

Fault

Possible cause

The displayed weight does not glow.

- The display unit is not switched on.
- Mains power supply interrupted (mains cable defective).
- Power supply interrupted.
- (Rechargeable) batteries are inserted incorrectly or empty
- No (rechargeable) batteries inserted.

The displayed weight is permanently changing

- Draught/air movement
- Table/floor vibrations
- Weighing pan has contact with other objects.
- Electromagnetic fields / static charging (choose different location/switch off interfering device if possible)

The weighing result is obviously incorrect

- The display of the balance is not at zero
- Adjustment is no longer correct.
- Great fluctuations in temperature.
- Warm-up time was ignored.
- Electromagnetic fields / static charging (choose different location/switch off interfering device if possible)

Should other error messages occur, switch display unit off and then on again. If the error message remains inform manufacturer.

12 Installing display unit / weighing bridge



- Installation / configuration of a weighing system must be carried out by a well acquainted specialist with the workings of weighing balances.

12.1 Technical data

| | |
|----------------------|--|
| Supply voltage: | 5 V/150mA |
| Max. signal voltage | 0-10 mV |
| Zeroing range | 0-2 mV |
| Sensitivity | 2-3 mV/V |
| Resistance parameter | 80 - 100 Ω , max 4 items per 350 Ω load cell |

12.2 Weighing system design

The display unit is suitable for connection to any analogue platform in compliance with the required specifications.

The following data must be established before selecting a weighing cell:

- **Weighing balance capacity**
This usually corresponds to the heaviest load to be weighed.
- **Preload**
This corresponds to the total weight of all parts that are to be placed on the weighing cell such as upper part of platform, weighing pan etc.
- **Total zero setting range**
This is composed of the start-up zero setting range ($\pm 2\%$) and the zero setting range available to the user via the ZERO-key (2%). The total zero setting range equals therefore 4 % of the scale's capacity.


The addition of weighing scales capacity, preload and the total zero setting range give the required capacity for the weighing cell.

To avoid overloading of the weighing cell, include an additional safety margin.

- **Smallest desired display division**
- **Verifiability, if required**
The application of the display unit as a verified weighing system requires that you short-circuit the two contacts [K1] of the circuit board, using a jumper; for position see chap. 6.11.
Remove the jumper for weighing systems not able to be verified.

12.3 How to connect the platform

- ⇒ Disconnect the display unit from the power supply.
- ⇒ Solder the individual leads of the load cell cable onto the circuit board. See diagrams below.

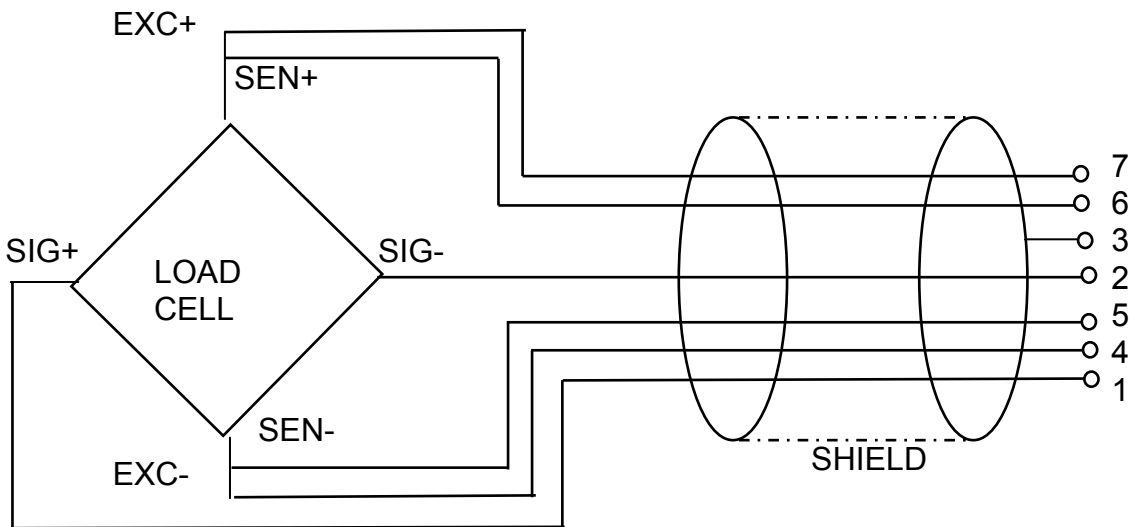

| PIN | Loadcell | |
|-----|--------------|--------------|
| | 6- conductor | 4- conductor |
| 7 | EXC+ | EXC+ |
| 6 | SEN+ | |
| 5 | EXC- | EXC- |
| 4 | SEN- | |
| 3 | SHIELD | SHIELD |
| 2 | SIG- | SIG- |
| 1 | SIG+ | SIG+ |

12.4 Configure display unit

12.4.1 Verified weighing systems

(contacts of circuit board [K1] short-circuited by means of jumper)

For menu overview see chap. 8.2.

In verified weighing systems the menu item for calibration „P2 mode“ is blocked.

KERN KFB-TM:



















To disable the access lock, destroy the seal and actuate the adjustment switch.
Position of the adjustment switch see chap. 6.11

KERN KFN-TM:






















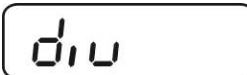
To override the blocked access you will have to destroy the seal before calling up the menu and to short-circuit the two contacts on the circuit board [K2], using a jumper (See chap. 6.11).



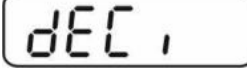




Attention:

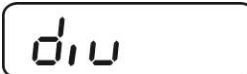After destruction of the seal the weighing system must be re-verified by an authorised agency and a new verification wire/seal mark fitted before it can be reused for applications subject to verification.















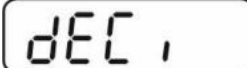
| | |
|--|---|
| <p>Call up menu:</p> <p>⇒ Switch-on balance and during the selftest press .</p> |  |
| <p>⇒ Press , ,  subsequently, the first menu block „PO CHK“ will be displayed.</p> |  |
| <p>⇒ Press  repeatedly until „P2 mode“ will be displayed.</p> <p>⇒ Operate the adjustment switch (models KFB-TM).</p> |  |
| <p>⇒ Press  and use  to select the weighing scales type.</p> <p> Single-range balance</p> <p> Dual range balance</p> <p> Multi-interval balance</p> |      |

Example single range scales *SIG* (d = 10 g, max. 30 kg)


| | |
|---|---|
| <p>⇒ Confirm selected weighing scales type by pressing ; the first menu item „COUNT“ will be shown.</p> |  |
| <p>1. Display internal resolution</p> <p>⇒ Press , the internal resolution will be shown.</p> <p>⇒ Return to menu by .</p> <p>⇒ Press  to select the next menu item.</p> |    |
| <p>2. Position decimal point</p> <p>⇒ Press , the currently set position of the decimal dot is displayed.</p> <p>⇒ Press  to select the desired setting. Options 0, 0.0, 0.00, 0.000, 0.0000.</p> <p>Confirm input by .</p> <p>⇒ Press  to select the next menu item.</p> |    |
| <p>3. Readability</p> <p>⇒ Press , and current setting will be displayed.</p> <p>Select desired setting by .</p> <p>Options 1, 2, 5, 10, 20, 50.</p> <p>Confirm entry by .</p> <p>⇒ Press  to select the next menu item.</p> |    |


| | |
|--|--|
| <p>4. Capacity</p> <p>⇒ Press , the current setting will be displayed.</p> <p>Using the navigation buttons (see chap. 2.1.1) select the desired setting, the active digit is flashing.</p> <p>Confirm input by .</p> <p>⇒ Press  to select the next menu item.</p> <p>5. Adjustment / linearization Adjustment or linearization is required after entering configuration data. For carrying out adjustment see chap. 6.9.1/step 6 or chap. 6.10.1 for linearisation</p> |     |
|--|--|

Example dual range scales *dUAL 1* (d = 2 / 5 g, max. 6 / 15 kg)

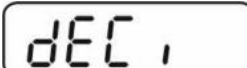
| | |
|---|---|
| <p>⇒ Confirm selected weighing scales type by ; the first menu item „COUNT“ will be shown.</p> |  |
| <p>1. Display internal resolution</p> <p>⇒ Press , the internal resolution will be shown.</p> <p>⇒ Return to menu by .</p> <p>⇒ Press  to select the next menu item.</p> |    |
| <p>2. Position decimal point</p> <p>⇒ Press , the currently set position of the decimal dot is displayed.</p> <p>⇒ Use  to select the desired setting. Options 0, 0.0, 0.00, 0.000, 0.0000.</p> <p>Confirm input by .</p> <p>⇒ Press  to select the next menu item.</p> |    |


3. Readability

⇒ Press , the display used to enter readability/verification value for first weighing range will appear.

⇒ Press , the current setting will be displayed.


⇒ Select desired setting with  and acknowledge by .

⇒ Press  to enter the next menu item for readability/verification value for second weighing range.

⇒ Press , and current setting will be displayed.

⇒ Select desired setting with  and acknowledge by .

⇒ Press , the unit will return to the menu

⇒ Press  to select the next menu item.

div

div 1 kg

2

div 1 kg











div 2 kg

5

div 2 kg

div




4. Capacity

- ⇒ Press  and the display for entering the capacity for the first weighing range will appear.
- ⇒ Press  and current setting will be displayed.
- ⇒ Select desired setting with  and acknowledge by .
- ⇒ Press  to select the next menu item used to enter the capacity for the second weighing range.
- ⇒ Press  and current setting will be displayed.
- ⇒ Select desired setting with  and acknowledge by .
- ⇒ Press , the unit will return to the menu
- ⇒ Use  to select next menu item.

5. Adjustment / linearization

Adjustment or linearization is required after entering configuration data.

For carrying out adjustment see chap. 6.9.1/step 6 or chap. 6.10.1 for linearisation

- ⇒ Acknowledge using , the current setting is displayed.
- ⇒ Acknowledge by , select desired setting with 
noLin = Adjustment
LinER = Linearisation

CAP

CAP 1

1006.00 kg

CAP 1

CAP 2

1015.00 kg

CAP 2

CAP
















CAL















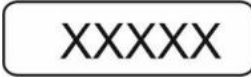


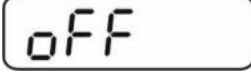


noLin



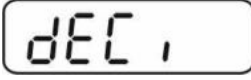














 ↓↑
 LinER

















12.4.2 Non verifiable weighing systems (contacts of circuit board [K1] not short-circuited)

☞ For menu overview see chap. 8.1.

| | |
|--|--|
| <p>Call up menu</p> <p>⇒ Switch-on balance and during the selftest press  .</p> <p>⇒ Press , ,  subsequently , the first menu block „PO CHK“ will be displayed.</p> <p>⇒ Press  repeatedly until „CAL“ will be displayed.</p> <p>⇒ Press , the first menu item „COUNT“ will be displayed.</p> |     |
| <p>Navigation in the menu</p> <p>⇒ With help of , the individual menu items can be selected one after the other.</p> <p>⇒ Confirm selected menu item by pressing . The current setting will be displayed.</p> <p>⇒ To change to the available settings, press the navigations keys as described in chap. 2.1.1.</p> <p>⇒ Either save by pressing  or cancel by pressing .</p> <p>⇒ Press  repeatedly to exit menu.</p> | |

| Parameter selection | |
|---|--|
| <p>1. Display internal resolution</p> <p>⇒ Press , the internal resolution will be shown.</p> <p>⇒ Return to menu by .</p> <p>⇒ Use  to select another menu item.</p> |    |
| <p>2. Position decimal point</p> <p>⇒ Press , the currently set position of the decimal dot is displayed.</p> <p>To make changes using the navigation keys (See chap. 2.1.1), select the desired setting. Options 0, 0.0, 0.00, 0.000, 0.0000.</p> <p>Confirm input by .</p> <p>⇒ Use  to select another menu item.</p> |    |
| <p>3. Weighing scales type, capacity and readability</p> <p>⇒ Press , and current setting will be displayed.</p> <p>⇒ Select desired setting by .</p> <p>„off“ Single-range balance „on“ Dual range balance</p> <p>⇒ Press  to confirm, the display for entering readability (for dual range scales for the first weighing range) appears.</p> <p>⇒ Press , the current setting will be displayed.</p> |     |

| | |
|--|---|
| ⇒ Select desired setting with  and acknowledge by  . |  |
| ⇒ Press  , the display for entering capacity will appear (at dual range balance for the first range). |  |
| ⇒ Press  , the current setting will be shown (such as max. = 2000kg). |  |
| ⇒ Using the navigation buttons (see chap. 2.1.1) select the desired setting, the active digit is flashing. | |
| ⇒ Acknowledge with  . In a single-range balance the entry of capacity / readability is finished. |  |
| either in single-range balance | |
| ⇒ Press  , the unit will return to the menu Press  to call up next menu item „CAL“. | |
| or | |
| In a dual range balance enter readability/verification value and capacity of the second weighing range. | |
| ⇒ Press  , the display for entering the capacity of the second weighing range will appear. |  |
| ⇒ Press  , the current setting will be displayed. |  |
| ⇒ Using the navigation buttons (see chap. 2.1.1) select the desired setting, the active digit is flashing. | |
| ⇒ Confirm input by  . |  |

| | |
|---|--|
| <p>⇒ Press , the display for entering the readability of the second weighing range will appear.</p> <p>⇒ Press , the current setting will be displayed.</p> <p>⇒ Select desired setting with  and acknowledge by .</p> <p>⇒ Press , the unit will return to the menu</p> <p>⇒ Press  to call next menu item.</p> |     |
| <p>4. Adjustment or linearisation Adjustment or linearisation is required after entering configuration data. For carrying out adjustment see chap. 6.9.2/step 4 or chap. 6.10.2 for linearisation</p> <p>⇒ Acknowledge using , the current setting is displayed.</p> <p>⇒ Press  to confirm, press  to select the desired setting noLin = Adjustment LineAr = Linearisation</p> |   ↓  |

1. Name and type of instrument

The indicators KFN-TM / KFB-TM are a family of weighing indicators suitable to be incorporated in non-automatic weighing instruments, class III or class IIII, with single-interval, multi-interval or multi-range.

2. Description of the construction and function

2.1 Construction

The electronic indicator consists of a single circuit board, SMD populated on both sides as the A/D-interface circuits, the microprocessor and the voltage regulation are placed on one side and the LCD display on the other side.

The LCD-display has indication for: Stable, zero, gross, net, tare, and weight unit (kg, g, t), and 5½ digits with a height of 52 mm.

The enclosure is made of stainless steel for the KFN-TM indicator or of ABS plastics for KFB-TM.

The front of the enclosure has an on/off key plus 6 keys for operating the functions of the indicator.

All instrument calibration and metrological setup data are stored in the non-volatile memory.

The indicators are power supplied with 9 - 12 VDC - normally supplied by external 230 VAC to 9 - 12 VDC adapter. An optional internal battery can be factory installed.

As part of the indicators EMC protection ferrites shall be placed as follows:

- Externally around the DC supply cable near its connection to the indicator (min. 1 turn).
- Internal on cable between power plug and main board (4 turns).
- Internal on cable between load cell connector and main board (min. 2 turns).

Software

The software version is displayed during the start-up of the indicator.

The tested software version is 1.07.

Sealing

The configuration and calibration data can only be changed if the calibration jumper is installed on the circuit board.

2.2 Function

The devices are a microprocessor based electronic weighing indicators for connection of strain gauge load cells.

List of devices:

- Self test
- Determination and indication of stable equilibrium
- Initial zero-setting $\pm 10\%$ of Max
- Semi-automatic zero-setting $\pm 2\%$ of Max
- Automatic zero-tracking $\pm 2\%$ of Max

- Indication of zero
- Semi-automatic subtractive tare
- Acting upon significant fault
- Weighing unstable samples
- Real time clock (optional)

3. Technical data

3.1 Indicator

| | |
|--|--|
| Type | KFN-TM / KFB-TM |
| Accuracy class | III or IIII |
| Weighing range | Single-interval, multi-interval or multi-range |
| Maximum number of verification scale intervals (n) | 6000 for single-interval 2×3000 for multi-interval and multi-range, however limited to 1000 for Class IIII |
| Minimum input voltage per VSI | 1 μ V |
| Maximum capacity of interval or range (Max _i): | $n_i \times e_i$ |
| Verification scale interval, e _i = | Max _i / n _i |
| Initial zero-setting range: | ± 10 % of Max |
| Maximum tare effect: | 100 % of Max |
| Fractional factor (pi) | 0.5 |
| Excitation voltage | 5 VDC |
| Circuit for remote sense | Active, (see below) |
| Minimum input impedance | 87 ohm |
| Maximum input impedance | 1600 ohm |
| Connecting cable to load cell(s): | See Section 3.1.1 |
| Supply voltage: | 9 - 12 VDC 230 VAC using external Vac/2Vdc adapter |
| Operating temperature range | Min / Max = -10 °C / +40 °C |
| Peripheral interface(s) | See Section 4 |

3.1.1 Connecting cable between the indicator and the junction box for load cell(s), if any

3.1.1.1 4-wire system

| | |
|----------------|--|
| Line | 4 wires, shielded |
| Maximum length | The certified length of the load cell cable, which shall be connected directly to the indicator. |

3.1.1.2 6-wire system

| | |
|-----------------------------|-----------------------|
| Line | 6 wires, shielded |
| Maximum length | 227 m/mm ² |
| Maximum resistance per wire | 3.8 ohm |

4. Interfaces

4.1 Load cell interface

Refer to section 3.1.1.

Any load cell(s) can be used for instruments under this certificate provided the following conditions are met:

- There is a respective test certificate (EN 45501) or an OIML Certificate of Conformity (R60) issued for the load cell by a Notified Body responsible for type examination under the Directive 2009/23/EC.
- The certificate contains the load cell types and the necessary load cell data required for the manufacturer's declaration of compatibility of modules (WELMEC 2, Issue 5, 2009, section 11), and any particular installation requirements. A load cell marked NH is allowed only if humidity testing to EN 45501 has been performed.
- The compatibility of load cells and indicator is established by the manufacturer by means of the compatibility of modules form, contained in the above WELMEC 2 document, or the like, at the time of EC verification or declaration of EC conformity of type.
- The load transmission must conform to one of the examples shown in the WELMEC 2.4 Guide for load cells.

4.2 Peripheral interfaces

The indicator may be equipped with one or more of the following protective interfaces that have not to be secured.

- RS-232C
- Analogue output (0 - 10 V / 4 - 20 mA)
- Digital output
- Blue Tooth

The peripheral interfaces are characterised "Protective interfaces" according to paragraph 8.4 in the Directive.

5. Conditions for use

Legal use of the indicator for automatic weighing or as counting device is not allowed with reference to this test certificate.

6. Location of seals and inscriptions

Seals shall bear the verification mark of a notified body or alternative mark of the manufacturer according to ANNEX II, section 2.3 of the Directive 2009/23/EC. The seals shall be placed so that the enclosure can not be opened.

Location of CE mark of conformity:

The CE mark of conformity is placed on the overlay on the rear side of the device.

Inscription on the overlay:

Type, accuracy class, Temp. -10 °C / +40 °C, Certificate No. DK0199-R76-11.04.

Other inscriptions on the overlay:

Manufacturer's name and/or logo, Part No, Supply voltage.

7. Tests

The indicator has been tested according to EN 45501 and WELMEC 2.1 Guide for testing of indicators.

Examination / tests

| |
|---|
| Temperature tests: 20 / 40 / -10 / 5 / 20 (tested at minimum input-voltage sensitivity) |
| Temperature effect on no-load indication (tested at minimum input-voltage sensitivity) |
| Stability of equilibrium |
| Repeatability |
| Warm-up time |
| Voltage variations |
| Short time power reductions |
| Electrical bursts |
| Electrostatic discharges |
| Immunity to radiated electromagnetic fields |
| Damp heat, steady state |
| Span stability |
| Checklist |
| Maximum load cell cable length and impedance of cable to load cell |
| Load cell interface measurements with interruptions of the sense circuit |

The test item fulfilled the maximum permissible errors at all tests.

8. Documentation

Contents of the technical documentation held by the notified body:

8.1 Product specification

- Manuals and descriptions
- Drawings
- Etc.

8.2 Examination report

OIML R76 report no. DANAK-1910568, DANAK-1910388 and NMI 709226.

8.3 Test results

Report no. DANAK-1910568, DANAK-1910388 and NMI 709226.


9. Pictures



After remove the label, you will find VOID on housing, or a self destroyable sticker/seal shall be used.

Figure 1 Sealing of KFN-TM.



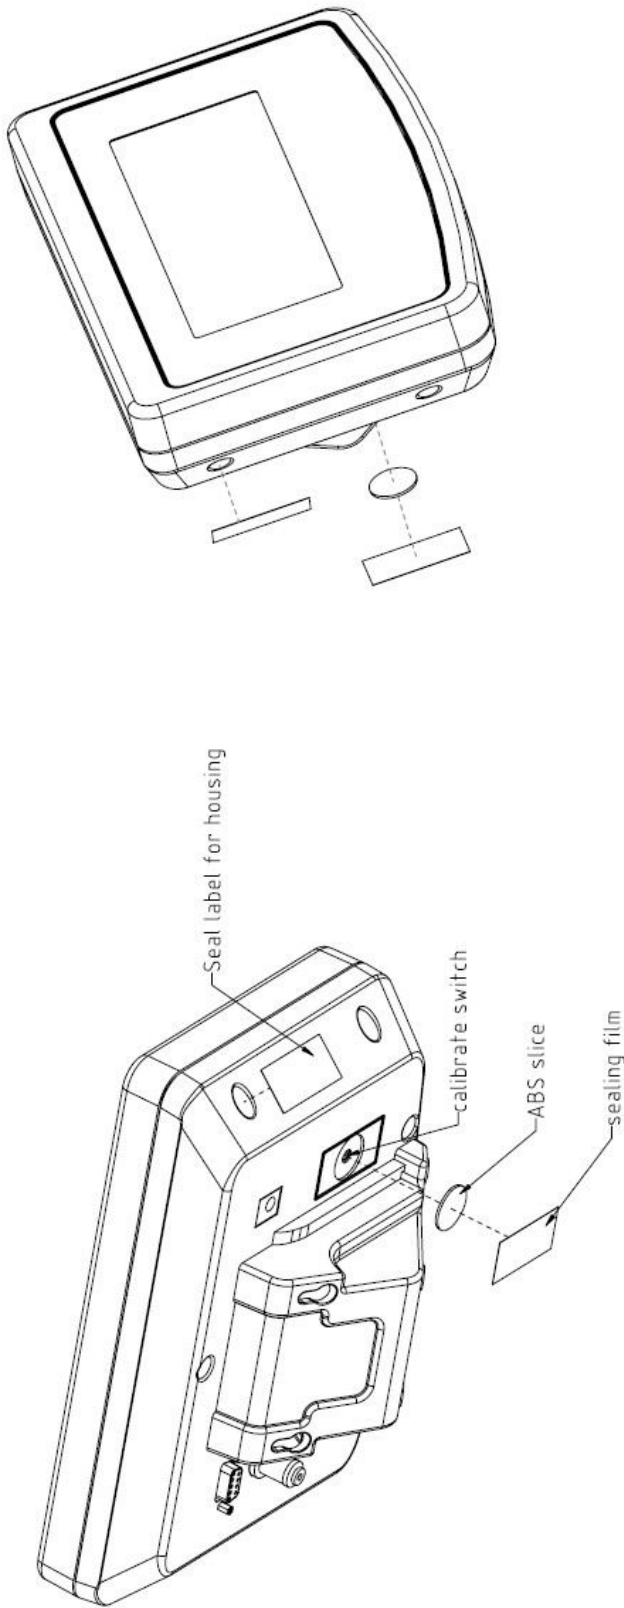

After calibration, assemble the seal cover (ABS) on the hole, then fix the seal film (self destroyed type), if you want to enter the calibration mode, the calibration switch must be pressed, so the sealing must be destroyed.

Figure 2 Sealing of KFB-TM.

