

User manual IM3

Alternating voltage / Alternating current signal rms-value (TRMS) 0-300 VAC, 0-600 VAC, 0-1 AAC, 0-5 AAC



Technical features:

- red display of -19999...99999 digits (optional: green, orange, blue)
- installation depth: 120 mm without plug-in terminal
- min/max-memory
- 30 adjustable setpoints
- display flashing at threshold value exceedance / undercut
- · digital input for triggering of Hold, Tara
- permanent min/max value recording
- volume metering (totaliser)
- mathematical functions like reciprocal value, square roots, squaring or rounding
- · setpoint generator
- sliding averaging
- brightness control
- programming interlock via access code
- protection class IP65 at the front
- pluggable screw terminal
- optional galvanic isolated digital input
- optional 1 or 2 analog outputs or 8 PhotoMos-outputs
- optional 2 or 4 relay outputs
- optional interface RS232 or RS485
- accessories: PC-based configuration kit PM-TOOL incl. CD and USB-adapter for devices without keypad and for a simple adjustment of standard devices

Tel.: 03303 / 504066

Fax: 03303 / 504068

Identification

STANDARD TYPES	ORDER NUMBER
Alternating current/voltage Housing size: 96x48 mm	IM3-1VR5B.0H04.S70BD

Options – breakdown of order code:

		IM	3-	1	٧	R	5	В.	0	н	0	4.	s	7	2	В	D	
Standard type M-line				•											_		_	Dimension Diphysical unit
139 mm, incl. plug-in terminal	3																	Version B B
Housing size 96x48x120 mm (BxHxD)	1																	Switching points 0 no switching points
Type of display V, A	V																	2 2 relay outputs 4 4 relay outputs 8 PhotoMos outputs
Display colour Blue Green Red Orange	B G R Y																	Protection class 1 without keypad, operation via PM-TOOL 7 IP65 / plug-in terminal
Number of digits 5-digit	5																	Supply voltage S 100-240 VAC, DC +/-10%
Digit height 14 mm	В																	Measuring input 4 Alternating current, voltage TRMS
Digital input without 1 digital input Interface RS232 Interface RS485	0 1 3 4																	Analog output 0 without 1x 0-10 VDC, 0/4-20 mA Y 2x 0-10 VDC, 0/4-20 mA
AC input 600 VAC, 300 VAC, 5 AAC, 1	ΑН																	

Please state physical unit by order, e.g. A.

Contents

1.	Brief description	2
2.	Assembly	2
3.	Electrical connection	3
4.	Description of function and operation	4
	4.1. Programming software PM-TOOL	5
5.	Setting up the device	6
	5.1. Switching on	6
	5.2. Standard parameterisation (flat operation level)	6
	Value assignment for the triggering of the signal input	
	5.3. Programming interlock "RUN"	9
	Activation/Deactivation of the programming interlock or change into professional or flat operation level	
	5.4. Extended parametersation (professional operation level)	9
	5.4.1. Signal input parameters "INP"	9
	Value assignment for the triggering of the signal input incl. linearisation	
	5.4.2. General device parameters "FCT"	13
	Superior device functions like Hold, Tara, min/max permanent, setpoint value function /	
	nominal value function, averaging, brightness control, suppression of negative Offsets, as well as the control of the digital input and keyboard layout	
	5.4.3. Safety parameters "COD"	17
	Assignment of user and master code to lock or to receive access to defined parameter such as	
	analog output and alarms, etc	
	5.4.4. Serial parameters " <i>SER</i> "	18
	Parameter for interface definition	
	5.4.5. Analog parameters " <i>0UT</i> " and " <i>0UZ</i> "	19
	Analog output functions	
	5.4.6. Relay functions "REL"	22
	Parameter for setpoint definition	
	5.4.7. Alarm parameters " <i>RL1RLY</i> "	24
	Actuator and dependencies of the alarms	
	5.4.8. Totaliser (Volume metering) "TOT"	26
	Parameter for calculation of the sum function	
6.	Reset to factory settings	27
	Reset parameters onto the delivery state	
7.	Alarms / Relays	28
	Functional principle of the switching outputs	
8.	Interfaces	29
	Connection RS232 and RS485	
9.	Sensor aligment	30
	Diagram of functional sequences for sensors with existing adjustable resistor	
10.	Technical data	31
11.	Safety advices	33
12.	Error elimination	34

1. Brief description

The panel meter instrument **M3-14H** is a 5-digit device for AC current / AC voltage signals (TRMS) and a visual threshold value monitoring via the display. The configuration happens via four keys at the front or via the optional PC software PM-TOOL. The integrated programming interlock prevents unrequested changes of parameters and can be unlocked again with an individual code. Optional the following functions are available: a digital input for triggering of Hold (Tara), one analog output and interfaces for further evaluating in the unit.


With help of the galvanic isolated setpoints (optional), free adjustable limit values can be controlled and reported to a superior master display.

The electrical connection is done via plug-in terminals on the back side.

Selectable functions like e.g. the recall of the min/max-value, an averaging of the measuring signals, a nominal presetting or setpoint presetting, a direct threshold value regulation during operation mode and further measuring setpoints for linearisation, complete the modern device concept.

2. Assembly

Please read the Safety advices on page 33 before installation and keep this user manual for future reference.

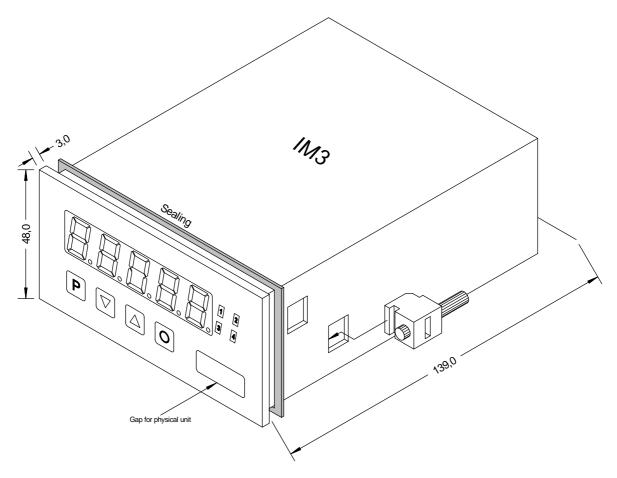


- 1. After removing the fixing elements, insert the device.
- 2. Check the seal to make sure it fits securely.
- 3. Click the fixing elements back into place and tighten the clamping screws by hand. Then use a screwdriver to tighten them another half a turn.

CAUTION! The torque should not exceed 0.1 Nm!


The dimension symbols can be exchanged before installation via a channel on the side!


3. Electrical connection

Type IM3-1VR5B.0H04.470BD with a supply of 100-240 VAC, DC \pm 10%

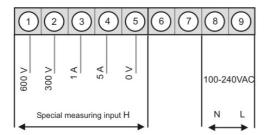


Options:

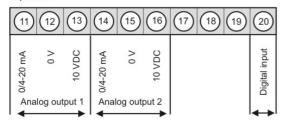




Relay 1 and 2

Relay 3 and 4



8 PhotoMos outputs

alternatively to analog output 2




Interface RS232 (Modbus protocol)



Interface RS485 (Modbus protocol)

M3 with digital input and external voltage source



4. Description of function and operation

Operation

The operation is divided into three different levels.

Menu level (delivery status)

This level was designed for the standard settings of the device. Only menu items which are sufficent to set the device into operation are displayed. To get into the professional level, run through the menu level and parameterise **PROF** under menu item **RUN**.

Menu group level (complete function volume)


Suited for complex applications as e.g. linkage of alarms, setpoint treatment, totaliser function etc. In this level function groups which allow an extended parameterisation of the standard settings are availabe. To leave the menu group level, run through this level and parameterise **ULDC** under menu item **RUN**.

Parameterisation level:

Parameters deposited in the menu item can here be parameterised. Functions, that can be changed or adjusted, are always signalised by a flashing of the display. Settings that are made in the parameterisation level are confirmed with **[P]** and thus saved. Pressing the **[O]-key** ("zero-key") leads to a break-off of the value input and to a change into the menu level. All adjustments are saved automatically by the device and changes into operating mode, if no further key operation is done within the next 10 seconds.

Level	Key	Description
	Р	Change to parameterisation level and deposited values.
Menu level		Keys for up and down navigation in the menu level.
	0	Change into operation mode.
	Р	To confirm the changes made at the parameterisation level.
Parameterisation level		Adjustment of the value / the setting.
	0	Change into menu level or break-off in value input.
	Р	Change to menu level.
Menu group level		Keys for up and down navigation in the menu group level.
	0	Change into operation mode or back into menu level.

Function chart:

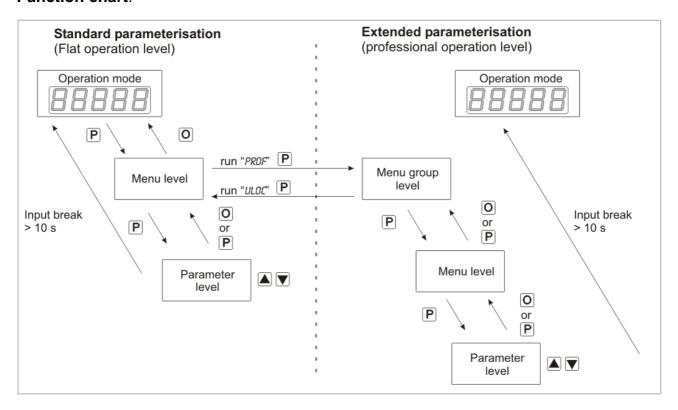

Underline:

- P Takeover
- O Stop
- ▲ Value selection (+)
- ▼ Value selection (-)

4.1 Parameterisation software PM-TOOL:

Part of the PM-TOOL are the software on CD and an USB-cable with device adapter. The connection happens via a 4-pole micromatch-plug on the back side of the device, to the PC-side the connection happens via an USB plug.

System requirements: PC incl. USB interface Software: Windows XP, Windows VISTA

With this tool the device configuration can be generated, omitted and saved on the PC. The parameters can be changed via the easy to handle program surface, whereat the operating mode and the possible selection options can be preset by the program.

5. Setting up the device

5.1. Switching on


Once the installation is complete, start the device by applying the voltage supply. Before, check once again that all electrical connections are correct.


Starting sequence


For 1 second during the switching-on process, the segment test (**B B B B B**) is displayed followed by an indication of the software type and, after that, also for 1 second the software version. After the starting sequence, the device switches to operation/display mode.

5.2. Standard parameterisation: (Flat operation level)

To parameterise the display, press the **[P]**-key in operating mode for 1 second. The display then changes to the menu level with the first menu item **TYPE**.

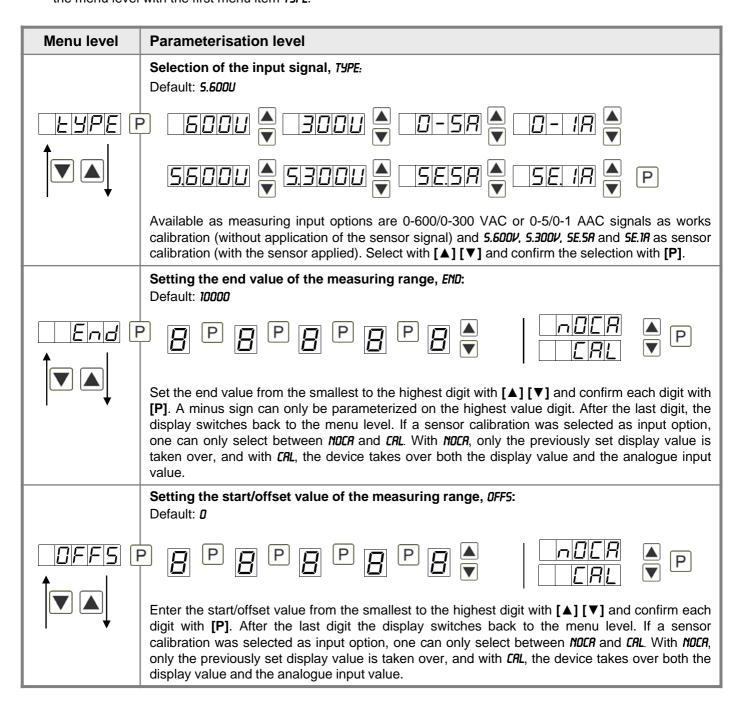

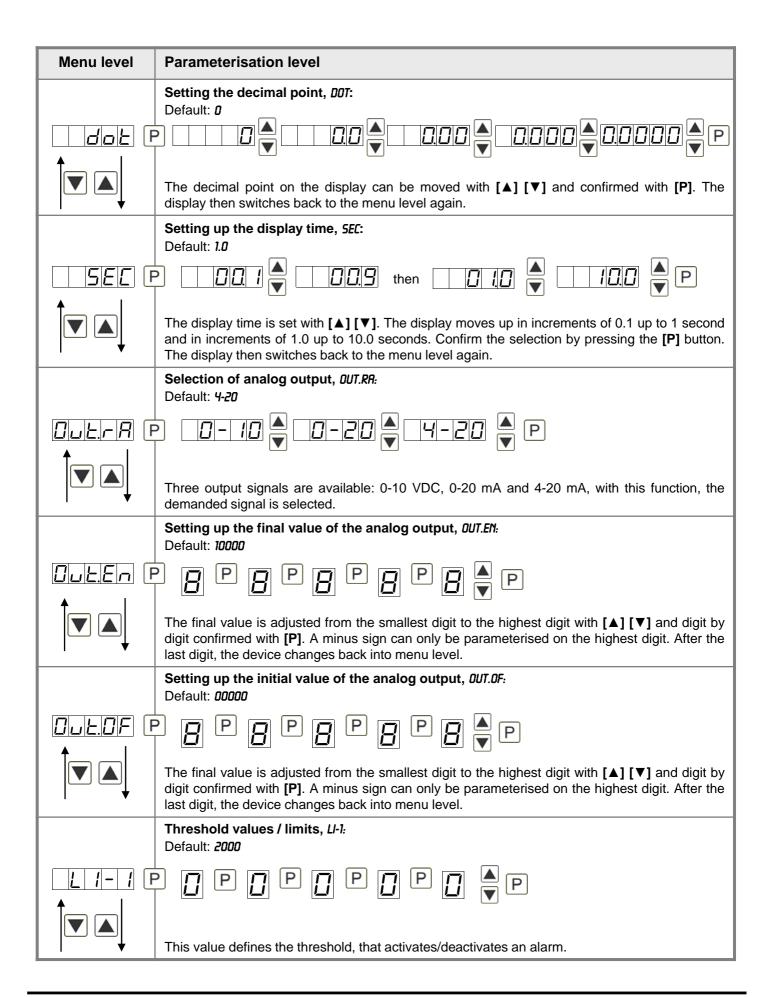

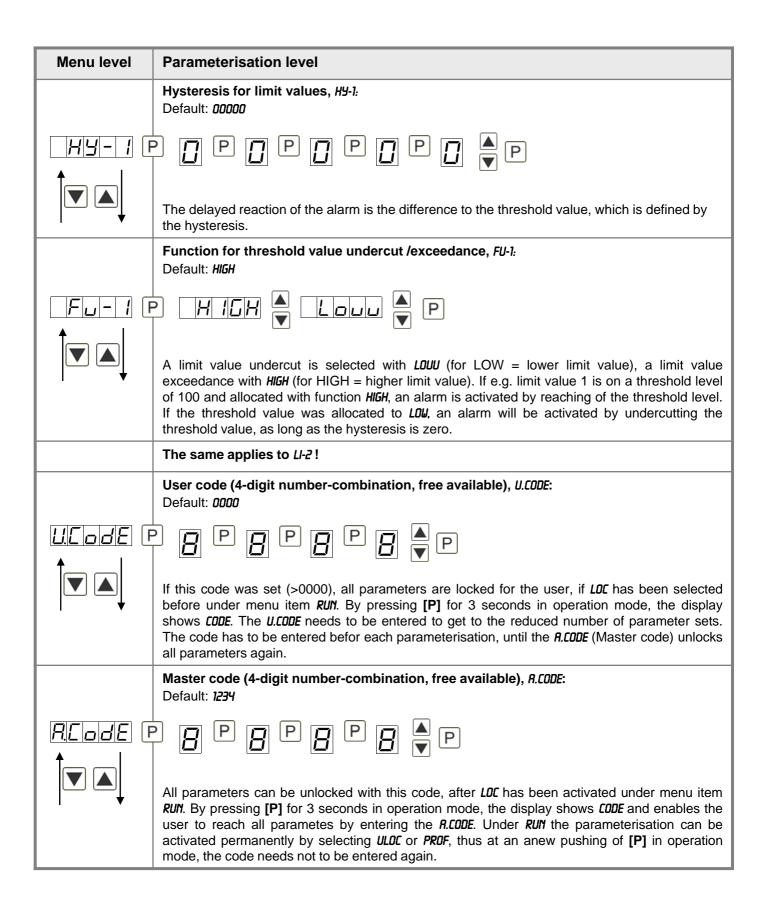



5.3. Programming interlock "RUN"


Menu level	Parameterisation level
	Activation / deactivation of the programming lock or completion of the standard parameterisation with change into menu group level (complete function range), RUM: Default: ULDC
	With the navigation keys [♠] [▼], choose between the deactivated key lock ULOC (works
	setting) and the activated key lock <i>LDC</i> , or the change into the menu group level <i>PRDF</i> . Confirm the selection with [P] . After this, the display confirms the settings with "", and automatically switches to operating mode. If <i>LDC</i> was selected, the keyboard is locked. To get back into the menu level, press [P] for 3 seconds in operating mode. Now enter the <i>CDDE</i> (works setting 1 2 3 4) that appears using [A] [V] plus [P] to unlock the keyboard. <i>FRIL</i> appears if the input is
	wrong. To parameterise further functions PROF needs to be set. The device confirms this setting with ", and changes automatically in operation mode. By pressing [P] for approx. 3 seconds in operation mode, the first menu group INP is shown in the display and thus confirms the change into the extended parameterisation. It stays activated as long as ULOC or LOC is entered in menu group RUN .


5.4. Extended parameterisation (Professional operation level)


5.4.1. Signal input parameters

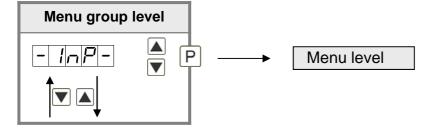

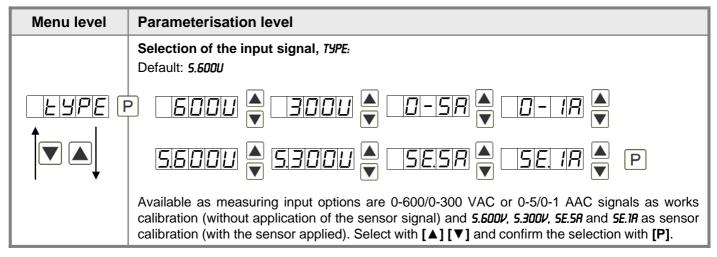


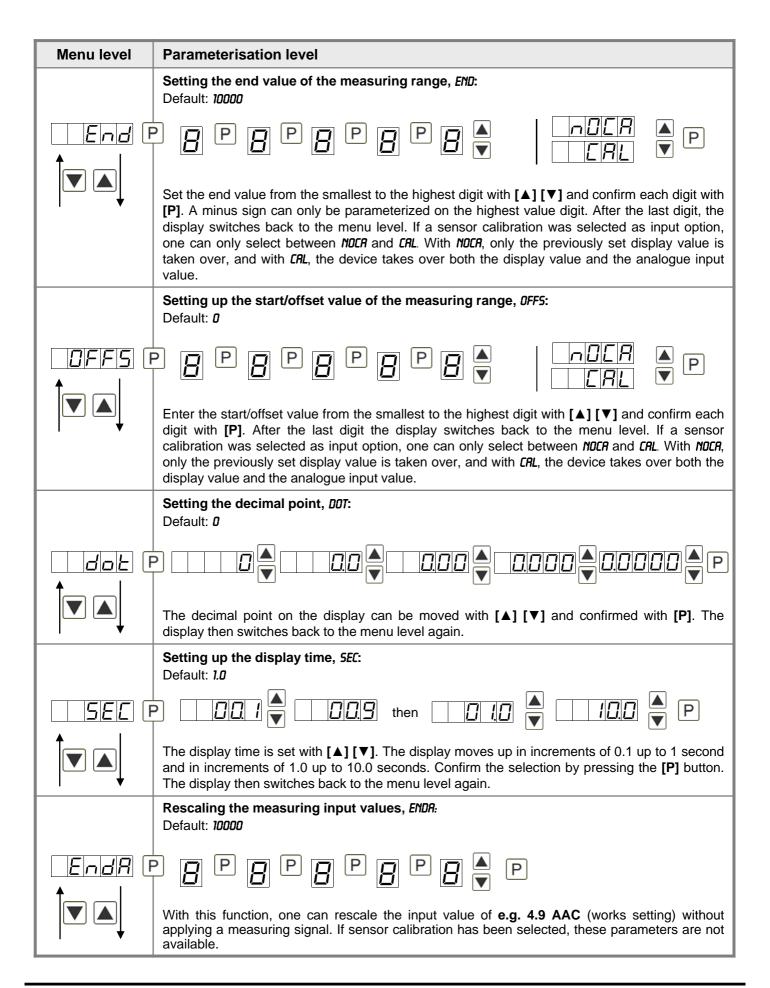


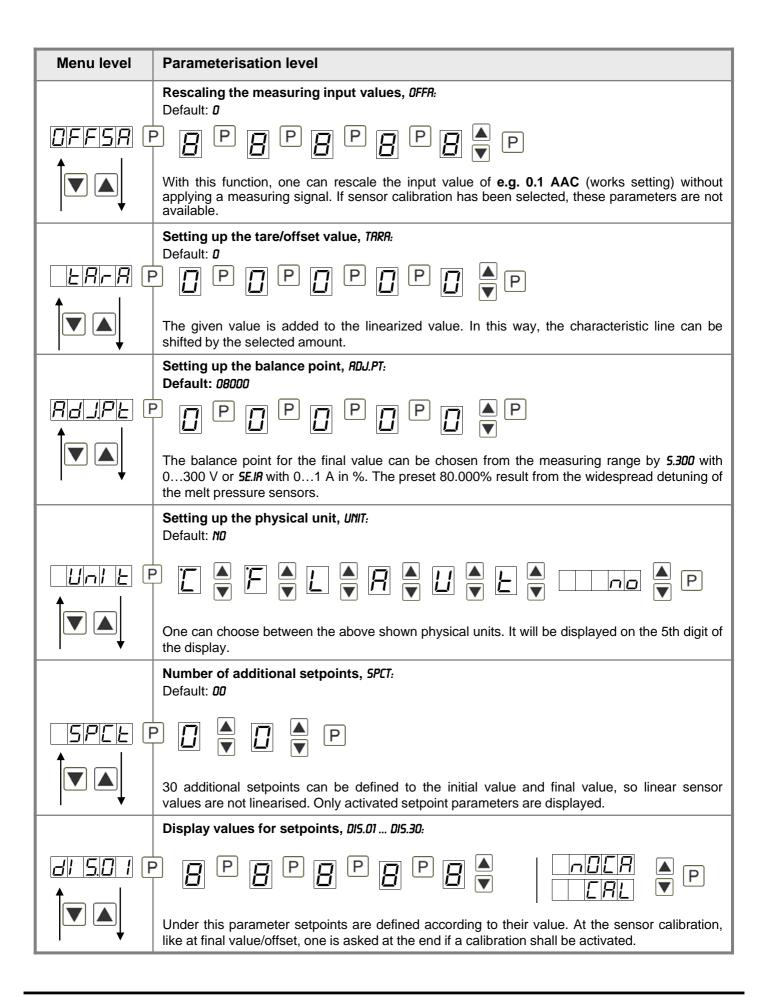


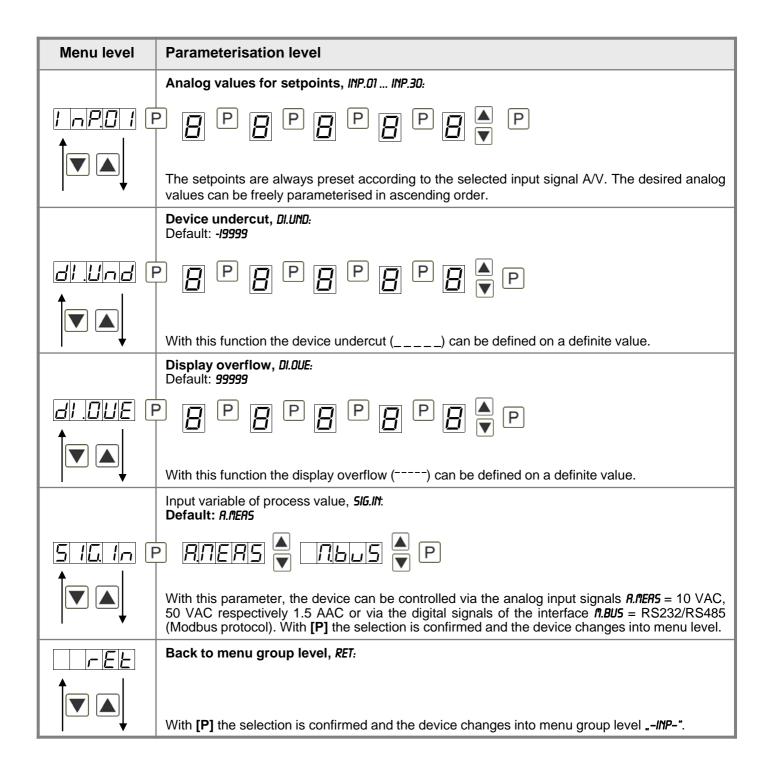



5.4.2. General device parameters

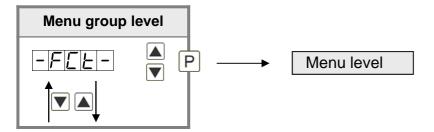

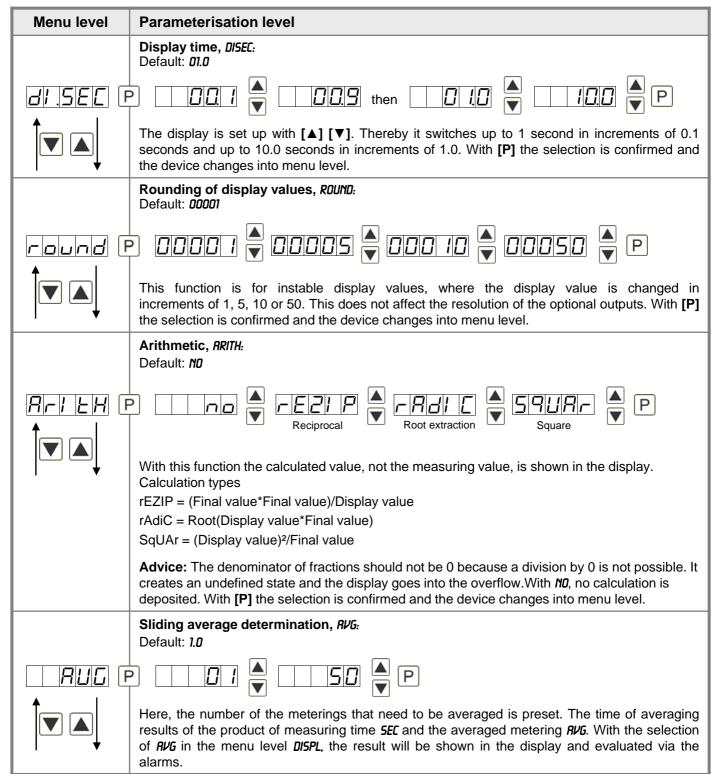


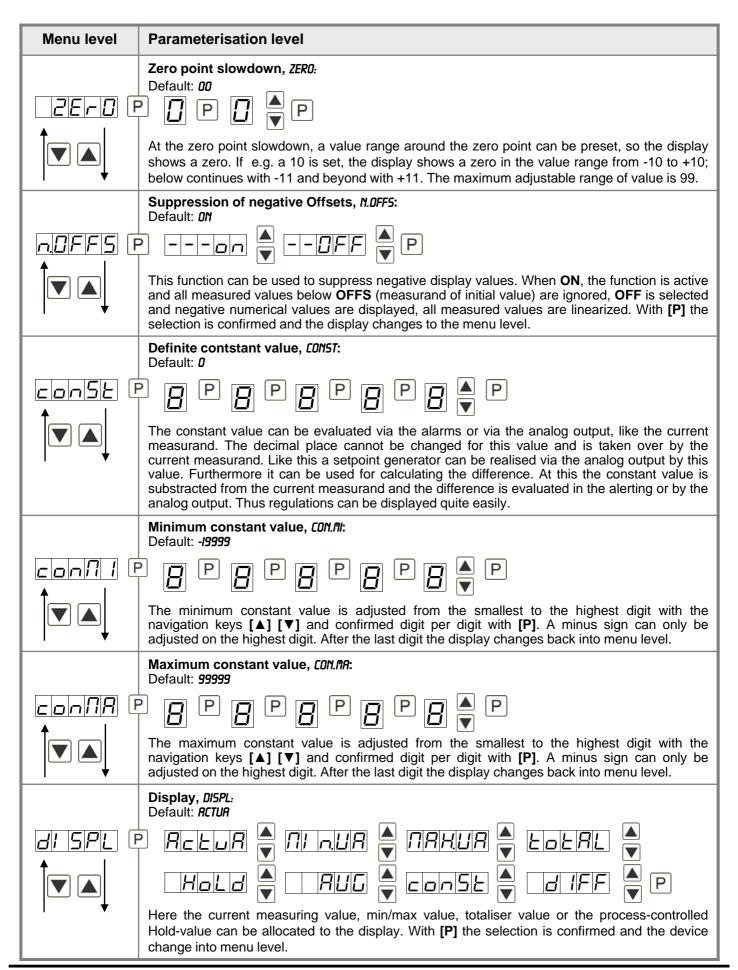


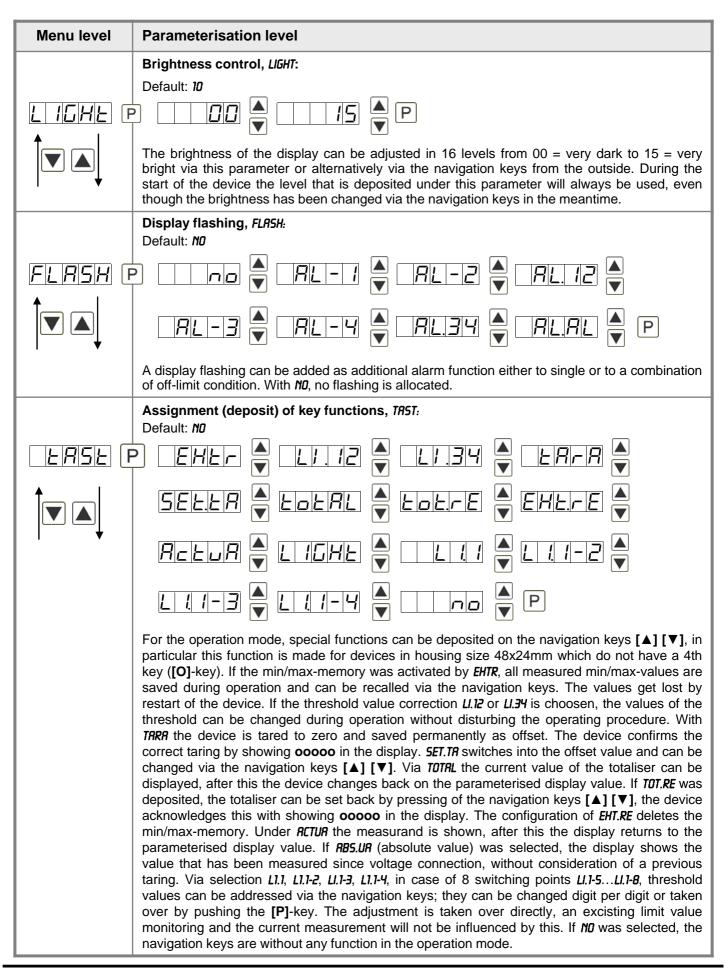

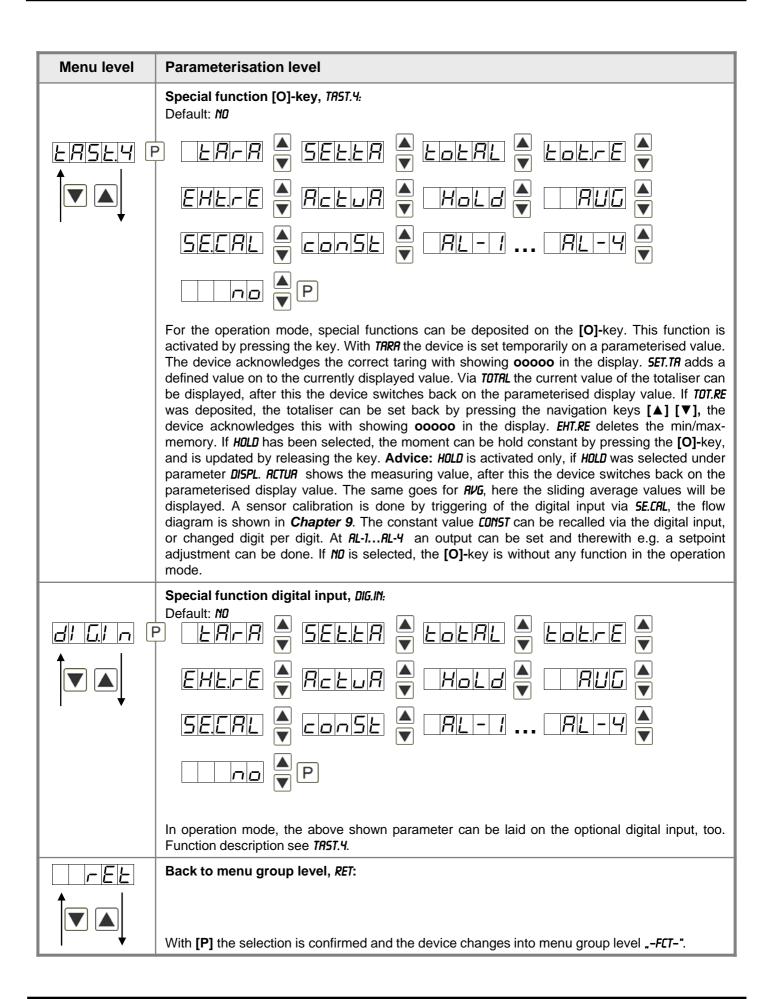


5.4.3. Safety parameters

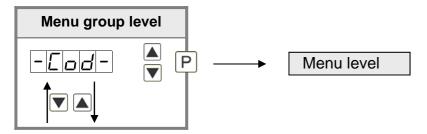


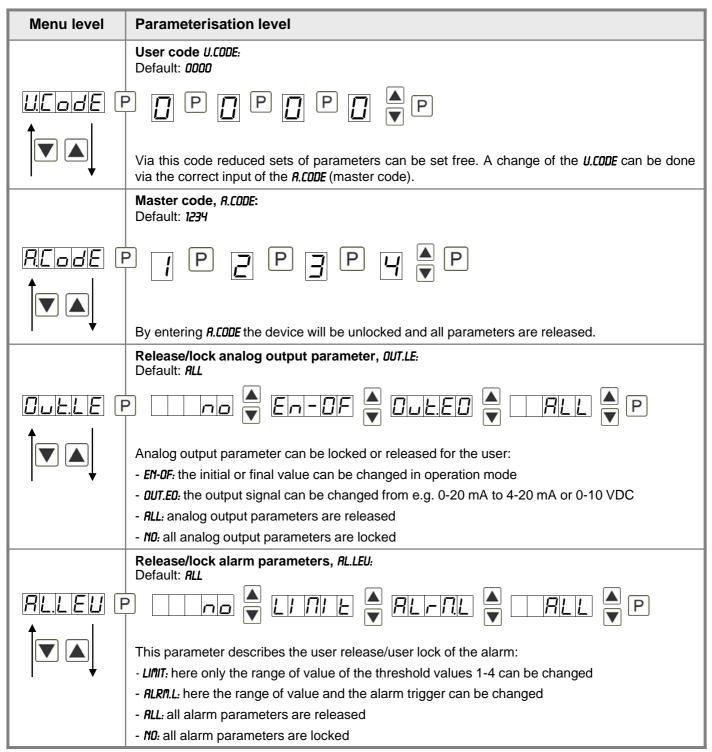


Menu level	Parameterisation level
LEE	Back to menu group level, <i>RET</i> :
	With [P] the selection is confirmed and the device changes into menu group level "- <code>COD-*</code> .


5.4.4. Serial parameters

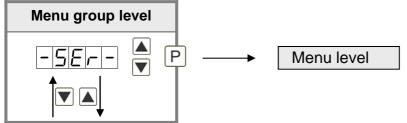


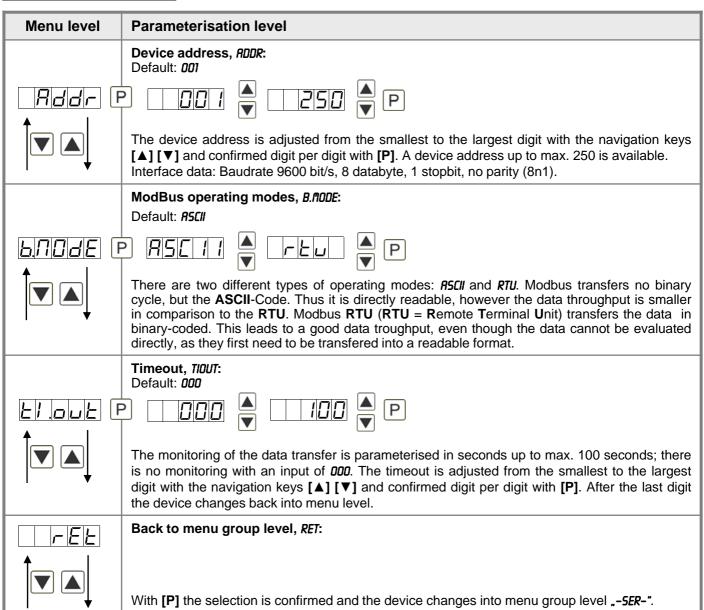


5.4.5. Analog output parameters for analog output 1

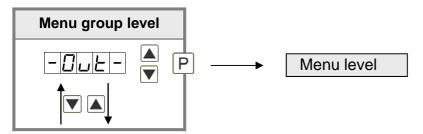


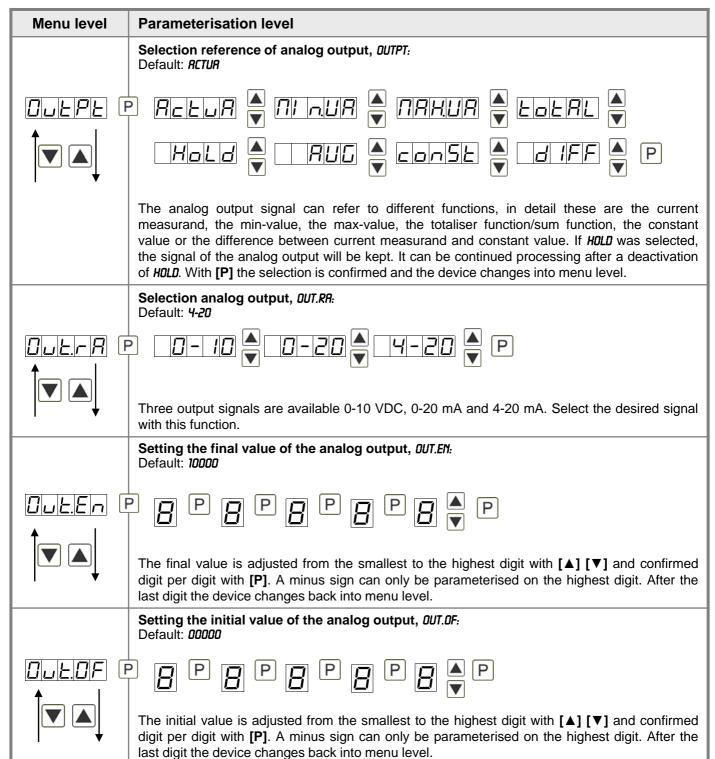


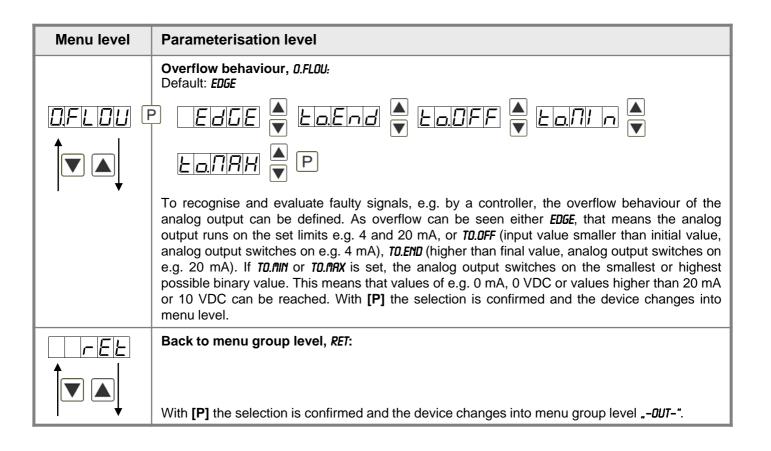


Analog output parameters for analog output 2

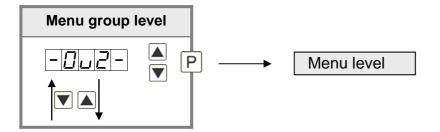


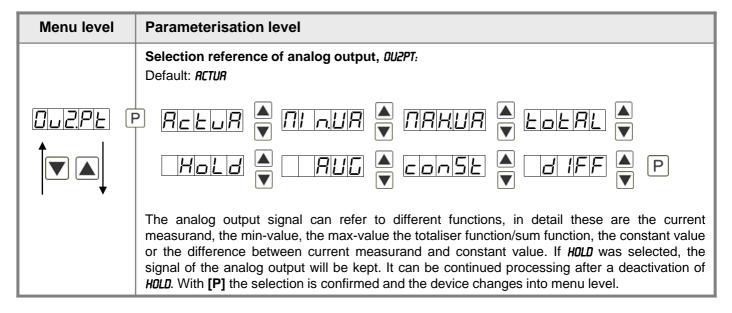


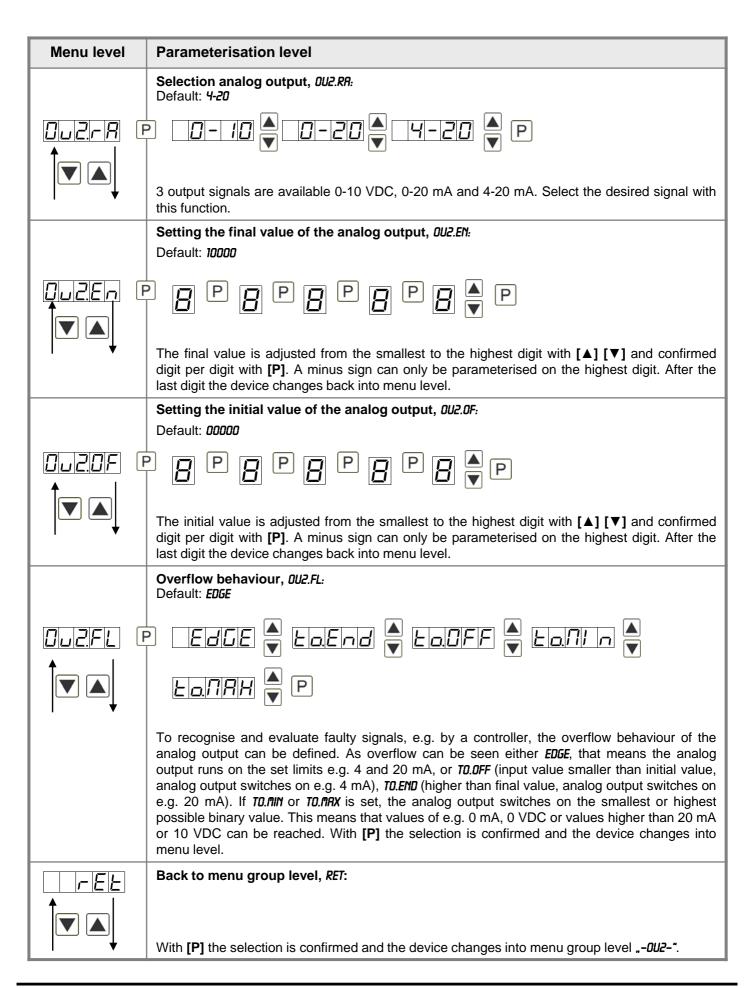


5.4.6. Relay functions

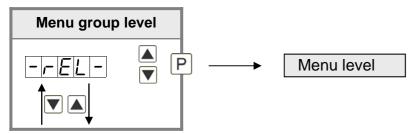


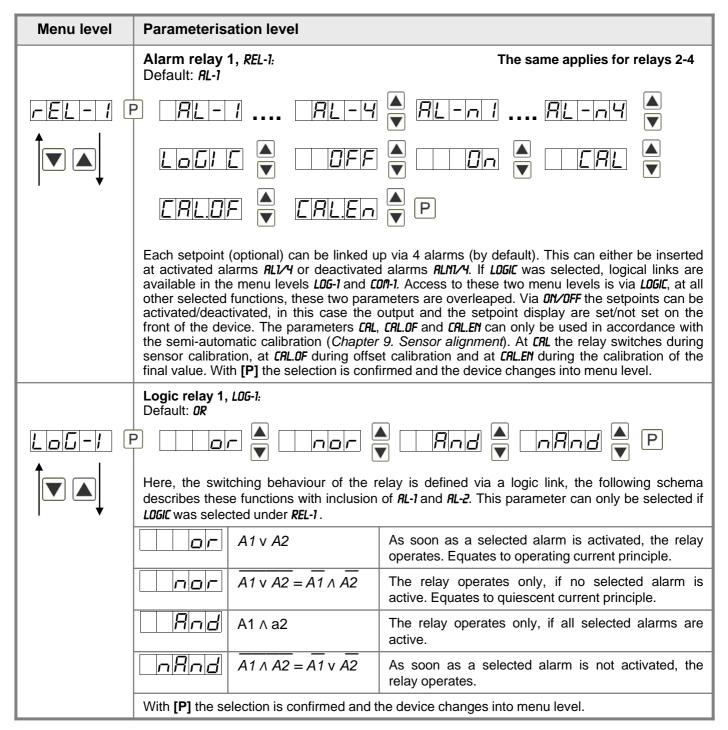


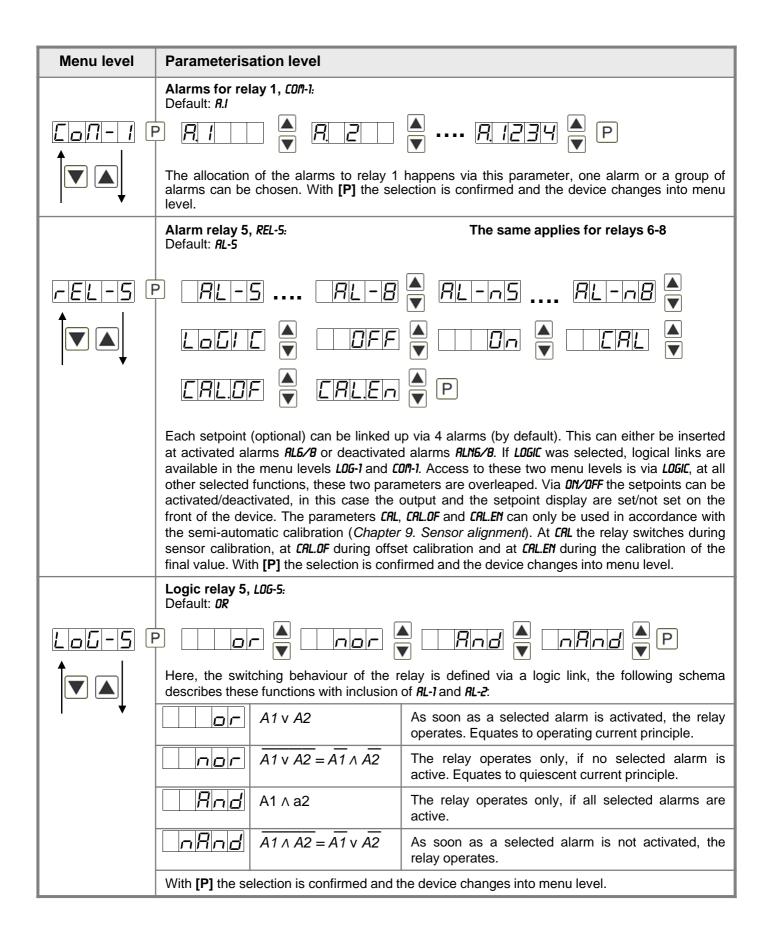


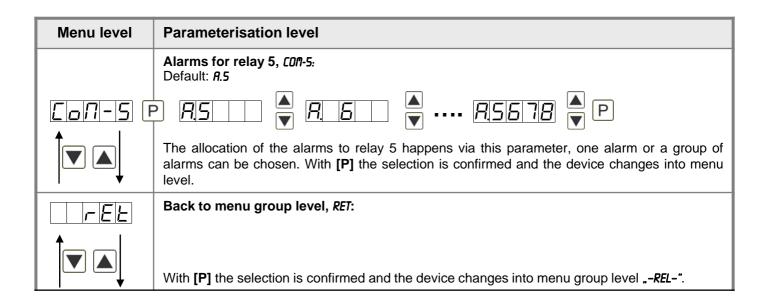

5.4.7. Alarm parameters

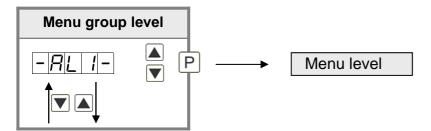


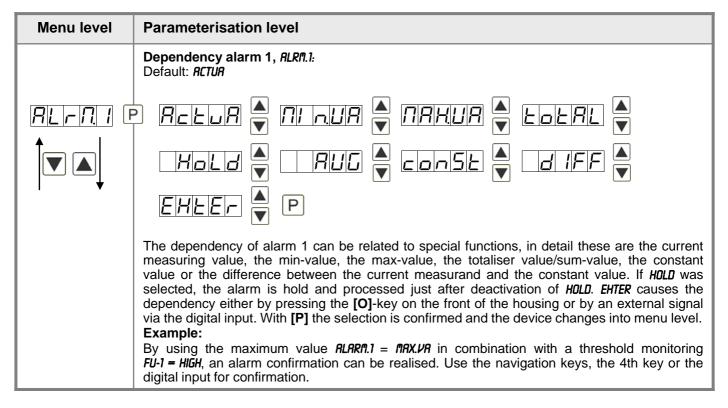


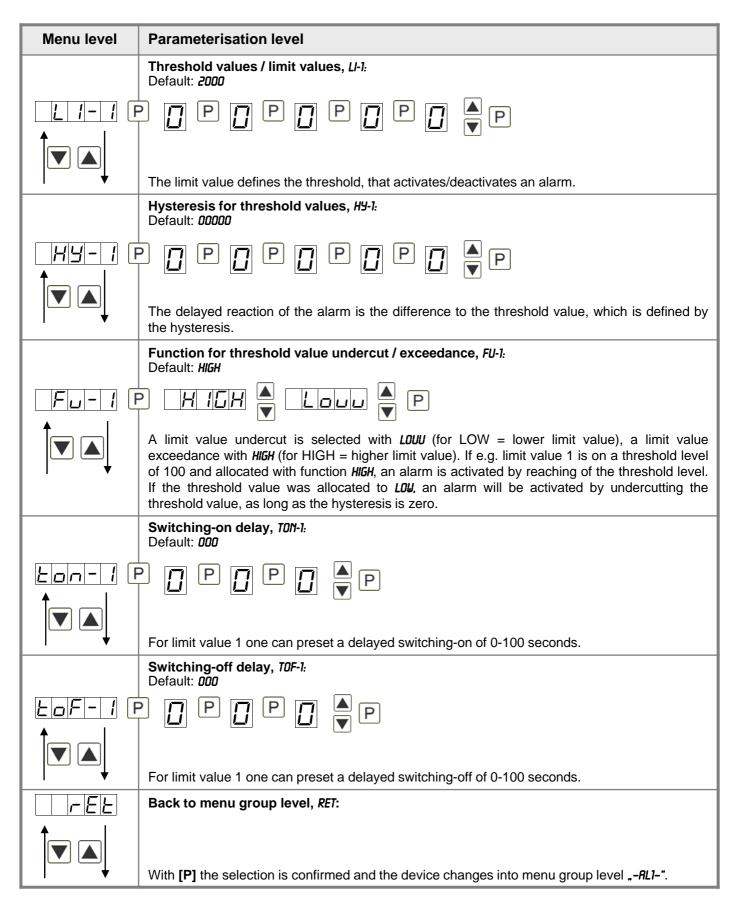


The same applies for *RL2* to *RL8*.


5.4.8. Totaliser (Volume metering)

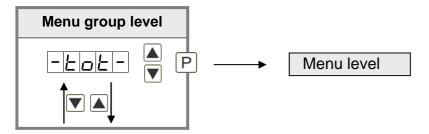

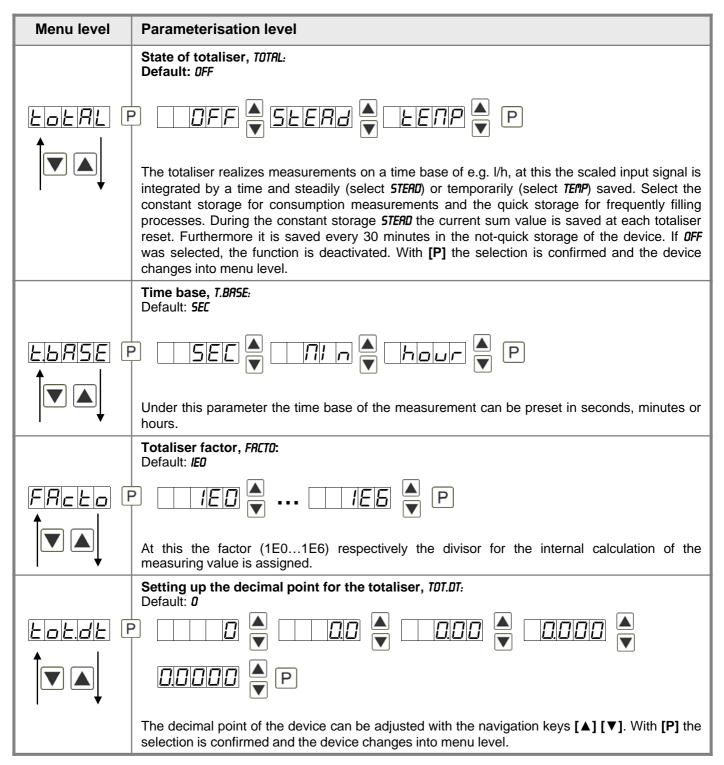

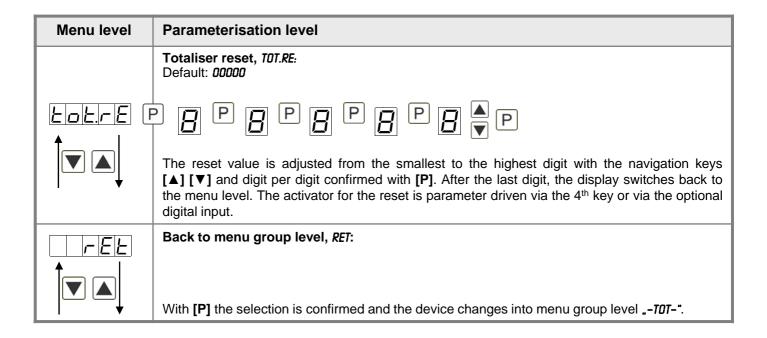

Programming interlock, RUN:

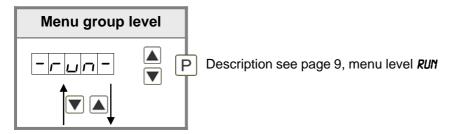

6. Reset to default values

To return the unit to a **defined basic state**, a reset can be carried out to the default values.

The following procedure should be used:

- Switch off the power supply
- Press [P] button
- Switch on voltage supply and press [P]-button until "----" is shown in the display.


With reset, the default values of the program table are loaded and used for subsequent operation. This sets the unit back to the state in which it was supplied.

Caution! All application-related data are lost.

7. Alarms / Relays


This device has 8 virtual alarms that can monitor one limit value in regard of an undercut or exceedance. Each alarm can be allocated to an optional relay output S1-S4; furthermore alarms can be controlled by events like e.g. Hold or min/max-value.

Function principle of alarms / relays						
Alarm / Relay x Deactivated, instantaneous value, min/max-value, hold-value, totalis value, sliding average value, constant value, difference between instantaneous value and constant value or an activation via the digital input						
Switching threshold	Threshold / limit value of the change-over					
Hysteresis	Broadness of the window between the switching thresholds					
Working principle Operating current / quiescent current						

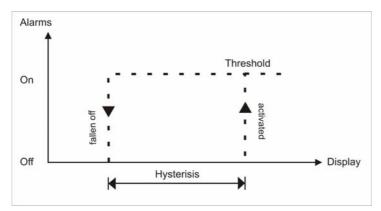


Operating current

By operating current the alarm S1-S2 is **off** below the threshold and **on** on reaching the threshold.

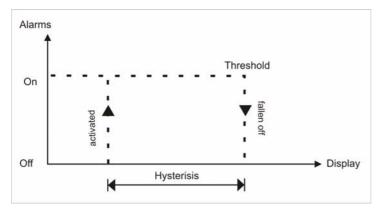

Quiescent current

By quiescent current the alarm S1-S2 is **on** below the threshold and switched **off** on reaching the threshold.

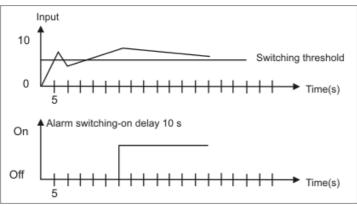

Switching-on delay


The switching-on delay is activated via an alarm and e.g. switched 10 seconds after reaching the switching threshold, a short-term exceedance of the switching value does not cause an alarm, respectively does not cause a switching operation of the relay. The switching-off delay operates in the same way, keeps the alarm / the relay switched longer for the parameterised time.

8. Interfaces

Connection RS232


Digital device M3

PC - 9-pole Sub-D-plug



Connection RS485


Digital device M3



The interface **RS485** is connected via a screened data line with twisted wires (Twisted-Pair). On each end of the bus segment a termination of the bus lines needs to be connected. This is neccessary to ensure a secure data transfer to the bus. For this a resistance (120 Ohm) is interposed between the lines Data B (+) and Data A (–).

9. Sensor alignment offset / final value

The device is equipped with a semi-automatic sensor calibration (5.600, 5.300, 5E.IR, 5E.SR). A switching output operates the trimming resistor, which exists in some sensors. An adjustment of offset and final value takes place, after which the sensor can be used directly. Depending on parameterisation, the calibration can be realized via the 4th key or via the digital input. It is possible to key during the calibration steps. So, reference signals can be connected manually. However the calibration will be interrupted after 30 seconds.

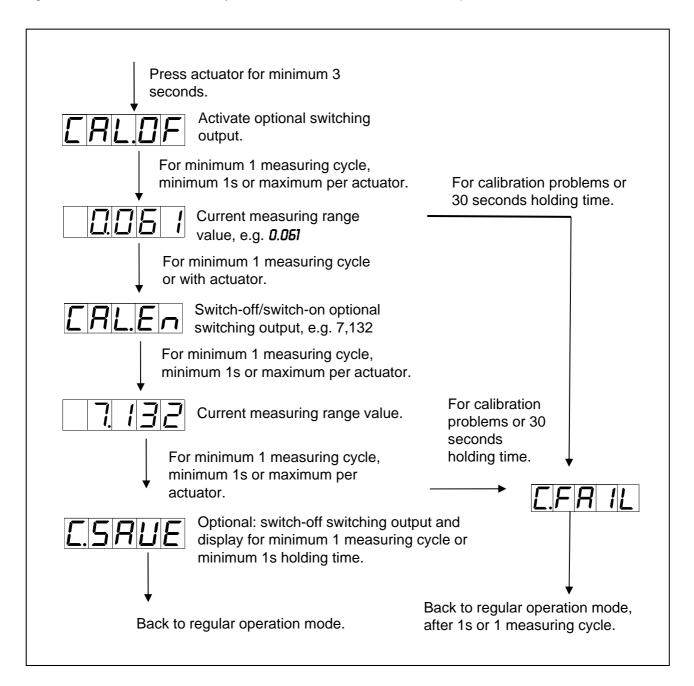

10. Technical data

Housing									
Dimensions	96x48x120 mm (BxHxD)								
	96x48x139 mm (BxHxD) ir	96x48x139 mm (BxHxD) incl. plug-in terminal							
Panel cut-out	92.0 ^{+0.8} x 45.0 ^{+0.6} mm	92.0 ^{+0.8} x 45.0 ^{+0.6} mm							
Wall thickness	up to 10 mm								
Fixing	screw elements								
Material	PC polycarbonate, black, L	JL94V-0							
Sealing material	EPDM, 65 Shore, black								
Protection class	standard IP65 (front), IP00	(back side)							
Weight	approx. 300 g	approx. 300 g							
Connection	plug-in terminal; wire cross	s-section up to 2.5 mm ²							
Display									
Digit height	14 mm	14 mm							
Segment colour	red (optional green, orange	red (optional green, orange or blue)							
Range of display	-19999 to 99999	-19999 to 99999							
Setpoint	one LED per setpoint								
Overflow	horizontal bars at the top								
Underflow	horizontal bars at the bottom								
Display time	0.1 to 10.0 seconds	0.1 to 10.0 seconds							
Input	Ri	Ri Measuring error Digit							
01 AAC TRMS	~ 0.2 Ω	0.5 % of final value	±1						
05 AAC TRMS	~ 0.05 Ω	0.5 % of final value	±1						
0300 VAC TRMS	~ 1 MΩ	~ 1 MΩ 0.5 % of final value ±1							
0600 VAC TRMS	~ 2 MΩ	$\sim 2 \text{ M}\Omega$ 0.5 % of final value ±1							
Digital input	$<$ 2.4 V OFF, 10 V ON, max. 30 VDC R_{l} ~ 5 kΩ								
Accuracy									
Drift of temperature	100 ppm / K	100 ppm / K							
Measuring time	0.110.0 seconds								
Measuring principle	U/F-conversion	U/F-conversion							
Resolution approx. 18 bit at 1 second measuring time									

Output	
Analog output	0/4-20 mA / burden ≤500 Ohm, 0-10 VDC / burden ≥10 kOhm, 16 bit
Switching outputs	
Relay with change-over contact Switching cycles	250 VAC / 5 AAC; 30 VDC / 5 ADC 30 x 10 ⁵ with 5 AAC, 5 ADC ohm resistive burden 10 x 10 ⁶ mechanically Division according to DIN EN 50178 / Characteristics according to DIN EN 60255
PhotoMos-outputs	Closer contacts: 30 VDC/AC, 0.4 A
Interface	
Protocol	Modbus with ASCII or RTU-protocol
RS232	9.600 Baud, no parity, 8 Databit, 1 Stopbit, cable length max. 3 m
RS485	9.600 Baud, no parity, 8 Databit, 1 Stopbit, cable length max. 1000 m
Power supply	100-240 VAC 50/60 Hz, DC ±10% (max. 15 VA)
Memory	EEPROM
Data life	≥ 100 years / 25°C
Ambient conditions	
Working temperature	050°C
Storing temperature	-2080°C
Weathering resistance	relative humidity 0-80% on years average without dew
EMV	EN 61326, EN 55011
CE-sign	Conformity according to directive 2014/30/EU
Safety standard	According to low voltage directive 2014/35/EU EN 61010; EN 60664-1

11. Safety advices

Please read the following safety advices and the assembly *chapter 2* before installation and keep it for future reference.

Proper use

The **IM3-14H-device** is designed for the evaluation and display of sensor signals.



Attention! Careless use or improper operation can result in personal injury and/or cause damage to the equipment.

Control of the device

The panel meters are checked before dispatch and sent out in perfect condition. Should there be any visible damage, we recommend close examination of the packaging. Please inform the supplier immediately of any damage.

Installation

The **IM3-14H-device** must be installed by a suitably **qualified specialist** (e.g. with a qualification in industrial electronics).

Notes on installation

- There must be no magnetic or electric fields in the vicinity of the device, e.g. due to transformers, mobile phones or electrostatic discharge.
- The fuse rating of the supply voltage should not exceed a value of 0.5A N.B. fuse!
- Do not install inductive consumers (relays, solenoid valves etc.) near the device and suppress any interference with the aid of RC spark extinguishing combinations or free-wheeling diodes.
- Keep input, output and supply lines separate from one another and do not lay them parallel with each other. Position "go" and "return lines" next to one another. Where possible use twisted pair. So, you receive best measuring results.
- Screen off and twist sensor lines. Do not lay current-carrying lines in the vicinity. Connect the **screening on one side** on a suitable potential equaliser (normally signal ground).
- The device is not suitable for installation in areas where there is a risk of explosion.
- Any electrical connection deviating from the connection diagram can endanger human life and/or can destroy the equipment.
- The terminal area of the devices is part of the service. Here electrostatic discharge needs to be avoided. Attention! High voltages can cause dangerous body currents.
- Galvanic isolated potentials within one complex need to be placed on an appropriate point (normally earth or machines ground). So, a lower disturbance sensibility against impacted energy can be reached and dangerous potentials, that can occur on long lines or due to faulty wiring, can be avoided.

12. Error elimination

	Error description	Measures
1.	The unit permanently indicates overflow.	 The input has a very high measurement, check the measuring circuit. With a selected input with a low voltage signal, it is only connected on one side or the input is open. Not all of the activated setpoints are parameterised. Check if the relevant parameters are adjusted correctly.
2.	The unit permanently shows underflow.	 The input has a very low measurement, check the measuring circuit. With a selected input with a low voltage signal, it is only connected on one side or the input is open. Not all of the activated setpoints are parameterised. Check if the relevant parameters are adjusted correctly.
3.	The word <i>HELP</i> lights up in the 7-segment display.	The unit has found an error in the configuration memory. Perform a reset on the default values and reconfigure the unit according to your application.
4.	Program numbers for parameterising of the input are not accessible.	Programming lock is activated Enter correct code
5.	ERR1 lights up in the 7-segment display	Please contact the manufacturer if errors of this kind occur.
6.	The device does not react as expected.	• If you are not sure that the device has been parameterised before, then follow the steps as written in <i>chapter 6</i> and set it back to its delivery status.