

Submersible pressure sensor High-performance Model LH-20





FM

Applications

- Deep well and borehole measurements
- Groundwater monitoring
- Level measurement in open bodies of water
- Sewage lift and pumping stations
- Settling ponds and rainwater basins

Special features

- Slimline design
- Scalable measuring range (option)
- Resistant against the harshest environmental conditions
- Reliable and secure by double-sealed design
- Titanium case for especially high resistance (option)



Submersible pressure sensor model LH-20 Fig. left: Stainless steel Fig. right: Titanium

Description

For the most demanding measurement tasks

The model LH-20 submersible pressure sensor has been designed for the most demanding of level measurement tasks. A slimline design, highest accuracies, low temperature errors and an adjustable measuring range ensure the suitability of the LH-20 for all submerged level measurements.

The model LH-20 submersible pressure sensor can adapt to countless applications and measuring media through a large number of features and options. Depending on the requirements, this submersible pressure sensor is available with, amongst other things, a titanium case, PUR/PE/ FEP cable, 0.1 % accuracy, HART[®], scalability or parallel temperature output signal.

For operation in hazardous environments, the model LH-20 submersible pressure sensor is also available in an intrinsically safe version. For potable and fresh water

WIKA data sheet PE 81.56 · 03/2018

applications, a drinking water conformant product variant is possible in accordance with KTW and ACS.

Hermetically sealed, robust and durable

The model LH-20 submersible pressure sensor has been engineered for use in the harshest environments. Through a double, redundant sealing concept, it is permanently hermetically sealed. A robust design from stainless steel or titanium, with a spring-reinforced cable seal, ensures a long service life, even under the big mechanical loads of installation and continuous use.

Designs with the highest media resistance using FEP cable and titanium cases, along with the integrated lightning protection, guarantee the longevity of the submersible pressure sensor even under the most adverse environmental influences in aggressive media, in both indoor and outdoor use.

Page 1 of 10



WIKA data sheet PE 81.56

Measuring ranges

Gauge	pressure					
bar	Measuring range	0 0.1	0 0.16	0 0.25	00.4	0 0.6
	Overload safety	15	20	30	30	35
	Measuring range	0 1	0 1.6	0 2.5	0 4	0 6
	Overload safety	35	50	50	65	90
	Measuring range	0 10	0 16	0 25		
	Overload safety	90	130	130		
inWC	Measuring range	0 50	0 100	0 150	0 250	
	Overload safety	8,000	12,000	12,000	14,000	
psi	Measuring range	0 5	0 10	0 15	0 25	0 50
	Overload safety	400	500	700	700	900
	Measuring range	0 100	0 160	0 200	0 300	
	Overload safety	1,300	1,900	1,900	1,900	
mH_2O	Measuring range	0 1	0 1.6	0 2.5	0 4	0 6
	Overload safety	150	200	300	300	350
	Measuring range	0 10	0 16	0 25	0 40	0 60
	Overload safety	350	500	500	650	900
	Measuring range	0 100	0 160	0 250		
	Overload safety	900	1,300	1,300		

Absolute pressure						
bar	Measuring range	0 1.6	0 2.5	0 4	0 6	0 10
	Overload safety	50	50	60	90	90
	Measuring range	0 16	0 25			
	Overload safety	130	130			

The given measuring ranges are also available in mbar, kPa and MPa.

Output signals

Output signals				
Standard	4 20 mA			
Option	4 20 mA and HART [®] signal, additional Pt100 measuring signal			

Load in $\boldsymbol{\Omega}$

The load depends on the selected output signal and measuring deviation (see page 3).

- 4 ... 20 mA with measuring deviation 0.1 %: ≤ (power supply 9.6 V) / 0.022 A
- 4 ... 20 mA with measuring deviation 0.2 %: ≤ (power supply 8 V) / 0.022 A
- 4 ... 20 mA and HART[®] signal: ≤ (power supply 9.6 V) / 0.022 A

Voltage supply

Power supply

The power supply depends on the selected output signal and measuring deviation (see page 3).

- 4 ... 20 mA with measuring deviation 0.1 %: DC 9.6 ... 30 V
- 4 ... 20 mA with measuring deviation 0.2 %: DC 8 ... 30 V
- 4 ... 20 mA and HART[®] signal: DC 9.6 ... 30 V

When being operated in hazardous areas, the submersible pressure sensor must be powered via a repeater power supply (see "Accessories").

Additional Pt100 measuring element

The HART® version has an additional Pt100 measuring element for measuring the medium temperature.

- Pt100 per DIN EN 60751
- Measuring range -50 ... +100 °C [-58 ... +212 °F]
- Resolution of 1 °K

Reference conditions

Temperature 15 ... 25 °C [59 ... 77 °F]

Atmospheric pressure 860 ... 1,060 mbar [86 ... 106 kPa /12.5 ... 15.4 psig]

Humidity 45 ... 75 % r. h.

Mounting position

Calibrated in vertical mounting position, with process connection facing downwards.

Accuracy specifications

Measuring deviation at reference conditions

Measuring deviation			
Standard	$\leq \pm 0.2$ % of span		
Option	$\leq \pm 0.1$ % of span		

By setting a turndown of greater than 5:1, a higher measuring deviation applies. Measuring deviation determined using the limit point method per IEC 60770.

Temperature error of the zero point in the temperature range 0 ... 80 °C [32 ... 176 °F]

- with measuring deviation $\leq \pm 0.2$ % of span
 - Standard, without turndown $\leq \pm 0.15$ % of span/10 K
 - Turndown \leq 5:1 $\leq \pm 0.20$ % of span/10 K
 - Turndown > 5:1 $\leq \pm 0.25$ % of span/10 K
- with measuring deviation ≤ ±0.1 % of span
 - Standard, without turndown $\leq \pm 0.05$ % of span/10 K
 - Turndown \leq 5:1 $\leq \pm 0.10$ % of span/10 K
 - Turndown > 5:1 $\leq \pm 0.15$ % of span/10 K

Long-term drift

 $\leq \pm 0.1$ % of span/year

Settling time (0 ... 63 %)

Depending on the output signal the following settling times apply:

- 4 ... 20 mA: 100 ms
- 4 ... 20 mA, HART[®] signal: 200 ms

Scalability (turndown)

The HART[®] version enables scaling of the measuring range (turndown).

It is recommended that turndown is not set to over 5:1, since the accuracy can decrease dependant on the scaling.

Operating conditions

Ingress protection (per IEC 60529) IP68

Immersion depth

to 250 m [820 ft]

Vibration resistance (per IEC 60068-2-6)

4 g (at 5 ... 100 Hz)

Lightning protection

Nominal discharge current \ge 5 kA, response time < 25 ns

Temperatures

The permissible temperature ranges are dependent on the cable material used:

Medium:	PE cable: PUR cable: FEP cable:	-40 +60 °C [-40 +140 °F] -40 +80 °C [-40 +176 °F] -40 +80 °C [-40 +176 °F]
Ambient:	PE cable: PUR cable: FEP cable:	-40 +60 °C [-40 +140 °F] -40 +85 °C [-40 +185 °F] -40 +85 °C [-40 +185 °F]
Storage:	PE cable: PUR cable: FEP cable:	-40 +80 °C [-40 +176 °F] -40 +80 °C [-40 +176 °F] -40 +80 °C [-40 +176 °F]

Maximum tension force on the cable

1,200 N [270 lbf]

Weight

- Submersible pressure sensor: approx. 370 g
- Cable: approx. 100 g/m [1.08 oz/ft]

Explosion protection (option)

Ignition	Ignition protection types				
ATEX	II 1G Ex ia IIC T6 Ga II 2G Ex ia IIC T6 Gb				
FM	IS class I, div. 1, groups A, B, C, D Class II, div. 1, groups E, F, G Class III, T6. Type 4X/6P Class I zone 0 AEx ia IIC				
CSA	Class I, div. 1, groups A, B, C, D Class II, div. 1, groups E, F, G Class III, T6. Encl. Type 4X Ex ia IIC				

Ambient temperature ranges

- ATEX for use as category 1G / Ga equipment (for zone 0) Ambient: Temperature class T6: -20 ... +50 °C [-4 ... +122 °F] Temperature class T1 ... T5: -20 ... +60 °C [-4 ... +140 °F]
- ATEX for use as category 2G / Gb equipment (for zone 1) Ambient: Temperature class T6: -40 ... +66 °C [-40 ... +150 °F] Temperature class T1 ... T5: -40 ... +80 °C [-40 ... +176 °F]
- CSA (Ex) Ambient: Temperature class T6: -40 ... +60 °C [-40 ... +140 °F] Temperature class T1 ... T4: -40 ... +80 °C [-40 ... +176 °F]
- FM (Ex) Ambient: Temperature class T6: -40 ... +60 °C [-40 ... 140 °F] Temperature class T1 ... T4: -40 ... +80 °C [-40 ... 176 °F]

Process connections

The model LH-20 is available in two process connection variants:

Process connections				
Standard	M14 x 1 with protective cap			
Option	Flush measuring cell			

Electrical connections

Reverse polarity protection

U+ vs. U-

Overvoltage protection

see lightning protection under "Operating conditions"

Cable lengths

Cable length to customer requirements, freely selectable

Connection diagrams

Cable outlet			
	U+	brown	
	U-	blue	
	Shield	black sheathed cable	

Pt100 measuring element (4-wire connection)				
[_] 1	1	white		
	2	yellow		
2	3	red		
L (); 4	4	black		

Materials (wetted)

	Standard	Option
Case	Stainless steel 316L	Titanium 1)
Cable material	PUR	PE, FEP
Sealing material ²⁾	FKM	EPDM

Not available in intrinsically safe version.
 The model LH-20 is double sealed behind the sensor.

Sensor

Ceramic Al₂O₃ 96 %

Titanium for especially high resistance (option)

· A second For a particularly high resistance against aggressive media, the model LH-20 submersible pressure sensor is available with a titanium case.

This exceptionally high-quality material enables the submersible pressure sensor to be used under the most adverse conditions.

The highly chemically-resistant titanium design ensures a long service life, even in aggressive media and the most demanding applications.

Approvals

Logo	Description	Country
CE	 EU declaration of conformity EMC directive EN 61326 emission (group 1, class B) and immunity (industrial application) RoHS directive ATEX directive (option) Hazardous areas 	European Union
(Ex)	- Ex i Zone 1 gas [II 2G Ex ia IIC T6 Gb] Zone 0 gas [II 1G Ex ia IIC T6 Ga]	
APPRIVED	FM (option) Intrinisically safe apparatus for use in: Class I, division 1 or 2, groups A, B, C, D Class II, division 1 or 2, groups E, F, G Class III, division 1 or 2, in accordance with control drawing Equipment protection by intrisic safety AEx ia for use in: Class I, zone 0, zone 1 or zone 2, group IIC in accordance with control drawing Nonincendive apparatus for use in: Class I, division 2, groups A, B, C, D Nonincendive for use in: Class I, zone 2, group IIC hazardous (classified) location, type 4X/6P and IP68	USA
(\$ P	CSA (option) Class I, division 1, groups A, B, C, D Class II, division 2, groups E, F, G Class III, T6. Encl. Type 4X Ex ia IIC	Canada
EAC	EAC EMC directive	Eurasian Economic Community
C	GOST Metrology, measurement technology	Russia
œ	BelGIM Metrology, measurement technology	Belarus
◙	UkrSEPRO Metrology, measurement technology	Ukraine
	DNOP (MakNII) Mining Hazardous areas	Ukraine
DNV-GL DNV-COLU	DNV GL (option) Ships, shipbuilding (e.g. offshore)	International
-	CRN Safety (e.g. electr. safety, overpressure,)	Canada


Certificates (option)


- Drinking water declaration of conformity in accordance with KTW and ACS ¹)
- Test report ²⁾

Only available in combination with PE cable and not available in intrinsically safe version
 The test report documents the product-specific instrument specifications and include a detailed listing of the single measured values of the acceptance test.

Approvals and certificates, see website

Dimensions in mm [in]

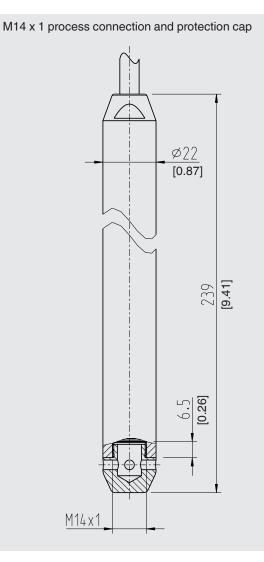

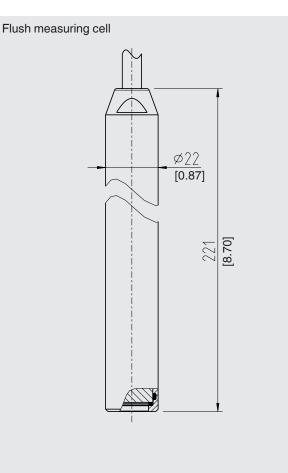

Accessories

	Description	Order nur	nber
	Cable strain relief clamp The cable strain relief clamp ensures easy and secure mechanical fastening of the submersible pressure sensor's cable. It serves to guide the cable to prevent mechanical damage and to reduce the action of tensile stresses.	14052336	
•	 Additional weight The additional weight increases the dead weight of the submersible pressure sensor. It simplifies the lowering in monitoring wells, narrow shafts and deep wells. It effectively reduces negative environmental influences of the measuring medium (e.g. turbulent flows) on the measuring result. The additional weight is available in two versions: Stainless steel 316L, approx. 350 g [12.3 oz], length 120 mm [4.7 in] Titanium, approx. 350 g [12.3 oz], length 214.5 mm [8.4 in] It is recommended that the design of the additional weight is selected in line with the case material of the submersible pressure sensor. 	14052322 14052330	(316L) (titanium)
unca L.C.M.	Terminal box The terminal box, with IP67 ingress protection and waterproof ventilation element, provides a moisture-free electrical termination for the submersible pressure sensor. It should be mounted in a dry environment, outside any shafts or vessels, or directly in the switch cabinet.	14052339	
	Intrinsically safe repeater power supply, model IS Barrier Input 0/4 20 mA, supplying and non-supplying Bidirectional HART [®] signal transmission For details see data sheet AC 80.14	14117118	
	Display module DIH52 and DIH62 5-digit display, 20-segment bar graph, without separate power supply, with additional HART® functionality. Automatic adjustment of measuring range and span. "Secondary-master" functionality: Setting the measuring range and unit of the connected transmitter using HART® standard commands possible. Optionally explosion protection per ATEX	on request	
A REAL	HART® modem with USB, RS-232 or Bluetooth® interface For scaling the measuring range using a PC via the HART® protocol, a HART® modem with USB, RS-232 or Bluetooth® interface is available. The modem communicates with all registered HART® field instruments and can be used with the most popular HART®- compatible software programs.	7957522 11025166 11364254	(RS-232 interface) (USB interface) (Bluetooth® interface)

Ordering information

Model / Measuring range / Output signal / Accuracy / Cable material / Cable length / Case / Process connection / Sealing / Approval / Certificate / Accessories

© 11/2012 WIKA Alexander Wiegand SE & Co. KG, all rights reserved. The specifications given in this document represent the state of engineering at the time of publishing. We reserve the right to make modifications to the specifications and materials.

WIKA data sheet PE 81.56 · 03/2018



SCHNEIDER MESSTECHNIK

ICS Schneider Messtechnik GmbH Briesestrasse 59 D-16562 Hohen Neuendorf / OT Bergfelde Tel.: +49 3303 5040-66 Fax: +49 3303 5040-68 E-Mail: info@ics-schneider.de



WIKA Alexander Wiegand SE & Co. KG Alexander-Wiegand-Straße 30 63911 Klingenberg/Germany Tel. +49 9372 132-0 Fax +49 9372 132-406 info@wika.de www.wika.de

Page 10 of 10